

SW 186
HAND DELIVERED

AUG 18 2011 400⁵⁰

UTAH DIVISION OF
SOLID & HAZARDOUS WASTE

2011.01916

**APPLICATION TO RENEW A PERMIT TO
OPERATE A CLASS I LANDFILL**

Prepared for:

**EMERY COUNTY LANDFILL
Castle Dale, Utah**

Prepared by

IGES, INC.
4153 Commerce Drive
Salt Lake City, Utah 84107

August 17, 2011



Utah Division of Solid and Hazardous Waste

Solid Waste Management Program

Mailing Address
P O. Box 144880
Salt Lake City, Utah 84114-4880

Office Location
195 North 1950 West
Salt Lake City, Utah 84116

Phone (801) 536-0200
Fax (801) 536-0222
www.deq.utah.gov

APPLICATION FOR A PERMIT TO OPERATE A CLASS I OR CLASS V LANDFILL

Please read the instructions that are found in the document, INSTRUCTIONS FOR APPLICATION FOR A PERMIT TO OPERATE A CLASS I OR CLASS V LANDFILL. This application form shall be used for all Class I or V solid waste disposal facility permits and modifications. Part I GENERAL INFORMATION must accompany a permit application. Part II, APPLICATION CHECKLIST, is provided to assist applicants and, if included with the application, will assist review. Part II is provided to assist in preparation and review of a permit application, it is not rule. The text of the rule governs all permit application contents and should be consulted when questions arise.

Please note the version date of this form found on the lower right of the page; if you have received this form more than six months after this date it is recommended you contact our office at (801) 536-0200 to determine if this form is still current. When completed, please return this form and support documents, forms, drawings, and maps to:

Scott T. Anderson, Director
Division of Solid and Hazardous Waste
Utah Department of Environmental Quality
PO Box 144880
Salt Lake City, Utah 84114-4880

(Note: When the application is determined to be complete, submittal of two copies of the complete application will be required.)

Utah Class I and V Landfill Permit Application Form

Part I General Information APPLICANT: PLEASE COMPLETE ALL SECTIONS.					
I. Landfill Type	<input checked="" type="checkbox"/> Class I <input type="checkbox"/> Class V	II. Application Type	<input type="checkbox"/> New Application <input checked="" type="checkbox"/> Renewal Application	<input type="checkbox"/> Facility Expansion <input checked="" type="checkbox"/> Modification	
For Renewal Applications, Facility Expansion Applications and Modifications Enter Current Permit Number <u>9427</u>					
III. Facility Name and Location					
Legal Name of Facility Emery County Landfill					
Site Address (street or directions to site) off road 550 West, 2.4 miles N of SR29, then S 0.7 miles on LF Rd				County Emery	
City Castle Dale		Zip Code 84513		Telephone (435) 381-5450	
Township 18 S	Range 8 E	Section(s) 16	Quarter/Quarter Section SE	Quarter Section SE	
Main Gate Latitude degrees 39 minutes 15 seconds 44			Longitude degrees 111 minutes 1 seconds 44		
IV. Facility Owner(s) Information					
Legal Name of Facility Owner Emery County					
Address (mailing) PO Box 889					
City Castle Dale		State UT		Zip Code 84513	
Telephone (435) 381-5450					
V. Facility Operator(s) Information					
Legal Name of Facility Operator Emery County					
Address (mailing) PO Box 889					
City Castle Dale		State UT		Zip Code 84513	
Telephone (435) 381-5450					
VI. Property Owner(s) Information					
Legal Name of Property Owner Emery County					
Address (mailing) PO Box 889					
City Castle Dale		State UT		Zip Code 84513	
Telephone (435) 381-5450					
VII. Contact Information					
Owner Contact Wayde Nielsen			Title Road Supervisor/Landfill Manager		
Address (mailing) PO Box 889					
City Castle Dale		State UT		Zip Code 84513	
Telephone 435 381 5450					
Email Address wayde@co.emery.ut.us			Alternative Telephone (cell or other) 435.749.7090		
Operator Contact Wayde Nielsen			Title Road Supervisor/Landfill Manager		
Address (mailing) PO Box 889					
City Castle Dale		State UT		Zip Code 84513	
Telephone (435) 381-5450					
Email Address wayde@co.emery.ut.us			Alternative Telephone (cell or other) 435.749.7090		
Property Owner Contact Wayde Nielsen			Title Road Supervisor/Landfill Manager		
Address (mailing) PO Box 889					
City Castle Dale		State UT		Zip Code 84513	
Telephone (435) 381-5450					

Utah Class I and V Landfill Permit Application Form

Part I General Information (Continued)

VIII. Waste Types (check all that apply)

<input type="checkbox"/> All non-hazardous solid waste (see R315-315-7(3) for PCB special requirements) OR the following specific waste types:		
Waste Type	Combined Disposal Unit	Monofill Unit
<input checked="" type="checkbox"/> Municipal Waste	<input checked="" type="checkbox"/>	<input type="checkbox"/>
<input checked="" type="checkbox"/> Construction & Demolition	<input checked="" type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Industrial	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Incinerator Ash	<input type="checkbox"/>	<input type="checkbox"/>
<input checked="" type="checkbox"/> Animals	<input checked="" type="checkbox"/>	<input type="checkbox"/>
<input checked="" type="checkbox"/> Asbestos	<input checked="" type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> PCB's (R315-315-7(3) only)	<input type="checkbox"/>	<input type="checkbox"/>
<input type="checkbox"/> Other _____	<input type="checkbox"/>	<input type="checkbox"/>

IX. Facility Area

Facility Area.....	<u>221</u>	acres
Disposal Area.....	<u>64</u>	acres
Design Capacity		
Years.....	<u>63</u>	
Cubic Yards.....	<u>2,790,000</u>	
Tons.....	<u>1,674,000</u>	

X. Fee and Application Documents

Indicate Documents Attached To This Application

Application Fee: Amount \$

Class V Special Requirements

- | | | | |
|--|--|---|---|
| <input checked="" type="checkbox"/> Facility Map or Maps | <input checked="" type="checkbox"/> Facility Legal Description | <input checked="" type="checkbox"/> Plan of Operation | <input checked="" type="checkbox"/> Waste Description |
| <input type="checkbox"/> Ground Water Report | <input checked="" type="checkbox"/> Closure Design | <input checked="" type="checkbox"/> Cost Estimates | <input checked="" type="checkbox"/> Financial Assurance |

Documents required by UCA 19-6-108(9) and (10)

I HEREBY CERTIFY THAT THIS INFORMATION AND ALL ATTACHED PAGES ARE CORRECT AND COMPLETE.

Signature of Authorized Owner Representative

Wayde S. Nielsen

 Name typed or printed
 Wayde S. Nielsen

Title

Landfill Manager

Date

Oct. 11, 2011

Address

300 W. SR29 Castle Dale UT 84513

Signature of Authorized Land Owner Representative (if applicable)

 Name typed or printed

Title

Date

Address

Name typed or printed

Signature of Authorized Operator Representative (if applicable)

 Name typed or printed

Title

Date

Address

Name typed or printed

Email Address wayde@co.emery.ut.us

Alternative Telephone (cell or other)

435.749.7090

Utah Class I and V Permit Application Checklist

Important Note: The following checklist is for the permit application and addresses only the requirements of the Division of Solid and Hazardous Waste. Other federal, state, or local agencies may have requirements that the facility must meet. The applicant is responsible to be informed of, and meet, any applicable requirements. Examples of these requirements may include obtaining a conditional use permit, a business license, or a storm water permit. The applicant is reminded that obtaining a permit under the *Solid Waste Permitting and Management Rules* does not exempt the facility from these other requirements. Please take note of the heading of each section for the facilities that the section applies to.

An application for a permit to construct and operate a landfill is the documentation that the landfill will be located, designed, constructed, operated, and closed in compliance with the requirements of Rules R315-302, R315-303, R315-308, R315-309, and R315-315 of the *Utah Solid Waste Permitting and Management Rules* and the *Utah Solid and Hazardous Waste Act* (UCA 19-6-101 through 123). The application should be written to be understandable by regulatory agencies, landfill operators, and the general public. The application should also be written so that the landfill operator, after reading it, will be able to operate the landfill according to the requirements with a minimum of additional training.

Copies of the *Solid Waste Permitting and Management Rules*, the *Utah Solid and Hazardous Waste Act*, along with many other useful guidance documents can be obtained by contacting the Division of Solid and Hazardous Waste at 801-536-0200. Most of these documents are available on the Division's web page at www.hazardouswaste.utah.gov. Guidance documents can be found at the solid waste section portion of the web page.

When the application is determined to be complete, the original complete application and one copy of the complete application are required along with an electronic copy.

Part II Application Checklist

I. Facility General Information	
Description of Item	Location In Document
Ia. Information Required - All Class I and V Landfills	
Completed Part I General information Form (See form above)	Part 1
General description of the facility (R315-310-3(1)(b))	Part 1b
Legal description of property (R315-310-3(1)(c))	Part II, Sec. 1.0
Proof of ownership, lease agreement, or other mechanism (R315-310-3(1)(c))	Part II, Sec. 2.0 and Appendix B
Area served by the facility including population (R315-310-3(1)(d))	Part II, Sec. 1.1
If the permit application is for a class I landfill a demonstration that the landfill is not a commercial facility	Part I, III-VI
Waste type and anticipated daily volume (R315-310-3(1)(d))	Part II Sec. 3 and Part III sec. 2.2
Ib. Information Required - All New Or Laterally Expanding Class I and V Landfills	
Intended schedule of construction (R315-302-2(2)(a))	Part II Sec. 3.1
Name and address of all property owners within 1000 feet of the facility boundary (R315-310-3(2)(a)(i))	Part Ib
Documentation that a notice of intent to apply for a permit has been sent to all property owners listed above (R315-310-3(2)(ii))	Part Ib
Name of the local government with jurisdiction over the facility site (R315-310-	Part II Sec. 1.1

Utah Class I and V Permit Application Checklist

I. Facility General Information	
Description of Item	Location In Document
3(2)(iii))	
Ic. Location Standards - All New Or Laterally Expanding Class I and V Landfills (R315-302-1)	
Documentation that the facility has meet the historical survey requirement of R315-302-1(2)(f)	Appendix F
Land use compatibility (R315-302-1(2)(a))	
Maps showing the existing land use, topography, residences, parks, monuments, recreation areas or wilderness areas within 1000 feet of the site boundary	Appendix A
Certifications that no ecologically or scientifically significant areas or endangered species are present in site area	Appendix F
List of airports within five miles of facility and distance to each	Appendix F
Geology (R315-302-1(2)(b))	
Geologic maps showing significant geologic features, faults, and unstable areas	Part III, sec 2.1.2
Maps showing site soils	Part III, sec 1.1.2
Surface water (R315-302-1(2)(c))	
Magnitude of 24 hour 25 year and 100 year storm events	Part III, sec 2.5
Average annual rainfall	Part III, sec 1.1.4
Maximum elevation of flood waters proximate to the facility	Part III, sec 2.1.3
Maximum elevation of flood water from 100 year flood for waters proximate to the facility	Part III, sec 2.1.3
Wetlands (R315-302-1(2)(d))	Part III, sec 2.1.4
Ground water (R315-302-1(2)(e))	Part III, sec 2.1.5.1
Id. Plan of Operations Requirements - All Class I And V Landfills (R315-310-3(1)(e) and R315-302-2(2))	
Forms and other information as required in R315-302-2(3) including a description of on-site waste handling procedures and an example of the form that will be used to record the weights or volumes of waste received (R315-302-2(2)(b) And R315-310-3(1)(f))	Part II, sec 3.2 and 3.11 Appendix C
Schedule for conducting inspections and monitoring, and examples of the forms that will be used to record the results of the inspections and monitoring (R315-302-2(2)(c), R315-302-2(5)(a), and R315-310-3(1)(g))	Part II, sec 3.3 Appendix C
Contingency plans in the event of a fire or explosion (R315-302-2(2)(d))	Part II, sec 3.5.1 & 3.5.2
Corrective action programs to be initiated if ground water is contaminated (R315-302-2(2)(e))	Part II, sec 3.5.5
Contingency plans for other releases, e.g. explosive gases or failure of run-off collection system (R315-302-2(2)(f))	Part II, sec 3.5.3 and 3.5.4

Utah Class I and V Permit Application Checklist

I. Facility General Information	
Description of Item	Location In Document
Plan to control fugitive dust generated from roads, construction, general operations, and covering the waste (R315-302-2(2)(g))	Part II, sec 3.8.6
Plan for litter control and collection (R315-302-2(2)(h))	Part II, sec 3.8.7
Description of maintenance of installed equipment (R315-302-2(2)(i))	Part II, sec 3.7
Procedures for excluding the receipt of prohibited hazardous or PCB containing wastes (R315-302-2(2)(j))	Part II, sec 3.3.1 and 3.3.2
Procedures for controlling disease vectors (R315-302-2(2)(k))	Part II, sec 3.8
A plan for alternative waste handling (R315-302-2(2)(l))	Part II, sec 3.6
A general training plan for site operations (R315-302-2(2)(o))	Part II, sec 3.10 and 3.11
Any recycling programs planned at the facility (R315-303-4(6))	Part II, sec 3.9
Closure and post-closure care Plan (R315-302-2(2)(m))	Part III, sec 2.7
Procedures for the handling of special wastes (R315-315)	Part II, sec 3.2.4
Plans and operation procedures to minimize liquids (R315-303-3(1))	Part II, sec 3.2.4.8
Plans and procedures to address the requirements of R315-303-3(7)(c) through (i) and R315-303-4	Part II, sec 3.11 Part II, sec 1 Part II, sec 3.5.1 Part II, sec 3.8
Any other site specific information pertaining to the plan of operation required by the Executive Secretary (R315-302-2(2)(p))	n/a
Ie. Special Requirements - New Or Laterally Expanding Class V Landfill (R315-310-3(2))	
Submit information required by the <i>Utah Solid and Hazardous Waste Act</i> Subsections 19-6-108(9) and 19-6-108(10) (R315-310-3(2)(a))	n/a
Approval from the local government within which the solid waste facility sits	n/a

II Facility Technical Information	
Description of Item	Location In Document
IIa. Maps - All Class I and V Landfills	
Topographic map drawn to the required scale with contours showing the boundaries of the landfill unit, ground water monitoring well locations, gas monitoring points, and the borrow and fill areas (R315-310-4(2)(a)(i))	Appendix A, Sheet 2
Most recent U.S. Geological Survey topographic map, 7-1/2 minute series, showing the waste facility boundary; the property boundary; surface drainage channels; any existing utilities and structures within one-fourth mile of the site; and the direction of the prevailing winds (R315-310-4(2)(a)(ii))	Appendix A, Sheet 1
IIb. Geohydrological Assessment - All Class I and V Landfills (R315-310-4(2)(b))	

Utah Class I and V Permit Application Checklist

// Facility Technical Information	
Description of Item	Location In Document
Local and regional geology and hydrology including faults, unstable slopes and subsidence areas on site (R315-310-4(2)(b)(i))	Part III, sec 1.1 Part III, sec 2.1.2
Evaluation of bedrock and soil types and properties including permeability rates (R315-310-4(2)(b)(ii))	Part III, sec 2.3.3
Depth to ground water (R315-310-4(2)(b)(iii))	Part III, sec 1.5.2
Direction and flow rate of ground water (R315-310-4(2)(b)(iv))	Part III, sec 1.5.2
Quantity, location, and construction of any private or public wells on-site or within 2,000 feet of the facility boundary (R315-310-4(2)(b)(v))	Part III, sec 1.3 Appendix D
Tabulation of all water rights for ground water and surface water on-site and within 2,000 feet of the facility boundary (R315-310-4(2)(b)(vi))	Part III, sec 1.3 Appendix D
Identification and description of all surface waters on-site and within one mile of the facility boundary (R315-310-4(2)(b)(vii))	Part III, sec 1.4 and sec 1.5.1
Background ground water and surface water quality assessment and, for an existing facility, identification of impacts upon the ground water and surface water from leachate discharges (R315-310-4(2)(b)(viii))	Part III, sec 1.5.2
Ground Water Monitoring (R315-303-3(7)(b) and R315-308)	Part III, sec 2.4.1
Statistical method to be used (R315-308-2(8))	n/a
Calculation of site water balance (R315-310-4(2)(b)(ix))	Part III, sec 1.6 Appendix D
//c. Engineering Report - Plans, Specifications, And Calculations - All Class I and V Landfills	
Documentation that the facility will meet all of the performance standards of R315-303-2	Part III, sec 3.4
Engineering reports required to meet the location standards of R315-302-1 including documentation of any demonstration or exemption made for any location standard (R315-310-4(2)(c)(i))	Appendix E
Anticipated facility life and the basis for calculating the facility's life (R315-310-4(2)(c)(ii))	Part III, sec 2.2
Cell design to include liner design, cover design, fill methods, elevation of final cover including plans and drawings signed and sealed by a professional engineer registered in the State of Utah (R315-303-3(3), R315-303-3(6) and (7)(a), R315-310-3(1)(b) and R315-310-4(2)(c)(iii))	Part III, sec 2.3
Leachate collection system design and calculations showing system meets the requirements of R315-303-3(2)	Part III, sec 2.4.2
Equipment requirements and availability (R315-310-4(2)(c)(iii))	Part II, sec 1.5
Identification of borrow sources for daily and final cover and for soil liners (R315-310-4(2)(c)(iv))	Part III, sec 2.3.3.3
Run-On and run-off diversion designs (R315-303-3(1)(c), (d) and (e))	Part III, sec 2.5

Utah Class I and V Permit Application Checklist

// Facility Technical Information	
Description of Item	Location In Document
Leachate collection, treatment, and disposal and documentation to show that any treatment system is being or has been reviewed by the Division of Water Quality (R315-310-4(2)(c)(v) and R315-310-3(1)(i))	Part III, sec 2.4.2
Ground water monitoring plan that meets the requirements of Rule R315-308 including well locations, design, and construction (R315-310-4(2)(b)(x) and R315-310-4(2)(c)(vi))	Part III, sec 2.4.1
Landfill gas monitoring and control plan that meets the requirements of Subsection R315-303-3(5) (R315-310-4(2)(c)(vii))	Part III, sec 2.4.3
Slope stability analysis for static and under the anticipated seismic event for the facility (R315-310-4(2)(b)(i) and R315-302-1(2)(b)(ii))	Part III, sec 2.1.2 Appendix G
Design and location of run-on and run-off control systems (R315-310-4(2)(c)(viii))	Part III, sec 2.5
II d. Closure Plan - All Class I and V Landfills (R315-310-3(1)(h))	
Closure Plan (R315-302-3(2) and (3))	Part III, sec 2.6
Closure schedule (R315-310-4(2)(d)(i))	Part III, sec 2.6.1
Design of final cover (R315-303-3(4) and R315-310-4(2)(c)(iii))	Part III, sec 2.6.2
Capacity of site in volume and tonnage (R315-310-4(2)(d)(ii))	Part I
Final inspection by regulatory agencies (R315-310-4(2)(d)(iii))	Part III, sec 2.6.3
II e. Post-Closure Care Plan - All Class I and V Landfills (R315-310-3(1)(h))	
Post-Closure Plan (R315-302-3(5) and (6))	Part III, sec 2.7
Site monitoring of landfill gases, ground water, and surface water, if required (R315-310-4(2)(e)(i))	Part III, sec 2.7.1
Changes to record of title, land use, and zoning restrictions (R315-310-4(2)(e)(v))	Part III, sec 2.7.2
Maintenance activities to maintain cover and run-on/run-off control systems (R315-310-4(2)(e)(iii))	Part III, sec 2.7.3
List the name, address, and telephone number of the person or office to contact about the facility during the post-closure care period (R315-310-4(2)(e)(vi))	Part I
II f. Financial Assurance - All Class I and V Landfills (R315-310-3(1)(j))	
Identification of closure costs including cost calculations (R315-310-4(2)(d)(iv)) and (R315-302-2(2)(n))	Part III, sec 2.9 Appendix J
Identification of post-closure care costs including cost calculations (R315-310-4(2)(e)(iv))	Part III, sec 2.9.3 Appendix J
Identification of the financial assurance mechanism that meets the requirements of Rule R315-309 and the date that the mechanism will become effective (R315-309-1(1))	Part III, sec 2.9.3 Appendix J

ANNOTATED TABLE OF CONTENTS

<u>Part</u>	<u>Title</u>
	Introduction Includes summary of permit with technical and operational issues highlighted
I.	General Data Includes State of Utah Solid Waste Permit Application forms
II.	General Report Includes information required by Utah Administrative Rule R315-301 through R315-310
III.	Technical and Engineering Report Includes information required by Utah Administrative Rule R315-301 through R315-310

INTRODUCTION

This document presents an application to renew a permit to operate solid waste disposal facilities at the Emery County Landfill, which is owned and operated by Emery County. The Emery County Landfill is currently operated under permit number 9427 issued by the Utah Solid and Hazardous Waste Control Board. This permit became effective on June 1, 1998, was last renewed May 15, 2006 and expires at midnight on May 14, 2011.

In the four and one half years that have passed since the current permit was issued to the Emery County Landfill, only minor changes have taken place in the day to day operations at the landfill. This permit will discuss these changes and also describe a proposed lateral expansion of the existing facility and better serve the needs of Emery County into the future.

This permit application contains conceptual level engineering sufficient for permitting purposes only. This permit application does represent a lateral expansion to the currently permitted landfill cells. As such it will address applicable changes in engineering and operational issues at the landfill. These changes include:

- Expansion of final cover configuration – the revised final cover represents a lateral and vertical expansion of the landfill and changes the overall configuration of the final cover. The changes in cover geometry will result in changes in storm water management and allowances for settlement.

- Extension of Landfill Life – the actual volume of waste being delivered to the landfill represents a 2%/year rate of increase as compared to the previous permit. Continuing this growth rate and expanding the available airspace results in an approximately 52 year extension of landfill life.

- Final cover design – The landfill expansion will use the currently permitted alternate final cover consisting of 30” on-site low permeability soils over the final lift of MSW.
- Plan of Operation – The Plan of Operation has been revised to reflect proposed operation practices and changes in configuration.

The following items, which have been previously permitted and are part of the operating record of the landfill, and since no changes in site conditions have occurred, will not be discussed in detail in this permit application:

- Alternate Liner – an alternate liner consisting of the low-permeability site soils has been approved for use as a landfill liner at the Emery County Landfill. All future Phases will be constructed using the previously approved alternate liner.
- Leachate collection and removal system exemption – due to unique site conditions, Emery County Landfill has been exempted from the incorporation of a leachate collection and removal system. All future Phases will be constructed without leachate collection and removal systems. Visual monitoring for leachate is still conducted as part of landfill operations.
- Ground water monitoring exemption – due to the extreme depth of ground water, Emery County Landfill has been exempted from the UDEQ ground water monitoring requirements. Emery County plans to continue to operate the landfill consistent with the current exemption.

The application has been organized to follow the general outline of R315-302 and R315-310. This organization results in some duplication and repetition of information, but it is intended to simplify the review and approval of the permit application. Part I of this document duplicates the standard form outlining general data pertaining to the site. Part II is a general report that includes a facility description, legal description and a landfill operations plan. Part III is the Professional

Engineering Report and includes details on the design and geohydrology of the site along with information on closure and post-closure plans.

PART I

**UTAH DEPARTMENT OF ENVIRONMENTAL QUALITY
DIVISION OF SOLID AND HAZARDOUS WASTE**

Application to Renew a Permit to Operate a Class I Landfill

PART I - General Data

1. Name of Facility: Emery County Landfill
2. Site Location: off road 550 west north of S.R.29, 2.4 miles thence 0.7 miles south on
County landfill road
Castle Dale, Utah 84513
3. Facility Owner: Emery County
4. Facility Operator: Emery County Road Department
5. Contact Person: Wayde Nielsen, Road Supervisor/Landfill Manager
- Address: Emery County Road Department
Post Office Box 889
Castle Dale, Utah 84513
- Telephone: (435) 381-5450
6. Type of Facility:
(X) Class I Landfill
() Class V Landfill
- () Initial Application
(X) Permit Renewal
- Original Permit Number 9427

7. Property Ownership

(X) Presently Owned by Applicant 100% Undivided interest

() To be Purchased by Applicant

() To be Leased by Applicant

Property Owner (if different from applicant)

Name: None

Address: _____

Telephone: _____

8. I certify under penalty of law that this document and all attachments were prepared under my direction or supervision in accordance with a system designed to assure that qualified personnel properly gathered and evaluated the information submitted. Based on my inquiry of the person or persons who manage the system, or those persons directly responsible for gathering the information, the information submitted is, to the best of my knowledge and belief, true, accurate, and complete. I am aware that there are significant penalties for submitting false information, including the possibility of fine and imprisonment for knowing violations.

Wayde S. Nielsen landfill manager
(Name of Official) (Title)


Signature: Wayde Nielsen Date: 10-11-11

SUBSCRIBED AND SWORN to before this 11 day of Oct. 2011

My Commission expires on the 19 day of Oct. 2011

Notary Public in and for Emery County, Utah.

(SEAL)

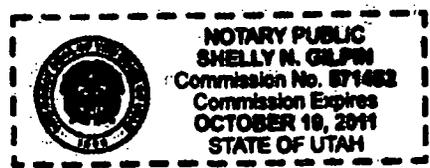

Shelly N Gilpin

**APPLICATION TO RENEW A PERMIT TO
OPERATE A CLASS I LANDFILL**

Emery County Landfill

PART II - GENERAL REPORT

TABLE OF CONTENTS

PART II - GENERAL REPORT	I
1.0 - FACILITY DESCRIPTION	1
1.1 AREA SERVED	1
1.2 WASTE TYPES	1
1.3 HOURS OF SITE OPERATION	2
1.4 PERSONNEL	2
1.5 LANDFILL EQUIPMENT	3
2.0 - LEGAL DESCRIPTION	4
2.1 PROOF OF OWNERSHIP	4
2.2 LAND USE AND ZONING OF SURROUNDING AREAS	4
3.0 - OPERATIONS PLAN	5
3.1 SCHEDULE OF CONSTRUCTION	6
3.1.1 <i>Sequence of Development</i>	6
3.1.1.1 Phase I - Northern Expansion	6
General	6
Waste Placement	7
3.1.1.2 Phase II - Northern Expansion	8
General	8
Waste Placement	8
3.1.1.3 Phase III - Northern Expansion	8
General	8
Waste Placement	9
3.1.1.4 Phase IV - Northern Expansion	9
General	9
Waste Placement	9
3.1.1.5 Phase V - Northern Expansion	10
General	10
Waste Placement	10
3.2 DESCRIPTION OF HANDLING PROCEDURES	10
3.2.1 <i>General</i>	10
3.2.2 <i>Waste Acceptance</i>	12
3.2.3 <i>Waste Disposal</i>	12
3.2.4 <i>Special Wastes</i>	13
3.2.4.1 Used Oil and Batteries	13
3.2.4.2 Bulky Wastes	13
3.2.4.3 Tires	14
3.2.4.4 Dead Animals	14
3.2.4.5 Asbestos Waste	14
3.2.4.6 Grease pit and Animal Waste By-Products	14
3.2.4.7 Infectious Wastes	15
3.2.4.8 Bulk or Containerized Liquid Waste	15
3.3 WASTE INSPECTION	15

3.3.1	<i>Landfill Spotting</i>	15
3.3.2	<i>Random Waste Screening</i>	16
3.3.3	<i>Removal of Hazardous or Prohibited Waste</i>	17
3.3.4	<i>Hazardous or Prohibited Waste Discovered After the Fact</i>	17
3.3.5	<i>Notification Procedures</i>	18
3.4	MONITORING AND INSPECTION SCHEDULE	18
3.4.1	<i>Groundwater</i>	18
3.4.2	<i>Surface Water</i>	18
3.4.3	<i>Leachate Collection</i>	18
3.4.4	<i>Landfill Gas</i>	19
3.4.5	<i>Inspection Documentation</i>	19
3.5	CONTINGENCY AND CORRECTIVE ACTION PLANS	19
3.5.1	<i>Fire</i>	19
3.5.1.1	<i>Incoming Waste/ Incoming Vehicle Fire</i>	19
3.5.1.2	<i>Ground Fire/Below Cover Fire</i>	20
3.5.2	<i>Explosion</i>	20
3.5.3	<i>Release of Explosive Gases</i>	21
3.5.4	<i>Failure of Run-Off Containment</i>	22
3.5.5	<i>Groundwater Contamination</i>	23
3.6	CONTINGENCY PLAN FOR ALTERNATIVE WASTE HANDLING	23
3.7	MAINTENANCE PLAN	23
3.7.1	<i>Groundwater Monitoring System</i>	23
3.7.2	<i>Leachate Collection and Recovery System</i>	23
3.7.3	<i>Gas Monitoring System</i>	23
3.8	DISEASE AND VECTOR CONTROL	24
3.8.1	<i>Insects</i>	24
3.8.2	<i>Rodents</i>	24
3.8.3	<i>Birds</i>	24
3.8.4	<i>Household Pets</i>	24
3.8.5	<i>Wildlife</i>	25
3.8.6	<i>Fugitive Dust</i>	25
3.8.7	<i>Litter Control</i>	25
3.9	RECYCLING PROGRAM	25
3.10	TRAINING PROGRAM	26
3.11	RECORDKEEPING	27
3.11.1	<i>Weights or Volumes of Incoming Waste</i>	27
3.11.2	<i>Number of Vehicles Entering Facility</i>	27
3.11.3	<i>Types of Wastes Received Each Day</i>	27
3.11.4	<i>Deviation from Approved Operations Plan</i>	27
3.11.5	<i>Training Procedures</i>	28
3.11.6	<i>Inspection Log or Summary</i>	28
3.11.7	<i>Closure and Post-Closure Care Plans</i>	28
3.11.8	<i>Cost Estimates and Financial Assurance Documentation</i>	28
3.11.9	<i>Other Records as Required by the Executive Secretary</i>	28
3.12	SUBMITTAL OF ANNUAL REPORT	28
3.13	INSPECTIONS	29

3.14	RECORDING WITH COUNTY RECORDER AND THE STATE OF UTAH DIVISION OF SOLID AND HAZARDOUS WASTE	29
3.15	STATE AND LOCAL REQUIREMENTS	29
3.16	SAFETY	29
3.17	EMERGENCY PROCEDURES	30

1.0 - FACILITY DESCRIPTION

Emery County owns and operates the Emery County Landfill located approximately 3.1 miles North of S.R. 29 off from 550 west north of Castledale, Utah. The landfill is a Class I municipal solid waste (MSW) disposal facility managed by the Emery County Road Department and is used primarily for the disposal of MSW generated within Emery County. The landfill has been continually operated by Emery County since the landfills development in 1979. The landfill is currently operating under Utah State Department of Environmental Quality Permit Number 9427. The facility is entirely fenced, with public access through the locking gate at the main entrance.

The Emery County Landfill is located in Sections 9 and 16 of Township 18 South, Range 8 East, Salt Lake Base and Meridian. Drawing 1 (Appendix A) illustrates the location of the Emery County Landfill. The landfill site consists of approximately 40 acres in Section 16 (existing) and 45 acres in Section 9 (proposed expansion) is bounded on the north and west by 335 plus acres of County owned properties available for future use.

1.1 AREA SERVED

The Emery County Landfill (Landfill) is the only active landfill in Emery County and serves the entire population of approximately 11,000 (U.S. Census, 2010). The majority of the residents of the County have curbside waste collection. The curbside collection program is currently contracted to City Sanitation located in Price.

1.2 WASTE TYPES

Based on the 2010 annual report the Landfill took in approximately 13,254 tons of MSW. during the previous calendar year. MSW constitutes the majority of the waste coming into the Landfill. Commercial wastes have historically made up approximately 36 percent of the waste stream. Industrial and mine related wastes are not accepted at the Emery County Landfill.

Emery County Landfill is currently recycling tires, white goods, scrap metal and collecting green waste to be diverted from the waste stream. Approximately 365 tons of green waste is diverted from the waste stream annually. Approximately 74 tons of waste per year is currently being diverted from the landfill to be recycled.

1.3 HOURS OF SITE OPERATION

The Emery County Landfill is open to the general public and commercial haulers for solid waste disposal Tuesday through Friday from 9:00 a.m. to 5:15 p.m. and Saturdays from 8:00 a.m. to 4:15 p.m. The landfill maintains these hours year round. The facility is closed for the following Holidays:

- New Year's Day
- 4th of July
- Thanksgiving
- Christmas

The Emery County Landfill controls public access to the landfill to prevent illegal dumping of wastes, public exposure to hazards, scavenging, and unauthorized traffic. Access control is a key element in preventing unauthorized scavenging or injury. Fences, locked gates, and natural barriers provide the basis of the site's access control system. During operating hours, Emery County personnel monitor and control all access to facilities with at least one person on-site during all operational hours.

1.4 PERSONNEL

The following persons are responsible or available for on-site landfill operations for the Emery County Landfill:

- **Landfill Manager** - The Landfill Manager (LM) is responsible for planning and construction of the landfill facility and overall operation of the solid waste management system. The LM must also ensure the facility's compliance with the parameters of the permit issued by the DSHW through regular inspections and monitoring. The LM oversees the production of annual environmental and financial reports. In Emery County, the LM is currently the Supervisor of the County Road Department and reports to the County Commissioners. All landfill personnel report to the Landfill Manager.

To fulfill these responsibilities adequately, the LM must have six to eight years of heavy equipment operation, with a minimal of five years supervisory experience. College training may be applied toward years of experience at the discretion of the County Commissioners. The Landfill Manager must complete the Solid Waste

Association of North America (SWANA) Manager of Landfill Operations (MOLO) course, or comparable training, within one year of being hired. Thereafter the LM must maintain active SWANA, MOLO and other applicable certification(s) as may be required for this position.

- **Solid Waste Technician Crewleader (SWTC)** - The SWTC oversees the daily operations of the landfill. Responsibilities include oversight of all landfill personnel, maintaining site operations, general site security and providing assistance to the Landfill Manager. The SWTC functions as the Landfill Manager in the Manager's absence.
- **Solid Waste Technician (SWT)** - All Landfill SWT's (Equipment Operators) are responsible for day-to-day activities of the Landfill. These responsibilities include waste acceptance and placement, safe operation and maintenance of equipment, visual inspection of each incoming load, random waste screening operations, application of daily, intermediate and final cover, and general maintenance of the facility.

SWT's are required to have at least two years experience operating heavy equipment.

- **Solid Waste Screener** – The Solid Waste Screener is responsible for visual inspections of incoming loads, helping the SWT (Equipment Operators) with random waste screening, logging vehicles, record keeping, traffic control and clean up of litter.

Emery County Landfill maintains at least one person at the gate to inspect/supervise incoming loads and one person to operate equipment and work the landfill face during all hours of operation.

1.5 LANDFILL EQUIPMENT

The following items of equipment are dedicated to the landfill and remain on-site for use in landfill operations

Caterpillar 816F Compactor
Volvo Haul Truck

Caterpillar D6T Dozer
Caterpillar 980F Loader

Additionally, the landfill is operated by the Emery County road department and has access to other heavy equipment on an as-needed basis.

2.0 - LEGAL DESCRIPTION

The legal description of the property Emery County owns for development of a landfill is:

Northwest $\frac{1}{4}$ of Northeast $\frac{1}{4}$ of Section 16, Township 18 South, Range 8 East, Salt Lake Baseline and Meridian.

The property currently in use or planned for landfill development lies within the following area:

Southeast $\frac{1}{4}$ of Section 9, Township 18 South, Range 8 East, Salt Lake Baseline and Meridian. This corresponds to a latitude and longitude of approximately 39.264 degrees North and 111.025 degrees West.

The exact gate location (WGS 84 Datum) is latitude 39 degrees 15 minutes 44.3 seconds North, Longitude 111 degrees 1 minute 44.4 seconds West.

A copy of the legal description is included in Appendix B and a map of the Emery County Landfill is included as Drawing 1 (Appendix A).

2.1 Proof of Ownership

Deeds indicating proof of ownership are included in Appendix B.

2.2 Land Use and Zoning of Surrounding Areas

The Emery County Landfill is located consistent with all land use and zoning restrictions in effect in Emery County. The area surrounding the landfill is zoned I-1 (Industrial).

3.0 - OPERATIONS PLAN

On October 9, 1991, the U.S. Environmental Protection Agency (EPA) announced revisions to the Criteria for Classification of Solid Waste Disposal Facilities. These revisions were developed in response to Subtitle D of the 1984 Hazardous Waste Amendments to the Resource Conservation and Recovery Act (RCRA). The Subtitle D regulations set forth revised minimum federal criteria for municipal solid waste landfills (MSWLFs), including facility design and operating criteria. The Subtitle D regulations set forth differing requirements for existing and new units (e.g., existing units are not required to remove wastes in order to install liners).

Subtitle D established a framework for federal, state, and local government cooperation in controlling the management of non-hazardous solid waste. The federal role in this arrangement is to establish the regulatory direction by providing minimum nationwide standards for protection of human health and the environment and by providing technical assistance to States for planning and developing their own environmentally sound waste management practices. However, the actual planning, direct implementation, and enforcement of solid waste programs under Subtitle D remain largely a state and local function.

On November 5, 1995, the State of Utah Department of Environmental Quality (UDEQ) issued final Administrative Rules entitled Solid Waste Permitting and Management Rules (R315-301 through 320) implementing Subtitle D at the state level. UDEQ has received authorization from EPA to implement and enforce the solid waste program.

Emery County has prepared this Landfill Operations Plan to guide the daily operations at the Emery County Landfill. This document provides substantial discussion of operations at the landfill based on the operating criteria outlined in 40 CFR 258, Subpart C, and State of Utah Administrative Rules R315-301 through 310.

A supplementary document titled *Emery County Landfill Operator's Manual* contains detailed information regarding operating procedures for the day to day operation of the landfill. The *Emery County Landfill Operator's Manual* is not included with this permit. A copy of this Operator's Manual is maintained on file at the Landfill.

3.1 SCHEDULE OF CONSTRUCTION

The remaining development of the Emery County Landfill has been proposed to consolidate the existing three Landfill Units into one single landfill consisting of 5 remaining phases. The current Landfill Unit receiving waste is in the Southeast region of the property. Waste was previously placed in the North Mass Fill Area. Fill will be placed over the top of existing waste in these areas, but future waste placement will generally proceed from east to west and utilize county property located to the north of existing waste cells. Development of the landfill site will be performed in general accordance with the plans and details presented in the drawings (Appendix A). These drawings show the conceptual configuration of each of the Landfill Phases and their general location within the landfill site. The proposed configuration was developed based on geologic/hydrogeologic conditions and geotechnical considerations. Excavation for additional cells will be performed as borrow soils are gathered for use as daily cover. Drawings in Appendix A illustrate the general sequencing of landfill development on the property.

By utilizing a portion of the County-owned property north of the existing Landfill Units the life of the landfill is projected to increase from 11 to 63 years of disposal based on available fill volume, expected daily waste disposal rates, and an in-place density of 1,200 pounds per cubic yard (ppcy).

3.1.1 Sequence of Development

The following paragraphs describe the filling sequence for the remaining Phases of the landfill. This sequencing will result in the planned placement of wastes to maximize the stability of the fill at any time during operation of the landfill. The SWT will not deviate substantially from the sequencing plan without concurrence of the Landfill Manager.

The Emery County solid waste plan defines the waste placement into five closure phases on the site. The following nomenclature defines the Phases.

3.1.1.1 *Phase I - Northern Expansion*

General

In order to minimize hauling distance while generating needed daily cover soils Phase 1 will be located near the eastern edge of the northern expansion, adjacent to proposed detention

pond area (Appendix A - Sheet 3). The Phase will be bounded to the north, south and east by a newly constructed access road which will separate waste from the natural drainage channel, south property boundary and new detention pond, respectively. The north, south and east slopes will be constructed with 4:1 (horizontal: vertical) side slopes and the west facing (working face) slope will be constructed with at 3:1. Waste placement will begin at/near existing grade without the need for extensive excavation. Potential run-on from the west will be diverted around newly placed waste and cover soils will be generated initially from the detention pond excavation east of the cell. Waste placement will begin in this area as soon as possible and will continue until early 2015. The north, south and east facing slopes will be reclaimed using final cover. Waste placement will continue westward towards Phase II.

Waste Placement

Work face dimensions will be kept narrow enough to minimize blowing litter and reduce the amount of material needed for daily cover.

Typically, the compactor is operated with the blade facing uphill. Equipment operations across the slope are avoided to minimize the potential of equipment tipping over. In addition to safety concerns, a “toe of slope” to “crest of slope” working orientation provides the following benefits:

- Increases effective compaction.
- Increased visibility for waste placement and compaction.
- More uniform waste distribution.

The MSW wastes will be compacted by making three to five passes up and down the slope. Compaction reduces litter, differential settlement, and the quantities of cover soil needed. Compaction also extends the life of the site, reduces unit costs, and leaves fewer voids to help reduce vector problems. Care is taken that no holes are left in the compacted waste. Voids are filled with additional waste as they develop.

Intermediate cover is applied to all areas of the active cell where additional waste will not be received within 30 days. Intermediate cover consists of an additional 12 inches of soil being placed over the 6 inches of daily cover soil.

Waste will be placed in typical 8 foot tall lifts covered with 6" of daily cover. An additional 12" of soil will be placed on all horizontal lifts to constitute an intermediate cover. The MSW will be placed to the final cover contours as indicated in Sheet 4 (Appendix A).

3.1.1.2 *Phase II - Northern Expansion*

General

Phase II will continue the east to west placement of waste in the northern expansion that was initiated in Phase I. Waste placement will be bounded on the north by the access road and on the south by the road and property boundary. Eventually the placement will continue southward into the Southeast Excavation Area (SEA) where waste is currently being placed (Appendix A - Sheet 5). Based on the projected waste stream waste placement will begin in Phase II sometime in early 2015 and continue into late 2024.

Waste Placement

Waste placement will be accomplished utilizing the same procedures as described for Phase I. Daily cover will be applied to the working face slope as needed, final cover soils will be placed on perimeter slopes and the top of the cap as they reach final grade. Efforts will be made to limit the size of the active working face, however, as the waste placement extends further to the south intermediate cover soils will be used to protect areas that may need to remain dormant for more than 30 days.

3.1.1.3 *Phase III - Northern Expansion*

General

Phase III will continue the east to west placement of waste in the northern expansion that was initiated in Phase I and continued in Phase II. Waste placement will be bounded on the north by the access road and on the south by the limits of waste previously placed in the North Mass Fill Area. Waste will be placed over top of existing waste in the North Mass Fill Area (Appendix A - Sheet 6). In the North Expansion area waste will largely be placed in a newly excavated cell that has been prepared in part to generate daily, intermediate and final cover soils for Phases I and II. The bottom slope of this cell will be graded so as to divert leachate/potential run-on northward and away from waste at the minimum required grade of

2%. Based on the projected waste stream waste placement will begin in Phase III sometime in late 2024 and continue into late 2044.

Waste Placement

Waste placement will be accomplished utilizing the same procedures as described for Phases I. Daily cover will be applied to the working face slope as needed, final cover soils will be placed on perimeter slopes and the top of the cap as they reach final grade. Efforts will be made to limit the size of the active working face, however, as the waste placement extends further to the south intermediate cover soils will be used to protect areas that may need to remain dormant for more than 30 days.

3.1.1.4 *Phase IV - Northern Expansion*

General

Phase IV will continue the east to west placement of waste in the northern expansion that was utilized in Phases I through II. Waste placement will be bounded on the north by the access road and on the south by the limits of waste previously placed in the North Mass Fill Area. Waste will be placed over top of existing waste in the North Mass Fill Area (Appendix A - Sheet 7). In the North Expansion area waste will largely be placed in a newly excavated cell that has been prepared in part to generate daily, intermediate and final cover soils for Phases I -III. The bottom slope of this cell will be graded so as to divert leachate/potential run-on northward and away from waste at the minimum required grade of 2%. Based on the projected waste stream waste placement will begin in Phase III sometime in late 2044 and continue into early 2062.

Waste Placement

Waste placement will be accomplished utilizing the same procedures as described for Phases I-III. Daily cover will be applied to the working face slope as needed, final cover soils will be placed on perimeter slopes and the top of the cap as they reach final grade. Efforts will be made to limit the size of the active working face; however, intermediate cover soils will be used as necessary to protect areas that may need to remain dormant for more than 30 days.

3.1.1.5 Phase V - Northern Expansion

General

Phase V will continue the east to west placement of waste in the northern expansion that was utilized in Phases I-IV and will continue to the proposed western limits of the landfill. Waste placement will be bounded on the north by the access road and on the south by the limits of waste previously placed in the North Mass Fill Area. Waste will be placed over top of existing waste in the North Mass Fill Area (Appendix A - Sheet 8). In the North Expansion area waste will largely be placed in a newly excavated cell that has been prepared in part to generate daily, intermediate and final cover soils for Phases I-IV. The bottom slope of this cell will be graded so as to divert leachate/potential run-on northward and away from waste at the minimum required grade of 2%. This Phase includes 1.03 Mcyd and based on the projected waste stream will begin accepting waste sometime in early 2062 and continue into late 2074.

Waste Placement

Waste placement will be accomplished utilizing the same procedures as described for Phases I-IV. Daily cover will be applied to the working face slope as needed, final cover soils will be placed on perimeter slopes and the top of the cap as they reach final grade. Efforts will be made to limit the size of the active working face, however, intermediate cover soils will be used when necessary to protect areas that may need to remain dormant for more than 30 days.

3.2 DESCRIPTION OF HANDLING PROCEDURES

3.2.1 General

The landfill is open for public and private disposal. Signs posted near the landfill entrance clearly indicate the following information:

- Types of wastes that are accepted
- Types of wastes not accepted
- Telephone numbers
- Hours of operation
- Recycling information
- Holidays – days of landfill operation
- Tipping fees

- Applicable regulations

All vehicles delivering wastes to the site must stop at the scalehouse. Scalehouse personnel will inquire as to the contents of each incoming load to screen for unacceptable materials. Any vehicle suspected of carrying unacceptable materials (liquid waste, sludges, or hazardous waste) will be prevented from entering the disposal site unless the driver can provide evidence that the waste is acceptable for disposal at the site. Emery County Landfill reserves the right to refuse service to any suspect load. Vehicles carrying unacceptable materials will be required to exit the site without discharging their loads. If a load is suspected of containing unacceptable materials, the following information will be recorded: date, time, name of the hauler, driver, telephone number, license plate, and source of waste. The scalehouse will then notify the tipping area operator by radio that a load is suspect and that load will be further inspected at the landfill tipping area before final disposal is allowed.

After a vehicle leaves the scalehouse, the vehicle will be routed to the appropriate discharge location by site personnel. Loads will be regularly surveyed at the tipping area. If a discharged load contains inappropriate or unacceptable material, the discharger will be required to reload the material and remove it from the landfill site. If the discharger is not immediately identified, the area where the unacceptable material was discharged will be cordoned off. The unacceptable material will be moved to a designated area for identification and preparation for proper disposal.

The operation of the landfill is documented on various forms. The forms that Emery County uses to help maintain an orderly processing of waste while minimizing the potential for environment impacts are:

- Landfill Inspection
- Routine Waste Inspection
- Landfill Recyclables Hauled Out
- Utah DIYer Used Oil Log
- Landfill Training Agenda
- Freon Extraction
- Landfill Waste Disposal Log
- Landfill Hot Load
- Landfill Gas Log

Copies of all forms are included in Appendix C.

3.2.2 Waste Acceptance

The Emery County Landfill utilizes customized spreadsheets in Quatro Pro to manage the landfill waste tracking. With this program Emery County is able to track all incoming waste as well as bill and receive payment from all customers. When a vehicle with waste stops on the scale; the scale operator identifies the load as to whether it is a commercial hauler, general public, or private individual with an account. All loads larger than a pickup are weighed and charged accordingly. All information pertaining to all transactions is stored on the in house computer at the Road Department. All records are backed up twice weekly to the main frame at the County Court House. A monthly summary of all landfill transactions is created and kept on file at the landfill. Any or all transactions may be retrieved as necessary. After each load has been recorded, the driver is directed where to take the load. All loads with the exception of green waste and dead animals are directed to the working face where the waste is deposited for disposal.

Each load is visually inspected. Waste screening is done as needed or scheduled according to the procedures outlined in Section 3.3 Waste Inspection. No open burning is allowed. No smoking is allowed near the work face.

3.2.3 Waste Disposal

Wastes are dumped at the toe of the work face when possible and spread up the slope in one to two foot lifts, keeping the slope at three to one (horizontal to vertical) configuration.

Work face dimensions are kept narrow enough to minimize blowing litter and reduce the amount of material needed for daily cover. Typically, the width of the working face is two and one-half times the width of the compactor blade (40 feet). This facilitates complete compaction of the waste and keeps the width narrow enough to minimize amount of daily cover required.

Typically the compactor is operated with the blade facing uphill. Equipment operations across the slope are avoided to minimize the potential of equipment tipping over. In addition to safety concerns, a toe of slope to crest of slope working orientation provides the following benefits:

- Minimizes blowing litter problems.

- Increases equipment compactive effectiveness.
- Increased visibility for waste placement and compaction.
- More uniform waste distribution.

Grade stakes are used when necessary to control cell height and top surface grade. The top of the surface grade ranges from 2 to 5 percent, and the cell height ranges from 8 to 10 feet.

Wastes are compacted by making three to five passes up and down the slope. Compaction reduces litter, differential settlement, and the quantities of cover soil needed. Compaction also extends the life of the site, reduces unit costs, and leaves fewer voids to help reduce vector problems. Care is taken that no holes are left in the compacted waste. Voids are filled with additional waste as they develop.

Intermediate cover is applied to all areas of the active cell that will not receive additional waste within 30 days. Intermediate cover consists of additional 12 inches of soil being placed over the 6 inches of daily cover soil.

3.2.4 Special Wastes

3.2.4.1 *Used Oil and Batteries*

The Emery County Landfill is a "Used Oil Recycle Center". When a customer has used oil to dispose of they fill out the form "UTAH DIYer USED OIL LOG" provided by UDEQ. A report generated from this form is turned in quarterly stating the amount of oil deposited and the customer's names. Batteries are not accepted at the working face. Emery County Landfill provides a pallet near the scalehouse where incoming batteries are stored until a sufficient number is generated to facilitate pickup by a local battery supplier (J&D Automotive).

3.2.4.2 *Bulky Wastes*

White goods are accepted at the landfill and are separated for recycling. All appliances containing refrigerants are segregated in a separate area. Refrigerant is removed from the damaged units and the recyclable appliances are set aside in a special area for recycling. Used cars are not accepted at the Emery County Landfill.

3.2.4.3 *Tires*

Emery County Landfill accepts small quantities of tires from the general public. Commercial haulers are prohibited from disposing of tires. Four passenger tires can be accepted with each load from the public. When sufficient quantities of tires are collected, a tire hauler is called and the tires are removed from the facility for recycling.

3.2.4.4 *Dead Animals*

Dead animals are accepted at the landfill. A designated trench is prepared for the acceptance of these animals. They are collected in the trench and a minimum of 6" of cover is placed over the animals at the end of each day. In the event the trench is inaccessible, the dead animals are incorporated into the face of the landfill. The incorporation of the carcasses into the landfill is accomplished by pushing up the toe of the face and depositing the animal in the bottom of the toe; waste is then pushed over the top of the animal.

3.2.4.5 *Asbestos Waste*

Emery County Landfill has developed asbestos management procedures to minimize the risk of asbestos related waste to humans and the environment. Emery County Landfill accepts on locally generated asbestos waste. Asbestos generators and transporters are required to make arrangements for asbestos disposal at a minimum of 24 hours prior to delivery to the landfill.

All asbestos waste management practices are as prescribed by UDEQ 315-315-2.

3.2.4.6 *Grease pit and Animal Waste By-Products*

Waste from restaurant grease traps and slaughterhouse by-products are accepted at the landfill. These wastes require 24 to 48 hour notice before disposal. If the waste passes the paint filter test, it is deposited in the dead animal trench and covered daily. If excess liquid is present in the waste, the waste is unloaded on a specially prepared drying pad. The waste remains on the drying pad until the moisture has been sufficiently reduced to pass the paint filter test. Once the waste passes the paint filter test, the waste is deposited either in the dead animal trench or at the toe of the working face where it is immediately covered.

3.2.4.7 *Infectious Wastes*

The Emery County Landfill will occasionally accept potentially infectious waste (sharps from nursing home), specific waste handling procedures will be followed to minimize the potential human contact with the infectious waste. The following procedures will constitute the Infectious Waste Management Plan:

- Upon entering the landfill, the transporter of infectious waste shall notify the landfill operator that the load contains infectious waste.
- The infectious waste containers will be placed at the bottom of the working face with sufficient care to avoid breaking them.
- The infectious waste will be immediately and completely covered with a minimum of 12 inches of soil or MSW that contains no infectious waste.
- The infectious waste will not be compacted until the 12 inches of soil or MSW containing no infectious waste is in place.
- Infectious waste may be placed in the dead animal pit as an alternative to disposal at the working face.

3.2.4.8 *Bulk or Containerized Liquid Waste*

Bulk or containerized liquid waste will not be disposed of in the Emery County Landfill unless it is household waste. Liquids restrictions are necessary because the disposal of liquids into landfills can be a potential source of leachate generation. By restricting the introduction of free liquids into the landfill, Emery County Landfill can minimize the leachate generation potential of the landfill. This should reduce the quantity of free liquids to be managed in the landfill. The ban on containerized free liquids will also reduce the problem of subsidence and possible damage to the final cover upon deterioration of the waste containers.

3.3 WASTE INSPECTION

3.3.1 Landfill Spotting

Learning to identify and exclude prohibited and hazardous waste is necessary for the safe operation of the Landfill. The SWT's are required to receive initial and periodic hazardous waste inspection training. SWT are required to take the SWANA waste screening training. Certificates of training are kept in the personnel files.

Hazardous wastes have either physical or chemical characteristics that could harm human health or the environment. A waste is considered hazardous if it falls into either of two categories: 1) a listed waste, or 2) a characteristic waste. Hazardous wastes are not accepted at the Emery County Landfill.

Small quantity generators (<100 kg/mo) and household quantities are exempt from hazardous waste regulations. However, hazardous wastes are most likely to enter the Landfill mixed in with common household waste. Public education and periodic waste screening are the tools used to minimize the amount of inadvertent hazardous waste entering the landfill.

3.3.2 Random Waste Screening

Random inspections of incoming loads are conducted according to the schedule established by the SWTC. One or more commercial waste haulers and residential loads per week are selected randomly according to the schedule. If frequent violations are detected, additional random checks are scheduled at the discretion of the Landfill Manager.

If a suspicious or unknown waste is encountered, the SWT proceeds with the waste screening as follows:

- The driver of the vehicle containing the suspect material is directed to the waste screening area.
- The waste screening form is completed.
- Protective gear is worn (leather gloves, steel-toed boots, goggles, coveralls, and hard hat).
- The suspect material is spread out with the wheel loader or hand tools and visually examined. Suspicious marking or materials, like the ones listed below, are investigated further:
 - Containers labeled hazardous
 - Material with unusual amounts of moisture
 - Biomedical (red bag) waste
 - Unidentified powders, smoke, or vapors
 - Liquids, sludges, pastes, or slurries
 - Asbestos or asbestos contaminated materials
 - Batteries
 - Other wastes not accepted by the Landfill

- The Landfill Manager is called if unstable wastes that cannot be handled safely or radioactive wastes are discovered or suspected.

3.3.3 Removal of Hazardous or Prohibited Waste

Should hazardous or prohibited wastes be discovered during random waste screening or during tipping, the waste is removed from the Landfill as follows:

- The waste is loaded back on the hauler's vehicle. The hauler is then informed of the proper disposal options.
- If the hauler or generator is no longer on the premises and is known, they are asked to retrieve the waste and informed of the proper disposal options.
- The Landfill Manager arranges to have the waste transported to the proper disposal site and then bill the original hauler or generator.

A record of the removal of all hazardous or prohibited wastes is kept in the site operational records.

3.3.4 Hazardous or Prohibited Waste Discovered After the Fact

If hazardous or prohibited wastes are discovered in the landfill, the following procedure is used to remove them:

- Access to the area is restricted.
- The Landfill Manager is immediately notified.
- The SWT removes the waste from the working face if it is safe to do so.
- The waste is isolated in a secure area of the landfill and the area cordoned off.
- The Emery County Sheriff's Department Hazmat Response Team is notified. The Response Team physically inspects the material and provides waste handling specifics for the disposal.

The DSHW, the hauler (if known), and the generator (if known) is notified within 24 hours of the discovery. The generator (if known) is responsible for the proper cleanup, transportation, and disposal of the waste.

3.3.5 Notification Procedures

The following agencies and people are contacted if any hazardous materials are discovered at the Landfill:

- Wayde Nielson, Landfill Manager(435) 381-5450
- Southeastern Utah Health Department(435) 637-3671
- Director, DSHW(801) 536-0200
- Emery Co. Sheriff's Office(435) 381-2404

A record of conversation is completed as each of the entities is contacted. The record of conversation is kept in the site operational records.

3.4 MONITORING AND INSPECTION SCHEDULE

3.4.1 Groundwater

Emery County Landfill is not required to monitor groundwater as part of the landfilling operations at the Emery County Landfill; therefore, no inspections or maintenance activities are required.

3.4.2 Surface Water

Drainage control problems can result in accelerated erosion of a particular area within the landfill. Differential settlement of drainage control structures can limit their usefulness and may result in a failure to properly direct storm water off-site. Drawing 10 (Appendix A) illustrates the location of the surface water drainage control features designed to incorporate both existing topographical features as well as changes to the overall site layout. Landfill staff will inspect the drainage system monthly. Temporary repairs will be made to any observed deficiencies until permanent repairs can be scheduled.

3.4.3 Leachate Collection

Leachate is not collected as part of the landfilling operations at the Emery County Landfill; therefore, no inspections or maintenance activities are required.

3.4.4 Landfill Gas

This facility is monitored for methane gas on a quarterly basis. Concentrations of methane gas are measured with a hand-held gas monitor. Gas readings are recorded at each end of the active cell, the shop, fuel tanks, scalehouse, and other random locations. Readings are recorded on the methane log sheet and kept on file in the scalehouse. Gas monitoring activities at the Emery County Landfill are performed by the local health department (Southeastern Utah Health).

If methane releases are detected in excess of 25 percent of the LEL, in the landfill building or more than 100 percent of the LEL at the property boundary, the procedure outlined in the "Explosive Gases" section is followed.

3.4.5 Inspection Documentation

The results of all routine inspections of site facilities will be recorded on inspection forms. The inspection forms will be submitted to the Landfill Manager for inclusion in the landfill operating records as required in Section R315-302-2(5) of the Rules. Copies of all landfill forms utilized to document landfilling activities are included in Appendix C.

3.5 CONTINGENCY AND CORRECTIVE ACTION PLANS

The following sections outline procedures to be followed in case of fire, explosion, ground water contamination, release of explosive gases, or failure of the storm water management system.

The SWTC has an on-site mobile communications system for use in an emergency to communicate with the management offices and off-site personnel. Additional available communication is the telephone located in the scale house, which will serve as the back-up communication system.

3.5.1 Fire

3.5.1.1 Incoming Waste/ Incoming Vehicle Fire

The potential for fire is a concern in any landfill. The Emery County Landfill follows a waste handling procedure to minimize the potential for a landfill fire. If any load comes to the

landfill on fire, the vehicle will be directed to a designated section of the landfill, away from any exposed waste, and allowed to deposit the material. The designated area will vary depending on operational areas in use. The area will be readily accessible and within 1 or 2 minutes of the tipping area. The designated area will be isolated from the existing tipping area and will either be an excavated area with no underlying fill or at a location with a minimum of 1 foot of soil cover over underlying fill. In no case will a load thought to be burning be allowed to be dumped in the landfill.

Once burning waste is removed from the vehicle, the application of cover soil by landfill earth-moving equipment or the application of water by the on-site water truck to extinguish the fire can be carried out. Smothering the fire with soil is the preferred method. If, at any time, additional assistance is required, local fire-fighting units will be contacted. Once the burning waste cools and is deemed safe, the material is then be incorporated into the working face.

3.5.1.2 *Ground Fire/Below Cover Fire*

In the event that waste placed on the ground or waste that was previously covered erupts into fire, the material will be isolated from previously deposited waste as much as possible and the local fire department advised. This may be done by either moving burning wastes to another area or by concentrating the burning wastes using the landfill earth-moving equipment.

Once burning material is separated from other exposed waste, the application of cover soil by landfill earth-moving equipment or the application of water by a water tank truck to extinguish the fire can be carried out.

If, at any time, additional assistance is required, local fire-fighting units should be contacted as-soon-as possible.

3.5.2 *Explosion*

In the event that an explosion should occur or seem eminent at the landfill or in any structure associated with the landfill site, all personnel in the area, including those in surrounding buildings, will be evacuated immediately. In addition, site equipment will be moved away from the scene, if possible.

All landfill personnel will be accounted for and local emergency personnel (fire, police) will be contacted and informed of the situation. The Landfill Manager will be immediately informed of the situation and will notify the Executive Secretary immediately.

The explosion area will be restricted to both landfill personnel and residents until cleared for re-entry by local emergency personnel.

3.5.3 Release of Explosive Gases

Methane gas generation and concentration is not anticipated to be a problem at the Emery County Landfill. However, due to the production of methane in all landfills, landfill gas levels are monitored quarterly. If a concentration of methane is detected in excess of 25 percent of the LEL in a landfill building, 100 percent of the LEL at the property boundary, or over 100 parts per million in an off-site building, the following procedure is followed:

- All landfilling operations cease immediately. All personnel in the area, including those in surrounding buildings, will be evacuated immediately. In addition, site equipment will be moved away from the scene, if possible.
- All landfill personnel will be accounted for.
- Local emergency personnel (fire, police) will be contacted and informed of the situation.
- The Landfill Manager will be informed of the situation.
- The release area and surrounding area will be monitored with a combustible gas indicator (CGI) by landfill personnel and readings documented for placement into the operating record.
- The release area will be restricted to both landfill personnel and residents until cleared for re-entry by local emergency personnel.

The Emery County Landfill Manager will notify the Executive Secretary immediately and prepare a written report to be submitted within 14 days of detecting the release. The gas levels detected and a description of the steps taken to protect human health are placed in the

operating record within 60 days of detection and the Executive Secretary is notified that the plan has been implemented.

3.5.4 Failure of Run-Off Containment

The purpose of the run-on/run-off control systems is to manage the storm water falling in or near the landfill. Water is diverted away from the landfill using a series of ditches. These ditches are inspected on a regular basis and repaired as needed. All water falling on the working face is unable to flow out of the working area due to surface depressions left by the compactor. All storm water falling or flowing near the active landfill cell is prevented from flowing into the active area by diversion berms and ditches.

If the run-on or run-off system fails, temporary measures such as temporary berms, ditches, or other methods are used to divert water from the active landfill cell. The following actions will be taken to minimize the impact to the facility:

- Landfill personnel will immediately suspend filling operations, if containment failure is in an active fill area.
- Landfill personnel will use earth-moving equipment to construct temporary earthen berms in an effort to divert the flow of surface water away from the failure area and toward a holding area.
- The Landfill Manager will conduct damage assessment. A decision will be made as to whether the damage can be rectified by on-site personnel.
- If the damaged area cannot be reconstructed by on-site personnel, Emery County Landfill will notify the Emery County Road Department for assistance. If the damage is such that the Emery County Road Department can not repair the damage within 1 week, the Emery County Landfill Manager will contact a contractor to either re-design the containment system or initiate repairs to the existing system.
- The Emery County Landfill Manager will provide the necessary notices to the Executive Secretary and fully document the event in the operating record, including corrective action within 14 days.

3.5.5 Groundwater Contamination

If ground water contamination is ever suspected, studies to confirm contamination will be conducted and the extent of contamination documented. This program may include the installation of ground water monitoring wells. A ground water monitoring program would be developed and corrective action taken as deemed necessary, with the approval of the Executive Secretary.

3.6 CONTINGENCY PLAN FOR ALTERNATIVE WASTE HANDLING

Based on historical operations and a history of never needing to close down the site, landfilling operations should not have to be suspended due to inclement weather conditions or interruption of service. Emery County Landfill believes that their past operating experience and cautious operating procedures will negate the need for alternate waste handling plans.

3.7 MAINTENANCE PLAN

The following subsections offer a description of the maintenance of installed landfill equipment systems.

3.7.1 Groundwater Monitoring System

Emery County Landfill is not required to monitor groundwater as part of the landfilling operations at the Emery County Landfill; therefore, no maintenance will be performed.

3.7.2 Leachate Collection and Recovery System

Leachate is not collected as part of the landfilling operations at the Emery County Landfill; therefore, no maintenance activities will be performed.

3.7.3 Gas Monitoring System

Emery County Landfill is not required to collect landfill gas as part of the landfilling operations at the Emery County Landfill; therefore, no maintenance will be performed.

3.8 DISEASE AND VECTOR CONTROL

The vectors encountered at the Emery County Landfill are flies, birds, mosquitoes, rodents, skunks, and snakes. Due to the rural location of the landfill, stray house pets are occasionally encountered at the landfill. The program for controlling these vectors is as follows:

3.8.1 Insects

Eliminating breeding areas is essential in the control of insects. Emery County Landfill minimizes the breeding areas by covering the waste daily and maintaining surfaces to reduce ponded water. The mosquito abatement district personnel assist the landfill as necessary.

3.8.2 Rodents

Reducing potential food sources minimizes rodent populations at the landfill. To date, no significant numbers of mice or rats have been observed. The potential food sources are minimized by properly applying daily cover.

In the event of a significant increase in the number of rodents at the landfill, a professional exterminator will be contacted. The exterminator would then establish an appropriate protocol for pest control in accordance with all county, state and federal regulations.

3.8.3 Birds

The Emery County Landfill has had minimal problems with birds (crows). Good landfilling practices of waste compaction, daily covering of working faces, and the minimization of ponded water has to date alleviated most of the bird problems. When the occasional need arises, the birds are encouraged to leave by using cracker and whistler shells.

3.8.4 Household Pets

Because of the landfill's location, some stray cats and dogs have wandered onto landfill property. When stray animals are encountered (and can be caught), they are turned over to the animal shelter. If we are unable to apprehend the animals, they are chased off the property. If the animals return and cannot be caught, lethal methods are used to eliminate the problem.

3.8.5 Wildlife

Emery County Landfill has a variety of wildlife located on or near the landfill property. Wildlife includes deer, snakes, foxes, skunks, and coyotes. The only operational problems with wildlife to date have been with an occasional skunk or snake. When problem skunks or snakes are encountered, they are exterminated. If other site wildlife becomes a problem, the landfill will coordinate with the Division of Wildlife Resources to provide methods and means to eliminate the problem.

In the event that any of these vectors become an unmanageable problem, the services of a professional exterminator will be employed.

3.8.6 Fugitive Dust

The roads leading to the landfill and the landfill face are paved, however; landfill construction activities and daily traffic produce a certain amount of dust. Landfill activities compounded by the occasional high wind present a fugitive dust problem. If the dust problem elevates above the "minimum avoidable dust level", the landfill applies water to problem areas.

The landfill has access to a water truck that is maintained by the Emery County Road Department. Water is applied to the unpaved surfaces receiving traffic within the landfill in compliance with the Utah Division of Air Quality requirements. Water or a dust palliative is applied as often as needed in order to control the dust on site.

3.8.7 Litter Control

Due to the nature of landfilling operations, litter control is an ongoing problem. Landfill personnel perform routine litter cleanup to keep the landfill and surrounding properties clear of windblown debris.

Whenever possible, the working face is placed down wind so that blowing litter is worked into the landfill face. During windy conditions, landfill personnel minimize the spreading of the waste to reduce the amount of windblown debris

3.9 RECYCLING PROGRAM

Emery County Landfill has a somewhat limited recycling program due to its relatively small daily waste streams and the logistical remoteness from viable recycling markets. Deseret

Industries has been allowed space at the facility to place a collection van. Landfill patrons are encouraged to recycle useful items through the Deseret Industries program. The full collection vans are replaced monthly with an empty van.

Metal products are periodically separated from the landfill waste stream when practical and when the recycled metal market will pay for the costs of the metal diversion. The exception to the metal recycling program as stated above is when large structural members are exposed in the waste stream, those structural members are set aside for County use.

Appliances are inspected with recyclable units being set aside for recycling by a local appliance dealer. Useable paints and some building materials are set aside weekly for "give and take" reuse by landfill patrons.

The Emery County Landfill serves as an oil recycling center. Do-It-Yourselfers oil and antifreeze are gathered and disposed of under the guidelines of the State program. Batteries brought to the landfill or discovered as part of the daily operation are collected and stored on a pallet to be recycled by a local battery dealer.

A modest effort is made to separate and compost clean organic matter. The organic matter is made available to the public at no cost.

3.10 TRAINING PROGRAM

Emery County Landfill personnel will be trained on how to identify unacceptable waste including liquid wastes, sludge, potential regulated hazardous waste, and PCB wastes. Personnel to be trained will include the SWTC, and all SWT. The training will emphasize methods of identifying containers and labels typical of hazardous and PCB waste. Training will also address the proper handling of unacceptable waste. All employees will receive on the job training in landfill operations and waste screening. This training will include operations and safety training. New employees will receive training during their first 3 months of employment. The Landfill Manager will be trained and certified as a Manager of Landfill Operations (MOLO). Upon completion of 5 years of landfill experience, the SWTC will receive the MOLO training.

3.11 RECORDKEEPING

Emery County Landfill personnel will maintain an operating record which will be available at the Emery County offices. This record will include: inspection records, training procedures, notification procedures; methane monitoring results and remediation plans, if required; closure and post-closure care plans; financial assurance documentation and cost estimates.

Records will be kept throughout the life of the facility, including post-closure care. Documents will be organized, legible, dated, and signed by the appropriate personnel. The information in the operating record will be available to citizens through the Utah Government Records Access Management Act (GRAMA).

3.11.1 Weights or Volumes of Incoming Waste

Emery County Landfill will record and retain in the operating record all documentation made with respect to any weights or volumes of incoming wastes as allowed by State of Utah Administrative Rule R315-302-2. An annual summary of scale records will also be placed into the operating record.

3.11.2 Number of Vehicles Entering Facility

Emery County Landfill will record and retain in the operating record all documentation made with respect to the number of vehicles entering the facility as allowed by State of Utah Administrative Rule R315-302.

3.11.3 Types of Wastes Received Each Day

Emery County Landfill will record and retain in the operating record all documentation made with respect to the types of waste received each day at the facility as allowed by State of Utah Administrative Rule R315-302.

3.11.4 Deviation from Approved Operations Plan

At any time during the operational life or post-closure care period of the Emery County Landfill, UDEQ may set alternative schedules for recordkeeping and notification. However, it is anticipated that any modifications to the schedule for recordkeeping will be discussed with Emery County Landfill personnel prior to official notice from the State of Utah.

3.11.5 Training Procedures

Emery County Landfill will record and retain in the operating record all documentation made with respect to any training programs or procedures as allowed by State of Utah Administrative Rule R315-302.

3.11.6 Inspection Log or Summary

Emery County Landfill will record and retain in the operating record all documentation made with respect to any inspection logs or summary sheets as allowed by State of Utah Administrative Rule R315-302

3.11.7 Closure and Post-Closure Care Plans

Emery County Landfill will record and retain in the operating record all documentation made with respect to the closure and post-closure care plans as allowed by State of Utah Administrative Rule R315-302-3.

3.11.8 Cost Estimates and Financial Assurance Documentation

Emery County Landfill will record and retain in the operating record all documentation made with respect to the cost estimates and financial assurance documentation as allowed by State of Utah Administrative Rule R315-309.

3.11.9 Other Records as Required by the Executive Secretary

Emery County Landfill will record and retain in the operating record all documentation made with respect to other processes, variances, and violations as required by the State of Utah.

3.12 SUBMITTAL OF ANNUAL REPORT

Emery County Landfill will submit a copy of its annual report to the Executive Secretary by March 1 of each year for the most recent calendar or fiscal year of facility operation. The annual report will include facility activities during the previous year and will include, at a minimum, the following:

- Name and address of facility.
- Calendar or fiscal year covered by the annual report.

- Annual quantity, in tons or volume, in cubic yards, and estimated in-place density in pounds per cubic yard of solid waste handled for each type of treatment, storage, or disposal facility, including applicable recycling facilities.
- Annual update of required financial assurances mechanism pursuant to Utah Administrative Code R315-309.
- Results of gas monitoring.
- Training programs completed.

3.13 INSPECTIONS

The Landfill Manager, or his/her designee, will inspect the facility to prevent malfunctions and deterioration, operator errors, and discharges that may cause or lead to the release of wastes to the environment or to a threat to human health. These inspections will be conducted on a quarterly basis, at a minimum. An inspection log will be kept as part of the operating record. This log will include at least the date and time of inspection, the printed name and handwritten signature of the inspector, a notation of observations made, and the date and nature of any repairs or corrective actions. Inspection records will be available to the Executive Secretary or an authorized representative upon request.

3.14 RECORDING WITH COUNTY RECORDER AND THE STATE OF UTAH DIVISION OF SOLID AND HAZARDOUS WASTE

Plats and other data, as required by the County Recorder, will be recorded with the Emery County Recorder as part of the record of title no later than 60 days after certification of closure. Additionally, Emery County Landfill will submit proof of record of title filing to the Executive Secretary.

3.15 STATE AND LOCAL REQUIREMENTS

The Emery County Landfill will maintain compliance with all applicable state and local requirements including zoning, fire protection, water pollution prevention, air pollution prevention, and nuisance control.

3.16 SAFETY

Landfill personnel are required to participate in an ongoing safety program. This program complies with the Occupational Safety and Health Administration (OSHA), and the National

Institute of Occupational Safety and Health (NIOSH) regulations as applicable. This program is designed to make the site and equipment as secure as possible and to educate landfill personnel about safe work practices.

First Aid and CPR training is provided to all landfill personnel by the Emery County Road Department Safety Technician every 2 years. The name of each person to have a first aid certificate is posted beside the telephone numbers. It is preferable to have one first aid certified personnel on site during all normal operating hours.

3.17 EMERGENCY PROCEDURES

In the event of an accident or any other emergency situation, the Equipment Operator notifies the Landfill Operator Crewleader who immediately contacts the Landfill Manager and proceeds as directed. If the Landfill Manager is not available, the Landfill Operator Crewleader calls the appropriate emergency number posted by the telephone. The emergency telephone numbers are:

- Emery County Central Dispatch.....911
- Fire Department.....911
- Sheriff's Office(435) 381-2404
- Highway Patrol(435) 637-0893
- Carbon/Emery County Fire Marshal.....(435) 637-0893
- Castleview Hospital(435) 637-4800
- Wayde Nielson, Landfill Manager(435) 381-5450

**APPLICATION TO RENEW A PERMIT TO
OPERATE A CLASS I LANDFILL**

Emery County Landfill

PART III - TECHNICAL AND ENGINEERING REPORT

TABLE OF CONTENTS

1.0 - GEOHYDROLOGICAL ASSESSMENT	1
1.1 GEOLOGY AND HYDROLOGY	1
1.1.1 Regional Geology	1
1.1.2 Local Geology	1
1.1.3 Permeability	2
1.1.4 Hydrology	2
1.2 HYDROGEOLOGY AND GROUNDWATER	3
1.3 WATER RIGHTS	4
1.4 SURFACE WATERS	4
1.5 BACKGROUND WATER QUALITY	4
1.5.1 Surface Water	4
1.5.2 Groundwater	4
1.6 SITE WATER BALANCE	5
2.0 - ENGINEERING REPORT	6
2.1 LOCATION STANDARDS - EXISTING AND PROPOSED LANDFILL EXPANSION	6
2.1.1 Land Use Compatibility Requirements	7
2.1.1.1 <i>Emery County Land Use Compatibility</i>	7
2.1.2 Geology and Geotechnical Engineering	9
2.1.2.1 <i>Geologic Hazards</i>	9
2.1.2.2 <i>Fault Areas</i>	9
2.1.2.3 <i>Seismic Impact Zone</i>	9
2.1.2.4 <i>Seismic Impact Zone Analysis</i>	10
2.1.2.5 <i>Unstable Areas</i>	13
2.1.3 Surface Water Requirements	14
2.1.4 Wetlands Requirements	14
2.1.5 Groundwater Requirements	14
2.1.5.1 <i>Emery County Landfill Groundwater</i>	15
2.2 FACILITY LIFE	15
2.3 CELL DESIGN	16
2.3.1 Liner	16
2.3.2 Fill Method	16
2.3.3 Daily, Intermediate and Final Cover	17
2.3.3.1 <i>Daily and Intermediate Cover</i>	17
2.3.3.2 <i>Final Cover</i>	18
2.3.3.3 <i>Borrow Sources</i>	21
2.3.3.4 <i>Elevations of Liner and Final Cover</i>	21

2.3.4	Equipment Requirements and Availability.....	21
2.4	MONITORING SYSTEM DESIGN - EXISTING AND PROPOSED LANDFILL EXPANSION	22
2.4.1	Groundwater	22
2.4.2	Leachate Collection and Treatment System	22
2.4.3	Landfill Gas.....	23
2.5	DESIGN AND LOCATION OF RUN-ON/RUN-OFF CONTROL SYSTEMS	23
2.5.1	Run-On from a 24-Hour, 25-Year Storm.....	23
2.5.2	Run-Off from a 24-Hour, 25-Year Storm.....	23
2.6	CLOSURE PLAN - EXISTING AND PROPOSED LANDFILL EXPANSION.....	24
2.6.1	Closure Schedule	24
2.6.2	Design of Final Cover.....	25
2.6.3	Final Inspection	26
2.7	POST-CLOSURE CARE PLAN - EXISTING AND PROPOSED LANDFILL EXPANSION	26
2.7.1	Site Monitoring.....	26
2.7.1.1	<i>Gas Monitoring</i>	26
2.7.1.2	<i>Land Monitoring</i>	26
2.7.1.3	<i>Groundwater Monitoring</i>	27
2.7.1.4	<i>Surface Water Monitoring</i>	27
2.7.2	Changes to Record of Title, Land Use and Zoning	27
2.7.3	Maintenance	28
2.7.4	Post-Closure Contacts.....	28
2.8	POST-CLOSURE LAND USE - EXISTING AND PROPOSED LANDFILL EXPANSION.....	28
2.9	FINANCIAL ASSURANCE.....	29
2.9.1	Closure Costs.....	29
2.9.2	Post Closure Care Costs	29
2.9.3	Financial Assurance Mechanism	29
3.0	- REFERENCES.....	31

APPENDIX A - PROJECT DRAWINGS

APPENDIX B - PROPERTY DEED

APPENDIX C - LANDFILL FORMS

APPENDIX D - WATER RIGHTS SEARCH

APPENDIX E - LANDFILL EXEMPTIONS

APPENDIX F - LANDFILL SITING DOCUMENTATION

APPENDIX G - LANDFILL STABILITY

APPENDIX H - LABORATORY TEST RESULTS

APPENDIX I - PRECIPITATION AND E.T. DATA

APPENDIX J - FINANCIAL ASSURANCE, LANDFILL LIFE, CLOSURE COST ESTIMATES

1.0 - GEOHYDROLOGICAL ASSESSMENT

1.1 GEOLOGY AND HYDROLOGY

1.1.1 Regional Geology

The Emery County Landfill is located near the western boundary of Castle Valley, in the Mancos Shale Lowlands section of the Colorado Plateau (Witkind, 1995; Hintze, 1993; Hintze, 1980; Stokes, 1986). Castle Valley is an erosional valley located in the western portion of the Colorado Plateau Province, within a series of northerly-dipping Cretaceous age units that form the sinuous margin between the southern Uinta Basin and the San Rafael Swell. These Cretaceous age strata comprise the Book Cliffs, Roan Cliffs and other prominent topographic rises. The Colorado Plateau Province is characterized by high plateaus and intervening lowlands, which contain relatively continuous geologic strata. These plateaus were not as widely affected by the prevalent large-scale normal faulting that characterizes the Basin and Range Province farther to the west. The Lowlands are the largest region of level land in central and eastern Utah, extending from the town of Emery eastward to Utah's border with Colorado. The western edge of the Mancos Shale Lowlands occurs at the eastern edge of the Great Basin-Colorado Plateau Transition Province, adjacent to the Wasatch Plateau.

Surface drainages flow eastward out of the Wasatch Plateau, across Castle Valley to Green River. The Mancos Shale Lowlands are crossed by only a few permanent streams and by a great number of intermittent washes draining higher country to the north and west.

Groundwater resources are limited near the Emery County Landfill. Small quantities of ground water (less than 10 gallons per minute) are produced in the southern portion of Castle Valley from the Ferron Sandstone Member of the Mancos Shale. Groundwater quality is poor, with total dissolved solids (TDS) usually exceeding 3,000 milligrams per liter (mg/l) (Lines and Morrissey, 1983).

1.1.2 Local Geology

The Emery County Landfill has been constructed on Wilberg Flat, a young pediment surface in the eastern half of section 16 and is proposed to extend laterally northward into section 9 (T18S R8E, SLBM). Much of the pediment gravel on Wilberg Flat was formed by erosion

and redeposition of older pediment gravel exposed at higher elevations on Danish Bench, to the west of the Landfill. The balance of the gravel was eroded directly from sandstones that cap the Mancos Shale in bluffs five miles northwest of the Landfill.

Wilberg Flat is underlain by the Main Body of the Blue Gate Member consists of light-bluish-gray and gray, thin- to medium-bedded shale and shaley siltstone that contains sparse interlayered thin sandstone beds (Witkind, 1995). This unit is reported to be up to 610 meters thick and at the site, the formation is observed to form rounded hills with relatively flat plateau tops.

The boundary between Wilberg Flat and the older pediment surface of Danish Bench occurs along a northwest to southwest trending, northeast facing bluff. The bluff is approximately 120 feet high near the center of Section 16. Approximately 10 feet of older pediment gravel overlies Mancos Shale at the top of the bluff. The remainder of the bluff is shale, locally obscured by loose fragments of gravel eroded from the pediment gravel at the top of the bluff.

1.1.3 Permeability

The most pertinent layer separating the migration of water and contaminants from the surface to deeper aquifers is the Blue Gate Member of the Mancos Shale that extends from near surface to approximately 1600 feet below the Emery County Landfill. Results of slug tests performed in two monitor wells drilled into the Blue Gate Member of the Mancos Shale were submitted to the Utah Division of Solid and Hazardous Waste by Bingham Environmental, Inc. The interval tested was from 30 to 110 feet below the existing ground surface. Bingham Environmental reported an average hydraulic conductivity of 5×10^{-5} cm/sec. Bingham also reported an average effective porosity of six percent for the shale in this interval.

1.1.4 Hydrology

The Emery County Landfill Site is located in alluvial outwash located several miles from the east slope of the Wasatch Mountains. The terrain consists of small washes, ravines and ridges. These washes may collect local runoff and transport small quantities of water over short distances, but do not appear to transport runoff and flash flood waters/debris flow of significant volume over long distances. This is apparent due to the lack of recent erosion in the washes surrounding the site.

Based on a review of climatological data for the Orangeville area, wet years produce 10 to 13 inches of total annual rainfall. Average annual rainfall at the site over the past nearly 100 years is 8.5 inches. Average annual evapotranspiration at the site is over 45 inches (Utah Climate Center, Utah State University). As shown, the Emery County Landfill site is arid and the majority of the precipitation is soaked up by the surface soils. However, during high intensity precipitation events some brief flash flooding can occur.

1.2 HYDROGEOLOGY AND GROUNDWATER

The only significant aquifer near the Emery County Landfill is the Ferron Sandstone Member of the Mancos Shale. The Ferron Sandstone Member occurs directly below the Blue Gate Member about 1,600 feet below the existing ground surface at the Emery County Landfill location.

The largest source of recharge to the Ferron Sandstone aquifer is subsurface inflow from the west under the Wasatch Plateau. Subsurface inflow near the town of Emery was estimated by Lines and Morrissey at 2.4 cubic feet per second. Most of this moves laterally through crushed zones in the Joes Valley fault system. Lines and Morrissey also stated that “little” water is recharged to the aquifer by precipitation on the outcrop area. Data from Lines and Morrissey suggest that near the Emery County Landfill, the groundwater in the Ferron Sandstone aquifer flows from west to east and infiltration from the surface to the Ferron Sandstone is negligible.

The Blue Gate Member of the Mancos Shale lies directly above the Ferron Sandstone Member and extends to the surface at the Emery County Landfill site as stated previously. The Blue Gate Member is not considered a good aquifer. An aquifer is defined as “a permeable geologic unit that can transmit and store significant quantities of water (Maidment, 1992). The Blue Gate is permeable where fractured, but neither transmits nor stores significant quantities of usable water. Based on a single boring completed by Tahoma, a minor amount of perched groundwater was encountered at 140 feet and a more significant water table was encountered at 372 below the existing ground surface. No information on the direction of flow for this groundwater was available, however we anticipate all groundwater flow to be west to east based on the hydrogeologic conditions at the site.

1.3 WATER RIGHTS

Records of the Utah Division of Water Rights have been reviewed to obtain information on points of diversion, water use classifications and depths of wells near the Emery County Landfill. No water rights or subsurface points of diversion have been claimed or developed within a one mile radius of the landfill or within Sections 9 or 16. A single "point to point" surface diversion is located just over 2015 feet east of the site. This diversion point is located on an ephemeral stream bed and is used for stock watering. Water quality data was not available for this diversion; however, given its use we do not anticipate it to be of high quality. Complete results of our water rights search are located in Appendix D.

1.4 SURFACE WATERS

There are no permanent impoundments or surface water or perennial streams present within a one mile radius of the site.

1.5 BACKGROUND WATER QUALITY

1.5.1 Surface Water

Because there are no existing permanent surface water impoundments on or near the site, no surface water quality assessment was performed.

1.5.2 Groundwater

Tahoma recovered water samples at 372 feet from the water table encountered in the Blue Gate Member of the Mancos Shale formation during drilling. These samples were analyzed by the Southern Utah University Water Laboratory. The results of the test indicate a total dissolved solids (TDS) content of 38,400 mg/l.

Published information on the quality of water in the Ferron Sandstone Aquifer was summarized by Lines and Morrissey (1983). Their summary shows that the TDS in groundwater taken from the Ferron Sandstone Member ranged from 500 to more than 50,000 mg/l. The following table summarizes findings from Lines and Morrissey for locations closest to the Emery County Landfill:

Section	Township	Range	Sample Depth (ft)	TDS (mg/l)
25	17 South	7 East	Not Known	14,541
16	17 South	10 East	185-205	3,840
27	20 South	7 East	804-806	21,534
3	20 South	8 East	105	8,120
4	20 South	8 East	120	10,100

1.6 SITE WATER BALANCE

As stated previously in the Hydrology Section of this report, due to the amount of precipitation and evapotranspiration we anticipate runoff from the Emery County Landfill to be minimal. Tahoma used HELP3 computer program to model the site water balance and included the results in the Exemption Request (Appendix D of Tahoma document) found in Appendix E.

2.0 - ENGINEERING REPORT

2.1 LOCATION STANDARDS - EXISTING AND PROPOSED LANDFILL EXPANSION

In addition to the Subtitle D criteria, DSHW has adopted specific location standards. The Utah location standards for Municipal Solid Waste Landfills (MSWLFs), as presented in the Solid Waste Permitting and Management Rules (R315-302), are outlined below.

- Land Use Compatibility (UAC R315-302-1(2)a)
 - Not to be located within 1000 feet of Parks and protected areas
 - Not to be located in an ecologically and scientifically significant area
 - Not to be located on prime or unique farmland
 - Not to be located within ¼ mile of existing dwellings, incompatible or historical structures, unless allowed by local land use planning or zoning
 - Not to be located within 5,000 feet of airport runways
 - Not to be located on archeological sites

- Geology (UAC R315-302-1(2)b)
 - Proximity to a Holocene Fault
 - Considerations for constructing in a seismic impact zone
 - Consideration given to unstable areas

- Surface Water (UAC R315-302-1(2)c)
 - Will not affect public water system
 - Will not affect existing lakes, reservoirs and ponds
 - Cannot be located in a floodplain unless certain criteria are met

- Wetlands (UAC R315-302-1(2)d) Not allowed unless:
 - Alternative location has been denied previously
 - Will not violate state water quality standard or Clean Water Act
 - Will not jeopardize threatened or endangered species
 - Will not cause or contribute to significant degradation of the wetlands

- Groundwater (UAC R315-302-1(2)e)
 - Groundwater/landfill cell separation
 - Sole source aquifer
 - Groundwater quality
 - Source protection areas

The following sections present the Utah MSWLF location standards and discuss the status of the Emery County Landfill's compliance with those requirements.

2.1.1 Land Use Compatibility Requirements

The existing landfill and proposed expansion meets all criteria outlined in UAC R315-302-1(2)(a) as shown below. Documentation of the items listed below is found in Appendix F.

2.1.1.1 *Emery County Land Use Compatibility*

- The existing facility and proposed expansion area is not within 1,000 feet of a national, state or county park, monument or recreation area; designated wilderness or wilderness study area; or wild and scenic river area.

Source(s): Gnojek, Tom, U.S. bureau of Land Management, San Rafael River Resource Area, Price, Utah. See Letter from Tahoma Companies dated April 5, 1994 and Environmental Assessment (DOI-BLM-UT-G021-2009-0083EA); Table "Resource Issues Considered" included in Appendix K.

- The existing facility and proposed expansion area is not within an ecologically and scientifically significant natural area, including wildlife management areas and habitat for threatened or endangered species as designated pursuant to the Endangered Species Act of 1982.

Source(s): Williams, Robert D., U.S. Fish and Wildlife Service; Salt Lake City, Utah. See letter from Tahoma Companies dated March 31, 1994. and Environmental Assessment (DOI-BLM-UT-G021-2009-0083EA); Table "Resource Issues Considered" included in Appendix K.

- The existing facility and proposed expansion area is not located on farmland classified as “prime” or “unique.”

Source(s): Jacobsen, Kyle “Jake”, Utah Department of Agriculture, Salt Lake City, Utah. See letter from Tahoma Companies dated March 30, 1994. Environmental Assessment (DOI-BLM-UT-G021-2009-0083EA) See Table “Resource Issues Considered” (Appendix K).

- The facility is not within one-fourth mile of:
 - a) Existing permanent dwellings, residential areas and other incompatible structures such as schools or churches.

Source: Field investigation by Brett Mickelson of IGES, Inc.

- b) Historic structures or properties listed or eligible to be listed in the State of National Register of Historic Places.

Source: Dykmann, James L., State of Utah, Utah State Historical Society. See letter from Tahoma Companies dated March 30, 1994 and response letter from the State of Utah dated April 12, 1994.

- The facility is not within 10,000 feet of any airport runway end used by turbojet aircraft or within 5,000 feet of any airport runway used by any piston-type aircraft.

Source: Rodda, Dave, Aviation Safety Inspector, Federal Aviation Agency, Salt Lake City, Utah. See letter from Tahoma Companies dated April 11, 1994.

- The facility is not within an archaeological site that would violate Section 9-8-204.

Source: Dykmann, James L., State of Utah, Utah State Historical Society. See letter from Tahoma Companies dated March 30, 1994 and response letter from the State of Utah dated April 12, 1994.

- The facility is not within an area that is at a variance with the Emery County land use plan or zoning requirements.

Source: Environmental Assessment (DOI-BLM-UT-G021-2009-0083EA).

2.1.2 Geology and Geotechnical Engineering

2.1.2.1 Geologic Hazards

The Utah State Regulations indicate “No new facility or lateral expansion of an existing facility shall be located in a subsidence area, a dam failure flood area, above an underground mine, above a salt dome, above a salt bed, or on or adjacent to geologic features which could compromise the structural integrity of the facility”.

The Emery County Landfill is not adjacent to geologic features that could compromise the structural integrity of the facility. The landfill is not in a subsidence area, a dam failure flood area, above an underground salt dome or a salt bed. Minor washes through the site could be subject to debris flow and/or alluvial fan flooding but in general these washes are not large enough to convey water or debris of sufficient quantity to jeopardize the landfill.

2.1.2.2 Fault Areas

A new landfill may not be located within 200 feet of an active (Holocene) fault. There are no known active faults that pass under or within 200 feet of the Emery County Landfill (Witkind, 1995; Hecker, 1993). The site is located approximately 21 miles east of the Joe’s Valley fault zone. This fault zone is reported to have been active in Holocene time and to have a 7.5 M_s estimated maximum credible earthquake (Hecker, 1993). The site is also located approximately 38 miles southeast of the Strawberry Valley fault. The Strawberry fault has a reported rupture length of 17.4 miles and a maximum potential magnitude of 7.0. The most recent activity on the Strawberry fault is reported to be early to middle Holocene.

2.1.2.3 Seismic Impact Zone

The EPA and the DSHW define a seismic impact zone as any location with a 10% or greater probability that the maximum horizontal acceleration (MHA) in lithified earth material, expressed as a percentage of the earth’s gravitational pull, will exceed 0.10g in 250 years.

Tahoma Companies in 1996 indicated there was a 10 percent chance in 250 years that the area could experience horizontal accelerations of 0.20g or greater. Based on the latitude and longitude of the landfill, the United States Geological Survey (USGS) Seismic Hazard Curves and Uniform Hazard Response Spectra V5.0.9 indicate an MHA value of 0.264g for the site. This value is an estimated ground surface acceleration from the 2002 data edition for a 2% probability of exceedance in 50 years. Therefore, the site does lie within a Seismic Impact Zone.

The MHA in lithified earth material is defined in 40 CFR part 258.14 (EPA 1991) as the “maximum expected horizontal acceleration depicted on a seismic hazard map with a 90% or greater probability that the acceleration will not be exceeded in 250 years, or the maximum expected horizontal acceleration based on site specific seismic risk assessment.” This definition was adopted in full by the DSHW. The MHA of 0.2g or greater indicated by Tahoma in 1996 was based on modified USGS maps from “Probabilistic Earthquake Acceleration and Velocity Maps for the United States and Puerto Rico by S.T. Algermissen, D.M. Perkins, P.C. Thenhaus, L.S. Hanson and B.L. Bender (1990)”. These maps have recently been superseded by the “United States Geologic Survey’s (USGS) Earthquake Hazards Program – National Seismic Hazard Mapping Project”. Based on the latitude and longitude of the site, these more recent maps indicate an MHA value of 0.264g for the site. This value is an estimated ground surface acceleration of a “firm rock” site, which is identified as having a shear-wave velocity of 760 m/sec in the top 30 meters and sites with different soil types may amplify or de-amplify this value.

Based on our limited field investigations and our understanding of the soils at the site, it is our opinion the site best fits within the International Building Code (IBC) Site Class B described generally as “rock” having seismic coefficients $F_a = 1.0$ and $F_v = 1.0$.

2.1.2.4 *Seismic Impact Zone Analysis*

A seismic study was performed by Tahoma Companies, Inc. in May of 1996, and is included as Appendix H. IGES performed a review of Tahoma’s seismic study and felt additional analysis should be performed based on the more recent and updated data available pertaining to the waste and soil strength properties and the updated MHA information discussed previously.

Based on the proposed landfill geometry, new cross-sections of the bottom excavation and final cover were generated and used in modeling static and seismic stability. The most critical section, based on the geometry of the bottom excavation and final covers, was modeled. These sections and slope stability modeling are presented in Appendix G.

The MSW unit weight and strength properties assumed by Tahoma were reviewed. Tahoma used a unit weight value of 50.73 pounds per cubic foot (pcf). Based on a review of the daily cover and compaction processes currently in use at the Emery County Landfill we estimate the unit weight of the refuse to be as low as 1000 pounds per cubic yard (pcy) and up to 1400 pcy, depending on the height of the overburden. This corresponds to 37 and 52 pcf, respectively, and therefore we feel 51 pcf is a reasonable representation of the MSW unit weight. Static and pseudo-static slope stability models were performed on Profile 2 with a unit weight of 51 pcf. Assuming a unit weight of 51 pcf for the MSW incorporates time dependant consolidation that may take place and is conservative as the higher unit weight represents a higher instability driving force for both the static and pseudo-static cases.

Based on a large scale direct shear test performed in-situ to measure strength properties of MSW, Withiam et al, 1995, obtained a friction angle of 30 degrees and a cohesion intercept of 200 pounds per square foot (psf). Other work by Kavazanjian et al (1995), suggest a friction angle of 33 degrees and a shearing strength of 500 psf below a normal stress of 627 psf for MSW. Based on this information a value of 30 degrees for the angle of internal friction and 150 psf for the cohesion intercept were used to define the strength properties of the anticipated MSW. These parameters compare to MSW strength properties of 20 degrees and 100 psf for the friction angle and cohesion intercept used by Tahoma.

Strength properties and unit weight of the on-site shale were estimated by Tahoma to have a friction angle of 22 degrees and a cohesion intercept of 3,446 psf as well as a unit weight of 147.5 pcf. No basis for these values, such as laboratory testing, was presented. An analysis was performed using RocData v.4.0 by RocScience to validate the strength parameters used by Tahoma. The analysis, which utilizes an extensive database of rock strength data, yielded a friction angle of 22 degrees for the range of stresses from 0 to 16,000 psf and a cohesion intercept of 1250 psf, slightly lower than that used by Tahoma. A reasonable unit weight for the shale was assumed to be 145 pcf.

To estimate the potential amplification of the free field acceleration (0.264g) as it travels up to the base of the landfill and then from the bottom of the landfill to the top of the landfill, a simplified approach was utilized. This method uses the information from Singh and Sun (1995) and Kavazanjian and Matasovic (1995) to estimate the potential amplification. The simplified two step procedure is outlined as follows: 1) estimate the free field peak ground surface acceleration at the base of the refuse; and 2) estimate the peak acceleration at the top of the landfill.

Based on the soil profile initially identified by Tahoma Companies, Inc. the upper 100 feet of material classifies as a firm rock site (firm rock soil profile according to IBC 2006). Therefore, a MHA of 0.264g was used as the ground surface acceleration at the base of the refuse. Based on an average shear wave velocity of 700 feet per second and using the analytical data from Singh and Sun (1995), the peak acceleration for a 200 foot high fill was 0.184g and 0.382g for a 100 foot high fill. Using linear extrapolation for the maximum fill height of approximately 70 feet, the anticipated peak acceleration is 0.441g. Appropriately, an average acceleration of 0.353g was used in the stability and deformation analysis performed for the waste mass.

Hynes and Franklin (1984) performed several Newmark seismic deformation analyses on embankments using 387 strong motion records and 6 artificial accelerograms. The analyses performed considered the yield accelerations (minimum acceleration to cause failure) of the slope sections evaluated by pseudo-static methods and compared them to the anticipated horizontal embankment accelerations. Based on these analyses performed by Hynes and Franklin, deformations are anticipated to be one meter or less if the yield acceleration is less than or equal to one-half the horizontal acceleration, with a 20% reduction in shear strength of the waste mass. Therefore, using a horizontal acceleration of 0.176g to obtain a pseudo-static factor of safety of 1.0 or greater indicates satisfactory performance of the waste mass under seismic conditions (deformation less than 1 meter).

Static and pseudo-static analyses of the slope sections were performed using critical sections of the landfill geometry and the soil and waste parameters outlined previously. Results of these analyses are presented in Appendix I. The static and pseudo-static slope stability analyses were completed using the computer program SLIDE v.6.0 by RocScience. The properties used in the slope stability analyses are summarized below.

Material	Unit weight (pcf)	Cohesion intercept, static (psf)	Cohesion intercept, seismic (psf)	Friction angle, static (deg)	Friction angle, seismic (deg)
MSW	51	150	120	30	25
Shale	145	1,250	1,250	22	22

A summary of the static and seismic (pseudo-static and deformation) analyses, based on the change in the waste strength parameters and the new seismic data generated for the soil profile, is presented below. Slope stability runs of the static and seismic analyses are provided in Appendix G.

Section	Direction	Analysis	Minimum FS	Deformation (meters)
SS-2	North	Static	3.16	-
		Seismic	1.44	<1
		Static - Cap	3.86	-
		Seismic - Cap	1.98	<1

Typical allowable limits in stability analysis are; a minimum factor safety of 1.5 for static conditions, a minimum factor of safety of 1.0 during pseudo-static (seismic) conditions, and a maximum allowable deformation of 1 meter. Based on the results of the analyses performed using the planned geometry of 4H:1V slopes in the final cover, the stability of the slopes in all areas is above the minimum standards.

2.1.2.5 Unstable Areas

The owner or operator of a landfill must consider several factors when determining whether and area is unstable. Among them are soil conditions, geologic or geomorphic features, and human-made features or events at the surface and in the subsurface.

Soil conditions at the Emery County Landfill site are well suited for the landfill. The site is in a relatively remote area in the foothills of the eastern slope of the Wasatch Mountain Range. The soils underlying the site consist predominantly of Shale Bedrock with some areas containing an overburden layer of silty gravel that is relatively dense and sometimes moderately cemented. The shale is reported to be approximately 1650 feet thick beneath the landfill.

The gravel and shale material underlying the landfill site is relatively incompressible given the height and unit weight of the waste mass. Settlement of the landfill will be limited to consolidation within the waste itself and not the underlying soils. Several inches of consolidation within the waste should be anticipated, however, ten to one (10H to 1V) slopes should be adequate for maintaining adequate drainage.

2.1.3 Surface Water Requirements

DSHW has adopted Subtitle D location restrictions for floodplains and wetlands. The Emery County Landfill site is not within a floodplain or wetland. All potential run-on water from the drainage will be diverted around the landfill site by shallow ditches or low berms.

No permanent impoundments of surface water or perennial streams are present within a one mile radius of the landfill.

2.1.4 Wetlands Requirements

The Emery County Landfill is not situated in a designated wetlands area.

2.1.5 Groundwater Requirements

DSHW location restrictions with respect to groundwater protection include the following:

- No new facility shall be located at a site where the bottom of the lowest liner is less than 5 feet above historical high level of groundwater in the uppermost aquifer.
- No new facility shall be located over a sole source aquifer as designated in 40 CFR 149.
- No new facility shall be located over groundwater classified as IB under Section R317-6-3.3 (an irreplaceable aquifer).
- A new facility located above any aquifer containing groundwater which has a total dissolved solids (TDSs) content below 1,000 milligrams per liter (mg/l) and does not exceed applicable groundwater quality standards for any contaminant is permitted only where the depth to groundwater is greater than 100 feet. For a TDS content between 1,000 and 3,000 mg/l, the separation must be 50 feet or greater. These

separation distance requirements are waived if the landfill is constructed with a composite liner.

- No new facility shall be located in designated drinking water source protection areas or, if no such protection area is designated, within a distance to existing drinking water wells or springs for public water supplies of 250-day groundwater travel time

2.1.5.1 *Emery County Landfill Groundwater*

Emery County Landfill complies with the requirements as outlined. The landfill bottom is not within five feet of the historic high level of groundwater. The landfill is not located over a sole source aquifer. The landfill is not located over an irreplaceable aquifer. Groundwater depth is greater than 100 feet. The landfill is not located in a designated drinking water source protection area or near springs or public drinking water wells.

No free groundwater is present within the overburden gravels at the site. In addition, the shale underlying the site is not known to store usable quantities of groundwater. As indicated previously, no water rights or points of diversion have been claimed or developed within a one mile radius of the landfill or within Section 16. Based on this information, the landfill meets the requirements of the groundwater protection location restrictions.

2.2 FACILITY LIFE

The estimated facility life is based on current and projected waste streams, and density estimates of the compacted waste material. The estimated life also attempts to account for the incorporation of recycling, composting and other programs that might affect the waste stream.

Including the proposed lateral expansion the total remaining airspace available at the Emery County Landfill is approximated to be 3.48 million cubic yards. Typical use of cover soils will result in approximately 20% of the landfill volume being filled with soil. The reduction in airspace due to daily and final cover soils leaves approximately 2.79 million cubic yards of airspace for MSW disposal use. The most recent reporting (2009) indicates that the landfill accepts approximately 52 tons per day of waste. The average density of the waste is assumed to be approximately 1,200 pounds per cubic yard, resulting in a remaining landfill life of approximately 63 years.

Based on these estimates, the following table shows the capacity and projected life span of each of the nine phases currently planned for development.

Landfill Area	Landfill Phase	Phase Volume (cubic yards)	Waste Capacity (cubic yards)	Projected Life Span
North Expansion	1	128,085	102,400	2011-2015
	2	301,415	240,800	2015-2024
	3	888,531	711,200	2024-2044
	4	1,140,309	912,000	2044-2062
	5	1,025,989	820,800	2062-2074
TOTALS	All Phases	3,484,329	2,787,200	2011-2074

2.3 CELL DESIGN

The growth of the Emery County Landfill has been broken into five phases. The Permit Drawings show the five Phases of the Emery County Landfill proposed growth plan. The five Phases of the landfill are as described in Sections 3.1.1.1 through 3.1.1.3 of Part II.

2.3.1 Liner

Due to the great distance to groundwater and low permeability of the site soils, arid climate, and high evaporation rate, the Emery County Landfill has been exempted from synthetic liner requirements. With the continued approval of the Executive Secretary, the proposed landfill expansion will not construct a synthetic liner system on the new phases. IGES has excavated and logged additional test pits at the Emery County Landfill. Lab test data confirms previous near surface exploration work at the site performed by Tahoma Inc. IGES lab data is presented in Appendix H.

2.3.2 Fill Method

Wastes are dumped at the toe of the work face and spread up the slope in one to two foot layers, keeping the working slope at a maximum three to one (horizontal to vertical).

Work face dimensions are kept narrow enough to minimize blowing litter and reduce the amount of soil needed for daily cover. However, dimensions should be wide enough to accommodate vehicles bringing garbage into the landfill safely. The Solid Waste Association of North America (SWANA) recommends that the width of the work face be no less than three times the width of the compactor blade.

Typically the compactor is operated with the blade facing uphill. Equipment operations across the slope are avoided to minimize the potential of equipment tipping over. In addition to safety an uphill operation provides the following benefits:

- Minimizes blowing litter problems.
- Increases equipment compactive effectiveness.
- Increased visibility for waste placement and compaction.
- More uniform waste distribution.

Grade stakes are used when necessary to control cell height and top surface grade. The top of the surface grade ranges from 5 to 25 percent, and the waste height ranges from 0 to 92 feet.

Wastes are compacted by making three to five passes up and down the slope. Compaction reduces litter, differential settlement, and the quantities of cover soil needed. Compaction also extends the life of the site, reduces unit costs, and leaves fewer voids to help reduce vector problems. Care is taken that no holes are left in the compacted waste. Voids are filled with additional waste as they develop.

2.3.3 Daily, Intermediate and Final Cover

2.3.3.1 *Daily and Intermediate Cover*

Daily cover typically comes from the borrow area northwest of the landfill cells. The borrow source is about a 100 foot high ridge that protrudes and terminates on the landfill property. The ridge is primarily made up of Mancos shale material with some overburden gravels. The material is placed approximately six inches thick. The material is used to retard infiltration of surface water and discourage vectors. Additional borrow soil will be generated by excavation of a detention pond and landfill cell. Cut slopes for this cell will be a maximum of 3H:1V and maintain a minimum floor slope of 2% to divert surface waters away from MSW in place.

Intermediate cover is required to be placed when portions of a Class I unit which will be idle for more than 30 days. Currently intermediate cover has been placed on Phases 1, 2 and 3, which have been filled. The source of intermediate cover is the same as the daily cover. The intermediate cover is to minimize the potential for water infiltration, blowing waste and vector problems. Intermediate cover will consist of at least 12 inches of site soils.

Compacted intermediate cover will remain exposed to atmospheric conditions for no more than three years before being covered with additional waste or final cover soils. Any areas of the landfill with intermediate cover that may be exposed to the atmosphere for more than three years will receive an additional 12 inches of cover soil. Areas with intermediate cover will be inspected for erosion and/or settlement quarterly. Damaged areas of the intermediate cover will be regraded and recompacted when necessary to restore the intermediate cover.

2.3.3.2 *Final Cover*

Emery County Landfill has proposed to use an alternative earthen final cover. The cover will consist of a monolithic barrier constructed from the borrow sources discussed in this report. The cover is designed to maximize runoff and then store remnant precipitation until it can be lost to evaporation and transpiration (evapotranspiration), thus providing a barrier to infiltration into the landfill.

The Emery County Landfill site is ideal for this type of cover because transpiration is so much greater than precipitation throughout the year. Based on climatological data obtained from the Utah Climate Center at Utah State University, the area receives an average of 8.4 inches of precipitation (rain and snow) each year while an average of 45.14 inches of evapotranspiration occurs. These values are based on daily climatological data from 1948 to the present.

In order to evaluate the storage/loss potential of the cover soil at the site, two sets of information needed to be assessed. First, the soil properties of the borrow material to be used as cover had to be evaluated, and second the worst case climate data had to be established in regards to potential infiltration into the landfill. Using these two parameters, the required thickness of the cover soil could then be established.

In order to evaluate the properties of the cover soil, IGES obtained seven samples of material from various locations throughout the proposed borrow sources. Of these seven samples, five were tested to evaluate capillary-moisture relationships, three were tested to evaluate remolded permeability and all seven samples had moisture-density relationships (proctors) and plastic limit tests completed.

The five capillary-moisture relationship tests were performed to evaluate the storage potential of the proposed cover soil. These tests evaluate the moisture retained in the soil under various suction pressures that are representative of conditions produced by evaporation and transpiration. The storage capacity of the soil is defined as the difference between the volumetric moisture content at field capacity and the volumetric moisture content at wilting point. Where the field capacity of the soil is taken as the volumetric moisture content at a suction pressure of 33 kPa and the wilting point is taken as the volumetric moisture content at a suction pressure of 1,500 kPa. The results of the tests indicate the proposed cover soils are relatively consistent throughout the borrow sources. The following table summarizes the capillary-moisture test results.

Location	Field Capacity (% by volume)	Wilting Point (% by volume)	Storage Capacity (% by volume)
Cover Sample No. 1 (borrow slope)	35.5	17.0	18.5
Borrow No. 1 (southwest borrow slope)	37.8	17.9	19.9
Borrow No. 2 (existing stockpile)	34.4	19.6	17.5
Borrow No. 3 (southcentral borrow slope)	37.2	19.3	17.9
Borrow No. 4 (excavation for cells 5 -7)	30.5	13.2	17.3
AVERAGE	35.1	16.9	18.2

The laboratory back-pressure permeability tests were conducted for general information pertaining to the inherent permeability of the site soils. Each of the permeability samples were remolded to 85 percent of ASTM D698 (Standard Proctor) at approximately 6 percent moisture, which represents very dry and loosely compacted field conditions. Under these conditions, the proposed material showed a laboratory permeability ranging from 2.4×10^{-6} to 7.9×10^{-8} cm/sec. The results of the tests are summarized in the following table:

Sample*	Maximum Dry Density (lb/cu. ft.)	Optimum Moisture (percent by weight)	Back-Pressure Permeability (cm/sec)
Cover No. 1	125.4	11.5	7.9×10^{-8}
Liner No. 1	122	12	2.38×10^{-6}
Liner No. 2	121.5	12	1.29×10^{-7}

* All samples were tested at 85% of the listed MDD and at 6% moisture content by weight

In addition to these test results listed, liquid and plastic limit tests were performed, gradation analyses were performed and additional proctors were performed. All of the laboratory data is summarized in Appendix H.

In order to establish the worst case climate data for the site and evaluate the required alternative cover soil thickness, the daily rainfall totals for an entire year had to be evaluated in a spreadsheet. The spreadsheet considers the available storage capacity of the cover soils based on the capillary-moisture data and then compares that to the daily evapotranspiration and daily rainfall recorded for that year. For a given thickness of cover material there is a maximum available storage, if the storage capacity of the cover soil is exceeded then the spreadsheet indicates infiltration through the cover layer. Within the spreadsheet, the evapotranspiration rate is also reduced by 40 percent to account for the difference in free-water surface evaporation and the evaporation from the soil particles. This reduction also accounts for the limiting factors pertaining to the plants ability to transpire moisture from the soil.

Each year of available data (1948 to present) was analyzed to ascertain a critical year where there was the most potential for infiltration through a given soil cover thickness. Based on our analysis the year 1980 appeared to represent the worst case of the years on record. 1980 did not have the highest yearly rainfall total, but it did have the most consecutively high precipitation amounts. With high consecutive precipitation amounts, the available storage capacity of the cover soil is not allowed to recover as it would when there are dry days in between events that would allow evapotranspiration to occur. Therefore the antecedent moisture accumulates and is pushed deeper until infiltration occurs.

Using the worst case climatological data, represented by the year 1980, three years in a row, it was established that 24-inches of cover soil was adequate to prevent infiltration into the landfill. Considering desiccation cracking, root growth, rodent burrows and other surface

anomalies we propose a minimum cover thickness of 30-inches. The results of the alternative cover analysis are shown in Appendix I.

Due to the potential capillary rise of the cover soils being as high as 25' (10 times the thickness of the final cover); the entire thickness of the final cover is exposed to evapotranspiration capillary forces.

2.3.3.3 *Borrow Sources*

As indicated previously, borrow sources for daily, intermediate and final cover comes primarily from the large ridge located northwest of the landfill cells that extends onto the landfill property. The ridge consists mainly of Mancos shale that can be excavated using conventional equipment. When exposed to the elements the Mancos shale quickly weathers into a residual clay material. Additional fill will be generated from pond construction and cell excavation within the landfill footprint. The materials encountered in all three borrow areas are similar in terms of moisture retention and low permeability. Samples of this material source were obtained and analyzed as alternative final cover material for Phases 1, 2 and 3.

2.3.3.4 *Elevations of Liner and Final Cover*

As illustrated on the Permit Drawings that are included with this permit application, the landfill will not be constructed with a synthetic liner. The bottom of the landfill for Phases 1 through 2 will be very near the existing grade. The lowest excavated elevation of the landfill in Phases 3 through 5 is planned to be constructed at 5970 feet above mean sea level (Drawing 3).

The maximum planned elevation for the final cover is planned to be 6078 feet above mean sea level. Final cover side slopes are planned to be 4:1 (horizontal to vertical) with the minimum cap slope on the surface to be 5% (Appendix A - Sheet 8)

2.3.4 *Equipment Requirements and Availability*

The following equipment is currently on site for routine operation of the landfill:

- Caterpillar 980F Wheel Loader
- Caterpillar D6T Dozer

- 816F Caterpillar Compactor
- Volvo Articulated Haul Truck

The Emery County Road Department will provide and operate other equipment as needed for construction activities. This equipment may consist of loaders, compactors, water trucks, excavators, rock crushers, etc. All landfill personnel are provided with two way radios and are in communication with each other and the county road department shop by telephone.

2.4 MONITORING SYSTEM DESIGN - EXISTING AND PROPOSED LANDFILL EXPANSION

2.4.1 Groundwater

Emery County Landfill does not plan to monitor groundwater. Tahoma Companies, Inc. applied for a waiver from groundwater monitoring. The waiver was tentatively granted in a letter dated February 29, 1996 from DSHW to Emery County Commissioner Bevan Wilson. As a result groundwater monitoring wells will not be installed and monitoring will not be performed as part of the regular monitoring program.

During the public comment period of the permitting process, the Division published a Draft Statement of Basis for granting the exemption from groundwater monitoring and from constructing the landfill with liners and a leachate collection system. No changes to the permit or the Draft Statement of Basis were required. Accordingly, the operating permit for the landfill was granted without requiring groundwater monitoring or requiring construction of the landfill with liners and a leachate collection system

2.4.2 Leachate Collection and Treatment System

The Emery County Landfill is exempt from leachate collection and treatment requirements under UAC R315-303-4(3)(c). With the approval of the Executive Secretary, the Landfill will not construct leachate collection and treatment system.

2.4.3 Landfill Gas

This facility is monitored for methane gas on a quarterly basis. Concentrations of methane gas are measured with a hand-held gas monitor.

Gas readings will be recorded at each end of the active cell, the office and shop, the fuel tanks, and other places at random. Readings will be recorded on the "Gas Log" sheet and kept on file in the scale house office. Gas monitoring activities at the Emery County Landfill are performed by the local health department (Southeastern Utah Health).

2.5 DESIGN AND LOCATION OF RUN-ON/RUN-OFF CONTROL SYSTEMS

The run-on and run-off information provided is based on a drainage study for the Emery County Landfill prepared by Mr. Ben Lamoreaux, P.E. This report was previously submitted under separate cover. The drainage study is included as Appendix K.

2.5.1 Run-On from a 24-Hour, 25-Year Storm

Run-on into the Landfill from the north has been diverted by construction of a ditch along the northern boundary. This ditch will deflect all potential run-on from the north of the facility into natural drainages east of the Emery County Landfill.

Potential run-on from areas northwest of the existing fenced landfill is deflected by topography into a deeply incised (approximately 15 feet deep) northwest to southeast trending channel that runs parallel to the Landfill's southerly fence, approximately 500 feet southwest of the fence line.

Existing drainages in the unused, westernmost, portion of the Landfill capture any sheetflow entering the Landfill from the west. Water from these existing drainages is carried out of the Landfill under the landfill access road in a 36-inch diameter corrugated metal pipe culvert.

2.5.2 Run-Off from a 24-Hour, 25-Year Storm

Run-off from active portions of the Landfill will be directed into the excavation area for Phases 5 through 9 until the excavation is used as a landfill unit. The excavation is large enough to retain all potential run-off from the 30-acres of the active landfill site that drain

toward it. The available volume of the excavation for Phases 5 through 9 is large enough to retain many times the average annual precipitation falling on the active landfill site disregarding evaporation and infiltration. Run-off from the remaining, unused, 10 acres of the site are downhill and will not contact waste and will be allowed to leave the landfill site in existing natural drainages without collection or treatment.

After final cover has been placed, run-off from the covered cells will be directed by ditches along the eastern and southern perimeters of the landfill site into a natural drainage that exits the Landfill at the southeast corner. This run-off will not contact waste and will be allowed to leave the Landfill site without collection or treatment. The proposed locations and typical cross sections of all run-off control structures are shown on the Permit Drawings.

2.6 CLOSURE PLAN - EXISTING AND PROPOSED LANDFILL EXPANSION

2.6.1 Closure Schedule

Closure will occur incrementally. Each phase of the Landfill will be closed once it has been filled to design capacity, unless additional phases will be constructed over them, as in the case of Phases 5, 6 and 7. Installation of the final cover, landscaping and contouring will proceed as follows:

- 1) Emery County will notify the Executive Secretary of the intent to implement closure in part, 60 days prior to the projected final receipt of waste at the uppermost landfill phase.
- 2) Emery County will begin closure of the Landfill phases within 30 days after receipt of the final volume waste. Closure activities will be completed within 180 days from their starting time, unless an extension is granted by the Executive Secretary.
- 3) The remaining Landfill capacity and projected life broken down by phase are presented in the following summary table:

Landfill Area	Landfill Phase	Waste Capacity (cubic yards)	Projected Closure
North Expansion	1	102,400	June 2015
	2	240,800	August 2024
	3	711,200	February 2044
	4	912,000	July 2062
	5	820,800	May 2074

- 4) New phases of the Landfill will be developed as the active phase approaches capacity.

Once the Emery County Landfill is full, or after a decision is made to close the facility, the operator will sell stockpiled recyclable materials to an independent contractor(s), and cover all remaining waste. Any excess borrow material previously excavated landfill units and/or disposal pits will then be graded level or convex upward surface. Slopes on convex upward surfaces will be graded at 4:1 (horizontal to vertical) to eliminate potential ponding. The areas will be planted with the same seed mixture used to vegetate the final cover.

When closure is completed, Emery County shall submit the following to the Executive Secretary:

- As-built unit closure plan sheet(s) signed by a licensed professional engineer registered in the state of Utah.
- Certification by Emery County and a licensed professional engineer in the state of Utah that the site has been closed in accordance with the approved closure plan.
- Closure plans and certification of closure will be submitted with the closure of each of the two disposal units (North Mass Fill Area and the Southeast Mass Fill Area).

2.6.2 Design of Final Cover

Emery County Landfill is proposing to use an alternative earthen final cover. The cover will consist of a monolithic barrier constructed from the borrow sources discussed in this report. The cover will be designed to maximize runoff and store remnant precipitation until it can be lost to evaporation and transpiration (evapotranspiration), thus providing a barrier to

infiltration. The final cover design for the Landfill has been previously discussed in Section 2.3.3.2.

2.6.3 Final Inspection

The DSHW will be invited to inspect the final grading of the Landfill. After approval of the final grading, a schedule will be established for vegetation. Agency personnel will then be invited to return to inspect the success of the erosion control system after one year.

2.7 POST-CLOSURE CARE PLAN - EXISTING AND PROPOSED LANDFILL EXPANSION

2.7.1 Site Monitoring

Utah State regulations stipulate that Emery County shall provide post-closure activities for continued facility maintenance and monitoring of land and gases for 30 years. The Executive Secretary may continue monitoring (even longer than the 30 year post-closure period) if it is felt more time is needed for the facility to become stabilized and/or to protect human health and the environment.

Minor quantities of landfill gases are expected to be generated at the Emery County Landfill after closure. Landfill settlement will be monitored and surface depressions in the cover repaired if consolidation of the wastes occur to a substantial degree.

2.7.1.1 Gas Monitoring

In the event of closure of the Landfill monitoring shall be conducted on a quarterly basis. The frequency of monitoring may be reduced only after a successful demonstration to the Executive Secretary that the closed landfill has stabilized.

2.7.1.2 Land Monitoring

Post-closure monitoring will be conducted quarterly throughout the closure and post-closure period. Landfill topography shall be visually checked for depressions that could result in ponding or rapid erosion. Irregularities in the surface of the final cover will be regraded and revegetated as needed to protect the surface from erosion and to eliminate ponding.

Side slopes will be maintained or reestablished with a maximum gradient of 4:1 and the top slopes will be maintained at no less than 10:1 to prevent ponding. The frequency of monitoring may be reduced only after a successful demonstration to the Executive Secretary that the closed landfill has stabilized.

Unscheduled monitoring of the landfill surfaces will be conducted after a 25-year storm event.

2.7.1.3 *Groundwater Monitoring*

Emery County Landfill does not plan to monitor groundwater. Tahoma Companies, Inc. applied for a waiver from groundwater monitoring. The waiver was tentatively granted in a letter dated February 29, 1996 from DSHW to Emery County Commissioner Bevan Wilson. As a result groundwater monitoring wells will not be installed and monitoring will not be performed as part of the post-closure monitoring program.

During the public comment period of the permitting process, the Division published a Draft Statement of Basis for granting the exemption from groundwater monitoring and from constructing the landfill with liners and a leachate collection system. No changes to the permit or the Draft Statement of Basis were required. Accordingly, the operating permit for the landfill was granted without requiring groundwater monitoring or requiring construction of the landfill with liners and a leachate collection system

2.7.1.4 *Surface Water Monitoring*

During post-closure, run-off from the covered cells will be directed by ditches along the eastern and southern perimeters of the landfill site into a natural drainage that exits the Landfill at the southeast corner. The ditches will be inspected quarterly through the post-closure period. Repairs will be completed as part of the maintenance activities.

2.7.2 *Changes to Record of Title, Land Use and Zoning*

The County Recorder will be provided plats and a statement of fact concerning the location of any disposal site no later than 60 days after certification of closure, as per Section 302-2(6) of the Rules. If necessary, the closed Landfill will be rezoned to conform with current Emery County zoning regulations after final closure. A description of the Landfill history and filled

areas will be permanently appended to the record of title. Land use restrictions will be assigned to the site in compliance with existing regulations for closed landfills at the time of closure.

2.7.3 Maintenance

Post-closure maintenance activities will be designed and implemented under the direction of a licensed professional engineer in response to results of monitoring. Design decisions will be made after the first post-closure quarterly inspection and implemented within 30 days after identification of maintenance issues. Results of post-closure maintenance shall be reported to the executive secretary by a professional engineer licensed in the state of Utah.

Because of the arid climate in Emery County, maintenance of final covers and run-on/run-off systems should be minimal. Final cover and control structures will be inspected quarterly as outlined in the post-closure plan.

Run-on/run-off control structures and final covers could be damaged by and unusually intense storm. Consequently, an unscheduled inspection will be required after any occurrence of a 25-year storm event within a five-mile radius of the site. If the post-storm inspection discloses damage, it will be appraised by a licensed engineer. The engineer will solicit bids if necessary and supervise repairs completed by the Emery County Road Department or a licensed contractor. Funds for payment for the repair work will be disbursed from the Financial Assurance Plan after approval by the Executive Secretary.

2.7.4 Post-Closure Contacts

The Emery County Board of Commissioners should be contacted concerning the Landfill during the post-closure period at: P.O. Box 629 Castle Dale, Utah 84513 or by telephone (801) 381-2119.

2.8 POST-CLOSURE LAND USE - EXISTING AND PROPOSED LANDFILL EXPANSION

Emery County Landfill will complete a post-closure land use plan to be implemented at the Landfill within 5 years prior to the end of the landfill's life. Emery County will select an end use for the landfill consistent with good landfiling practices and will be in accordance with zoning

and other regulations in force at the time. The final land use selected for the Landfill will be based upon maintaining a functional landfill cover.

Typical end uses range from recycling operations (which complement existing operations) to recreational activities. Since the closure of the site is several years away and additional growth may occur, it is not practical to develop land use plans consistent with surrounding land uses that are not fully known.

2.9 FINANCIAL ASSURANCE

Cost estimates for closure and post-closure care were prepared using the worksheet found in Appendix J. Closure and post-closure costs were obtained from similar costs from other landfills in the State

2.9.1 Closure Costs

The closure cost estimates were based on the cost to close the largest area of the disposal facility or unit requiring a final cover, including the cost of obtaining, moving and placing the cover material, final grading, placing topsoil, fertilizing and seeding.

The Emery County Landfill will be closed incrementally. The largest unit requiring final cover material is Phase 1. Unit costs for applying final cover were provided to the Emery County Road Department by Johansen and Tuttle Engineering, Inc.

2.9.2 Post Closure Care Costs

The post-closure estimate must be the cost for completing care reasonably expected during the 30-year post-closure period. These tasks include site inspections, maintenance, and record keeping.

2.9.3 Financial Assurance Mechanism

The amount required for financial assurance (for the largest open area) is summarized in the table below:

Total Financial Assurance Costs

Engineering Total:	\$15,720
Construction Total:	\$234,461
10 % Contingency:	<u>\$23,446</u>
SUBTOTAL:	\$273,627
 TOTAL CLOSURE COSTS:	 \$273,627
Post-Closure Total:	<u>\$81,180</u>
TOTAL FINANCIAL ASSURANCE:	\$354,807

3.0 - REFERENCES

- Algermissen, S.T., Perkins, D.M., Thenhaus, P.C., Hanson, S.L., Bender, B.L., 1990, *Probabilistic Earthquake Acceleration and Velocity Maps for the United States and Puerto Rico*, U.S. Geologic Survey Map MF 2120.
- Earthquake Hazards Program – National Seismic Hazards Mapping Project, United States Geologic Survey, Golden, Colorado, **URL: <http://geohazards.cr.usgs.gov/eq/>**
- Benson, C.H., Daniel, D.E. and Shackleford, C.D. 1999, *Liners and Covers for Waste Containment Facilities*, Geo Institute.
- Hecker, S., 1993, Quaternary Tectonics of Utah with Emphasis on Earthquake-Hazard Characterization: Utah Geological Survey Bulletin 127, 157p.
- Hintze, L.F., 1980, Geologic Map of Utah: Utah Geological and Mineral Survey Map-A-1, scale 1:500,000.
- Hintze, L.F. 1993, Geologic History of Utah, Brigham Young University Studies, Special Publication 7, 202p
- Hynes-Griffen, M.E. and Franklin, A.G., 1984, *Rationalizing the Seismic Coefficient Method*, Department of the Army, Miscellaneous Paper GL-84-13.
- Kavazanjian, Edward; Matasivic, Neven; Bonaparte, Rudolph; and Schmertmann, Gary R., Evaluation of *MSW Properties for Seismic Analysis, Geoenvironment 2000: Characterization, Containment, Remediation and Performance in Environmental Geotechnics*, Yalcin B. Acar and David E. Daniel, Eds. pp. 1126-1141.
- Makdisi, F.I., and Seed, H.B. *Simplified Method for Estimating Dam and Embankment Earthquake-Induced Deformations*, 1978, Journal of the Geotechnical Engineering Division, pp 849-867.
- Richardson, G *Design of Waste Containment Liners and Final Closure Systems* American Society of Civil Engineers.
- State of Utah Department of Environmental Quality, Division of Solid and Hazardous Waste, 2000, *R315-301 through R315-311 Utah Solid Waste Permitting and Management Rules*.
- Tahoma Companies, Inc., May 1996, *Revised Class I Permit Application, Emery County Landfill*, Unpublished consultant's report.
- Witkind, I.J., 1995, Geologic map of the Price 1° x 2° Quadrangle, Utah: U.S. Geological Survey Map 1-2462, scale 1:250,000.

APPENDIX A

EMERY COUNTY LANDFILL

2011 PERMIT APPLICATION

EMERY
COUNTY

Emery County
P.O. Box 889
Castle Dale, Utah
(435) 381-5450


CONSULTANTS




4153 South Commerce Drive
Salt Lake City, Utah 84107
(801)270-9400 Fax: (801)270-9401

LIST OF DRAWINGS


1. TITLE SHEET
2. GENERAL ARRANGEMENT
3. CELL AND POND DEVELOPMENT
4. PHASE I FILL PLAN
5. PHASE II FILL PLAN
6. PHASE III FILL PLAN
7. PHASE IV FILL PLAN
8. PHASE V FILL PLAN
9. ELEVATION VIEW
10. STORM WATER CONTROL PLAN
11. LANDFILL DETAILS

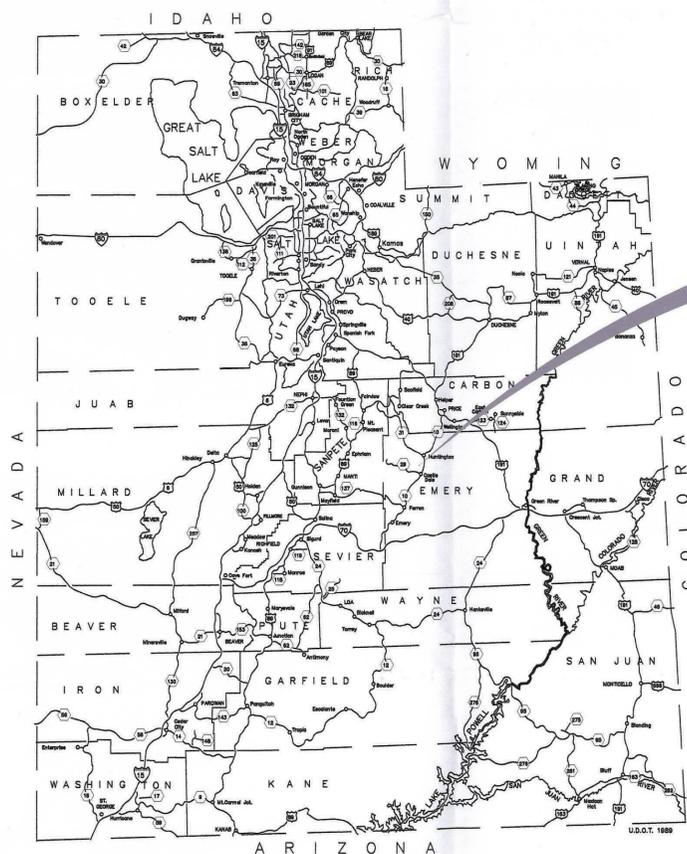

SITE LOCATION MAP

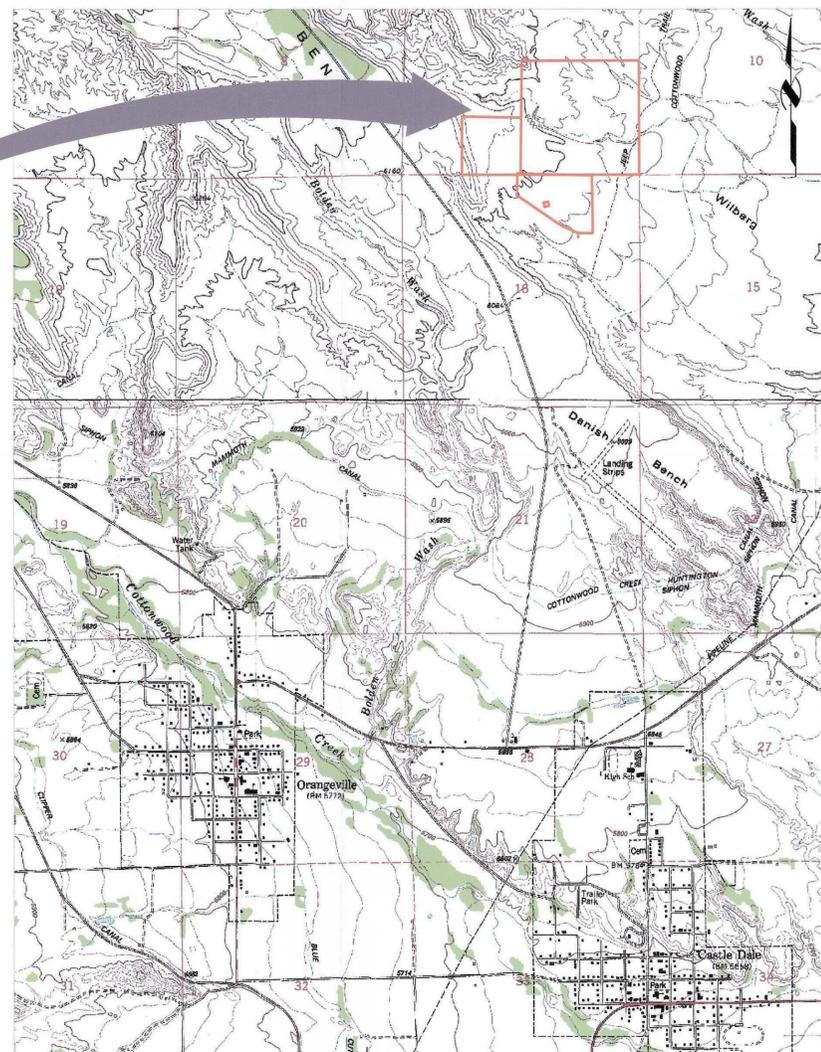

SITE LOCATION MAP
1" = 2000'

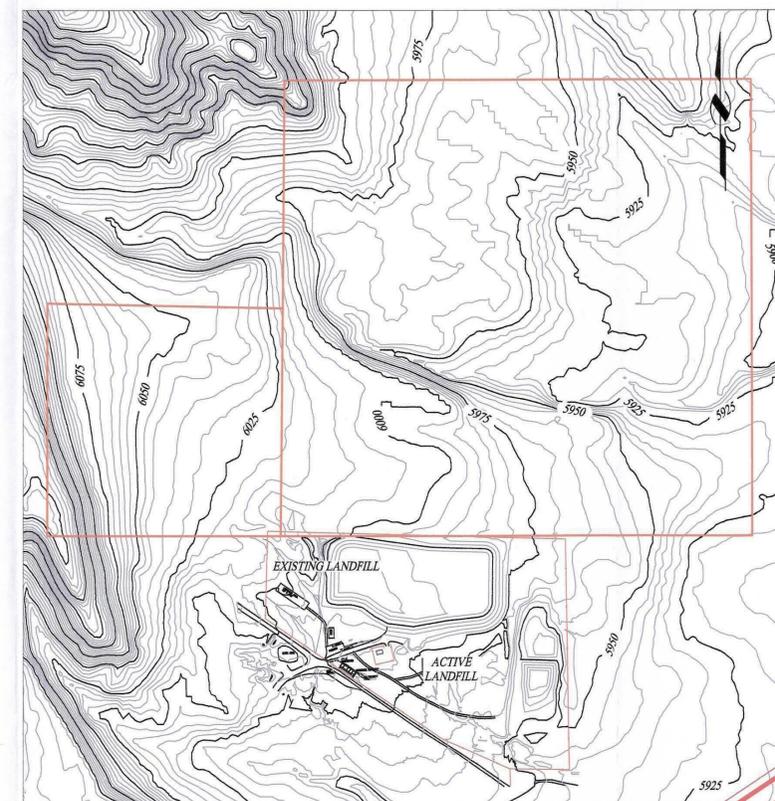

SITE LOCATION MAP
1" = 500'

FOR PERMIT
PURPOSES ONLY
NOT FOR
CONSTRUCTION

MARK	DATE	DESCRIPTION
	6/24/11	PERMIT
	5/23/11	DRAFT

ISSUE:
PROJECT NO.: 00450-004
CAD DWG FILE: 00450\004\Emery County 2011.dwg
DRAWN BY: JAH
DESIGNED BY: BDM
CHECKED BY: BDM
COPYRIGHT: IGES 2011

SHEET TITLE
EMERY COUNTY LANDFILL
TITLE SHEET

REFERENCE:
ADAPTED FROM USGS TOPO MAP AND DIGITAL ELEVATION MODEL (UTAH AGRC)
"RED POINT, UTAH" 1979
SITE TOPOGRAPHY BY JOHANSEN & TUTTLE, 1994
UPDATED BASED ON AERIAL IMAGERY, 2010

EMERY COUNTY

Emery County
 P.O. Box 889
 Castle Dale, Utah
 (435) 381-5450

CONSULTANTS



4153 South Commerce Drive
 Salt Lake City, Utah 84107
 (801)270-9400 Fax: (801)270-9401

- EMERY COUNTY PROPERTY
- PROPOSED NORTHERN EXPANSION
- PROPOSED LANDFILL DEVELOPMENT PHASES


FOR PERMIT PURPOSES ONLY
NOT FOR CONSTRUCTION

MARK	DATE	DESCRIPTION
	5/23/11	DRAFT

ISSUE:
 PROJECT NO.: 00450-004
 CAD DWG FILE: 00450\004\Emery County 2011.dwg
 DRAWN BY: JAH
 DESIGNED BY: BDM
 CHECKED BY: BDM
 COPYRIGHT: IGES 2011

SHEET TITLE
**EMERY COUNTY LANDFILL
 GENERAL
 ARRANGEMENT**

DRAFT

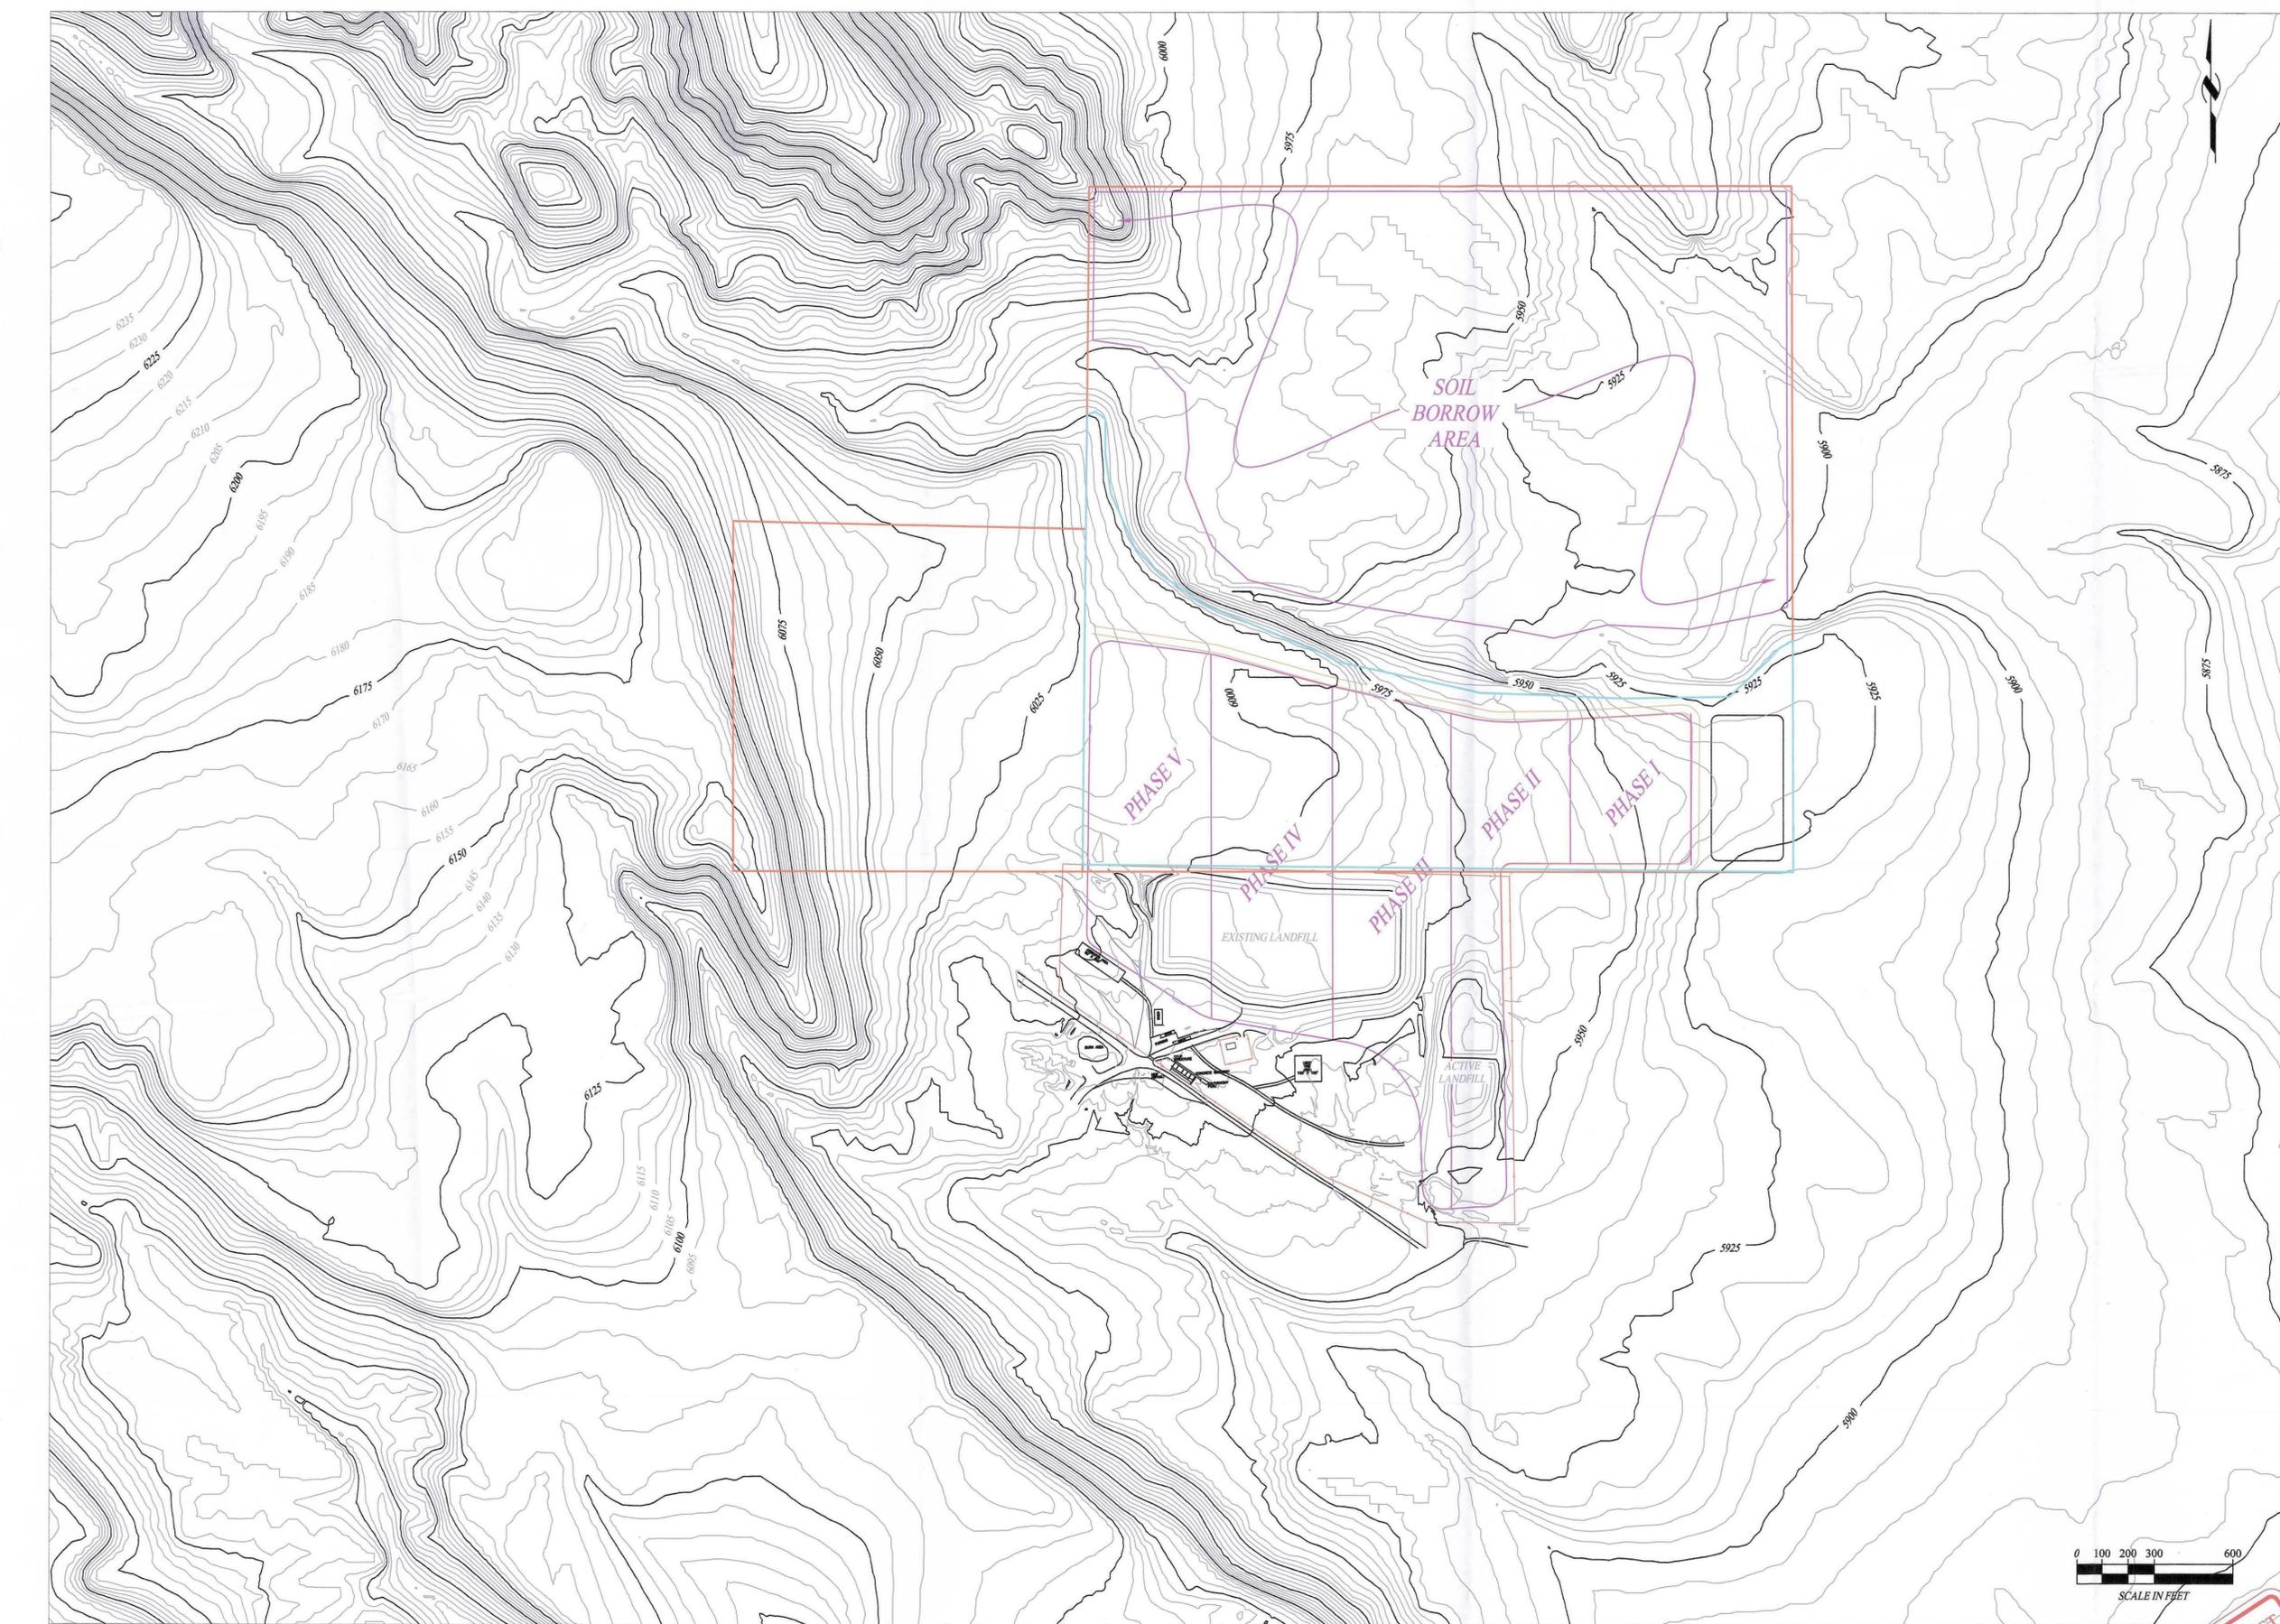

REFERENCE:
 ADAPTED FROM USGS TOPO MAP AND DIGITAL ELEVATION MODEL (UTAH AGRC)
 "RED POINT, UTAH" 1979
 SITE TOPOGRAPHY BY JOHANSEN & TUTTLE, 1994
 UPDATED BASED ON AERIAL IMAGERY, 2010

EMERY COUNTY

Emery County
 P.O. Box 889
 Castle Dale, Utah
 (435) 381-5450

CONSULTANTS



4153 South Commerce Drive
 Salt Lake City, Utah 84107
 (801)270-9400 Fax: (801)270-9401

NOTES:

CELL EXCAVATION: 761,000 CYD
DETENTION POND EXCAVATION: 50,000 CYD

- PERIMETER ACCESS ROAD
- EXISTING FENCE
- RUN-OFF CONTROL CHANNEL

FOR PERMIT PURPOSES ONLY NOT FOR CONSTRUCTION

MARK	DATE	DESCRIPTION
	6/24/11	PERMIT
	5/23/11	DRAFT



ISSUE:

PROJECT NO.: 00450-004
 CAD DWG FILE: 00450\004\Emery County 2011.dwg
 DRAWN BY: JAH
 DESIGNED BY: BDM
 CHECKED BY: BDM
 COPYRIGHT: IGES 2011

SHEET TITLE

EMERY COUNTY LANDFILL CELL & POND DEVELOPMENT

DRAFT

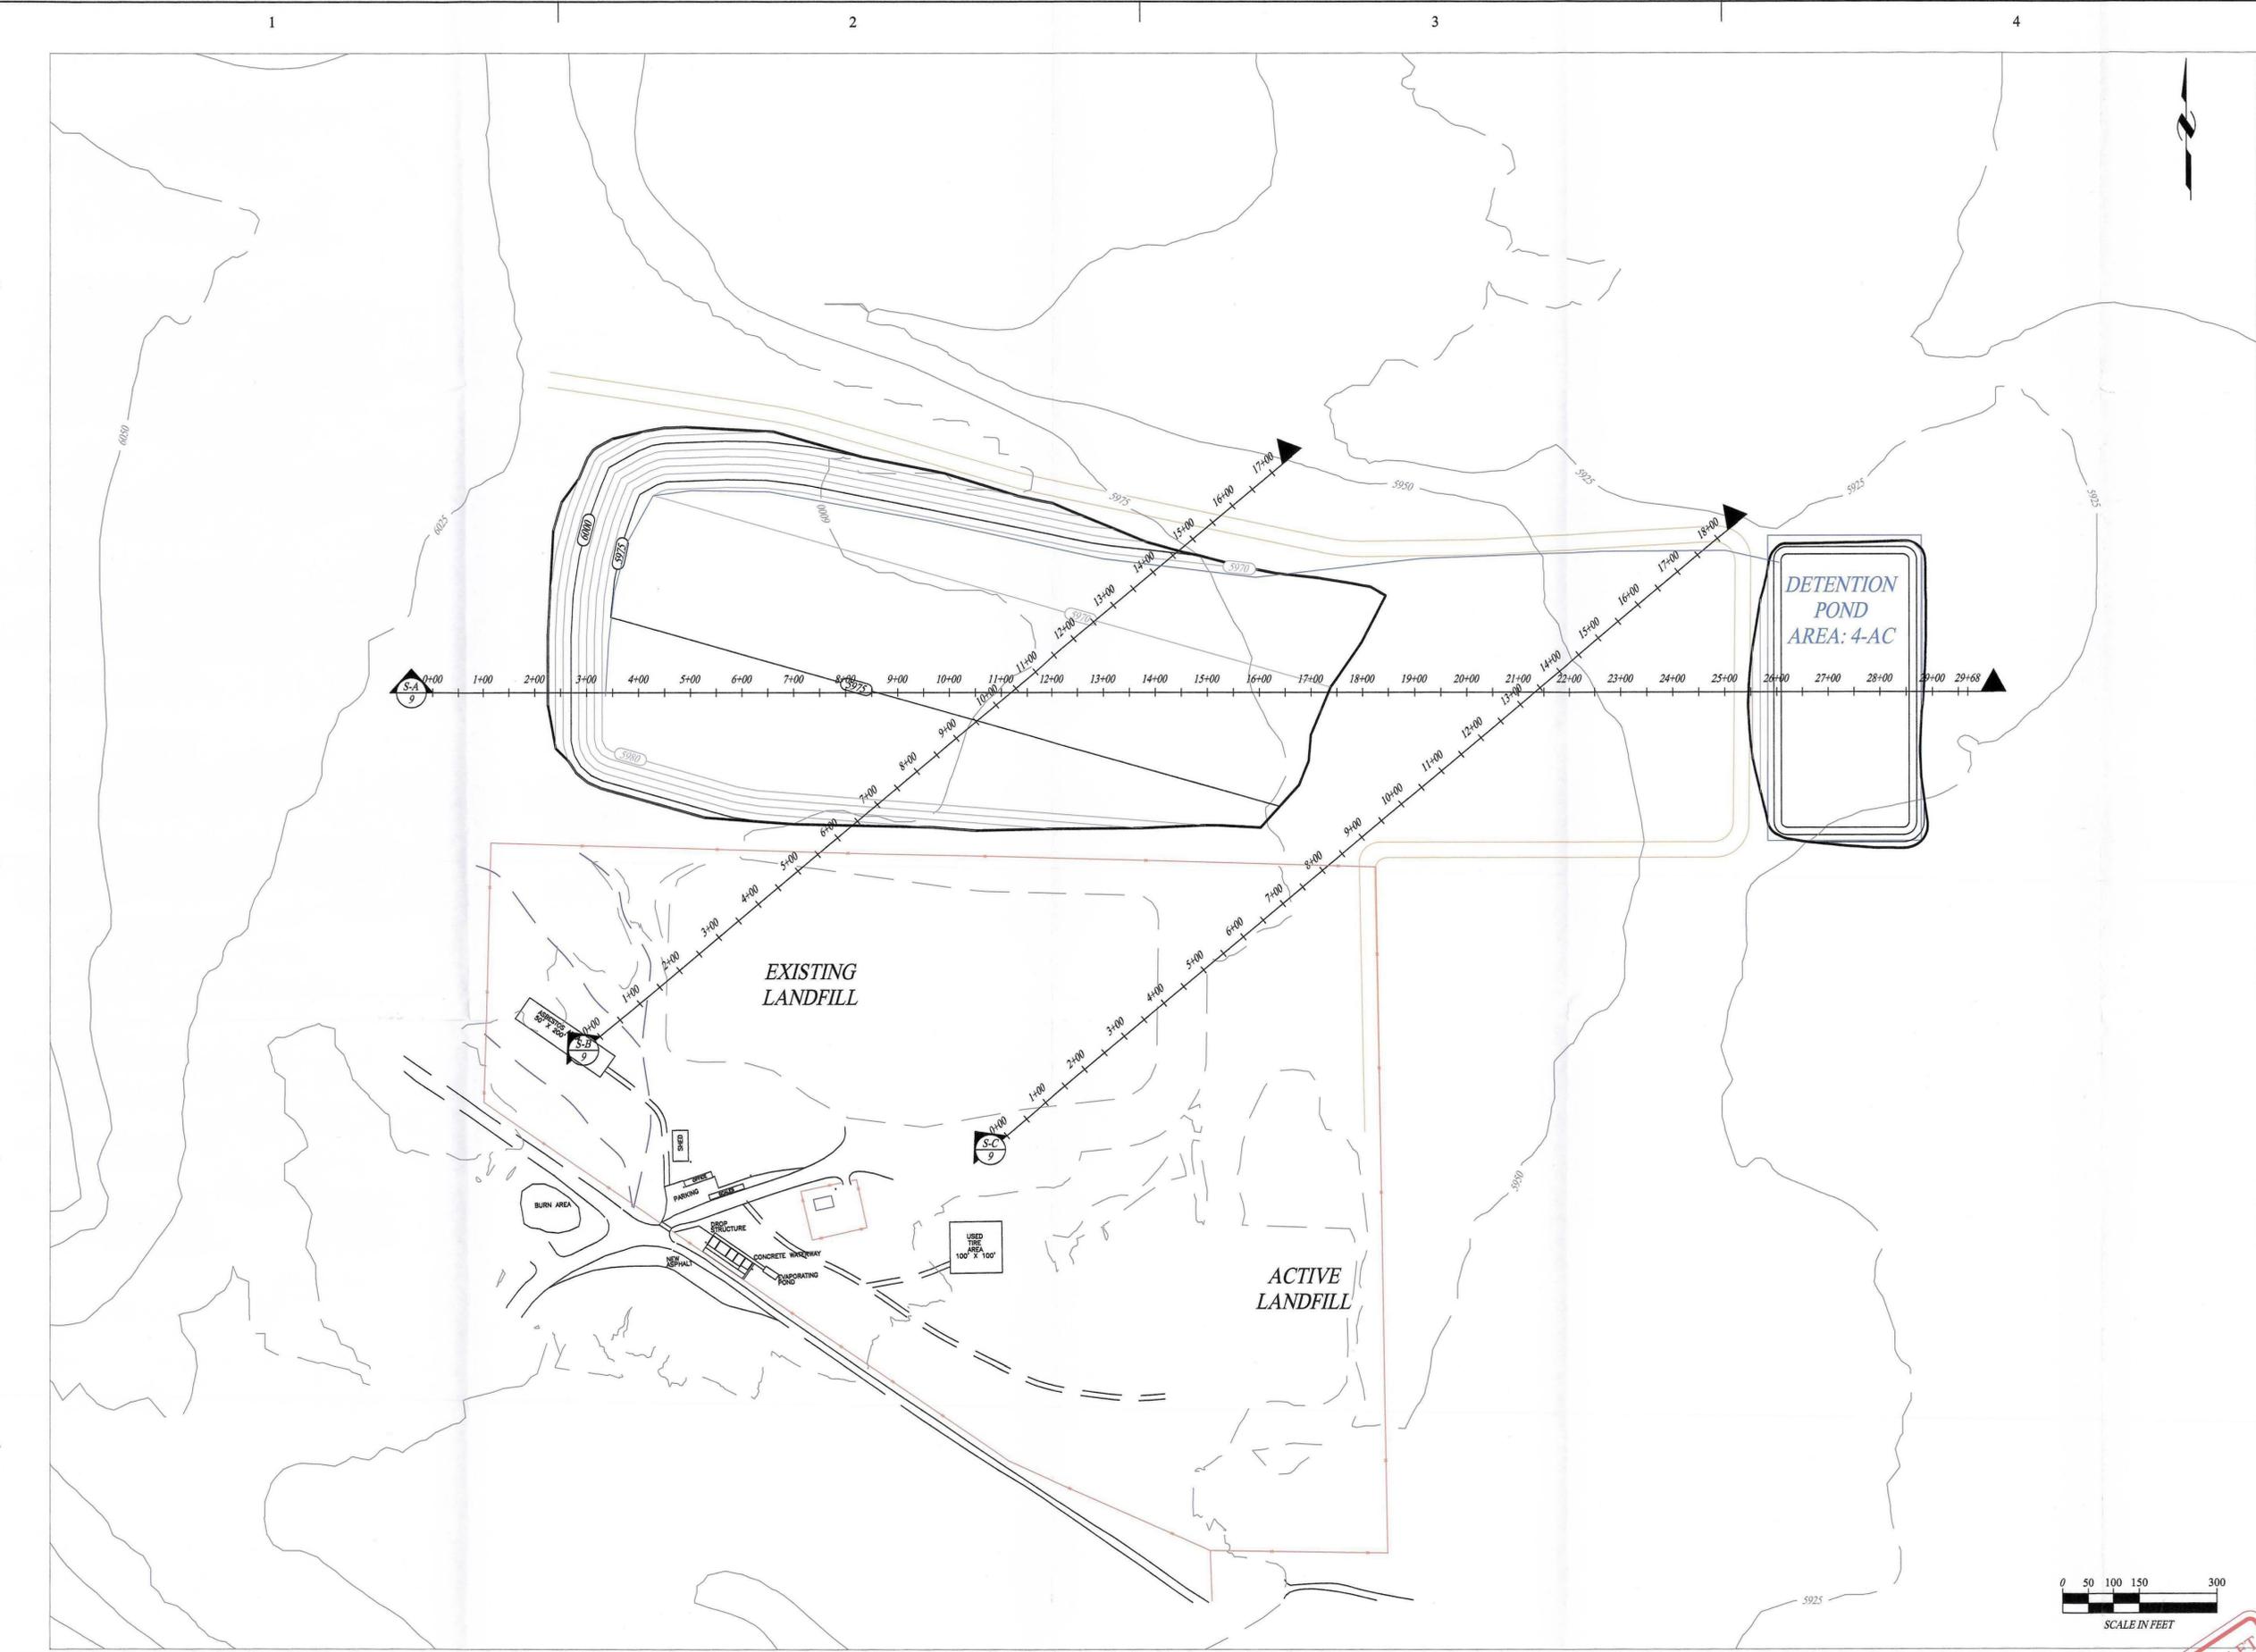

REFERENCE:
 ADAPTED FROM USGS TOPO MAP AND DIGITAL ELEVATION MODEL (UTAH AGRC)
 "RED POINT, UTAH" 1979
 SITE TOPOGRAPHY BY JOHANSEN & TUTTLE, 1994
 UPDATED BASED ON AERIAL IMAGERY, 2010

EMERY COUNTY

Emery County
 P.O. Box 889
 Castle Dale, Utah
 (435) 381-5450

CONSULTANTS



4153 South Commerce Drive
 Salt Lake City, Utah 84107
 (801)270-9400 Fax: (801)270-9401

NOTES:

PHASE I CAPACITY
 GROSS AIRSPACE: 128,000 CYD
 LESS 20% SOIL: 25,600 CYD
 WASTE CAPACITY: 102,400 CYD

PERIMETER ACCESS ROAD

EXISTING FENCE

FOR PERMIT
 PURPOSES ONLY
 NOT FOR
 CONSTRUCTION

MARK	DATE	DESCRIPTION
	6/24/11	PERMIT
	5/23/11	DRAFT


ISSUE:

PROJECT NO.:	00450-004
CAD DWG FILE:	00450\004\Emery County 2011.dwg
DRAWN BY:	JAH
DESIGNED BY:	BDM
CHECKED BY:	BDM
COPYRIGHT:	IGES 2011


SHEET TITLE

EMERY COUNTY LANDFILL PHASE I FILL-PLAN

DRAFT

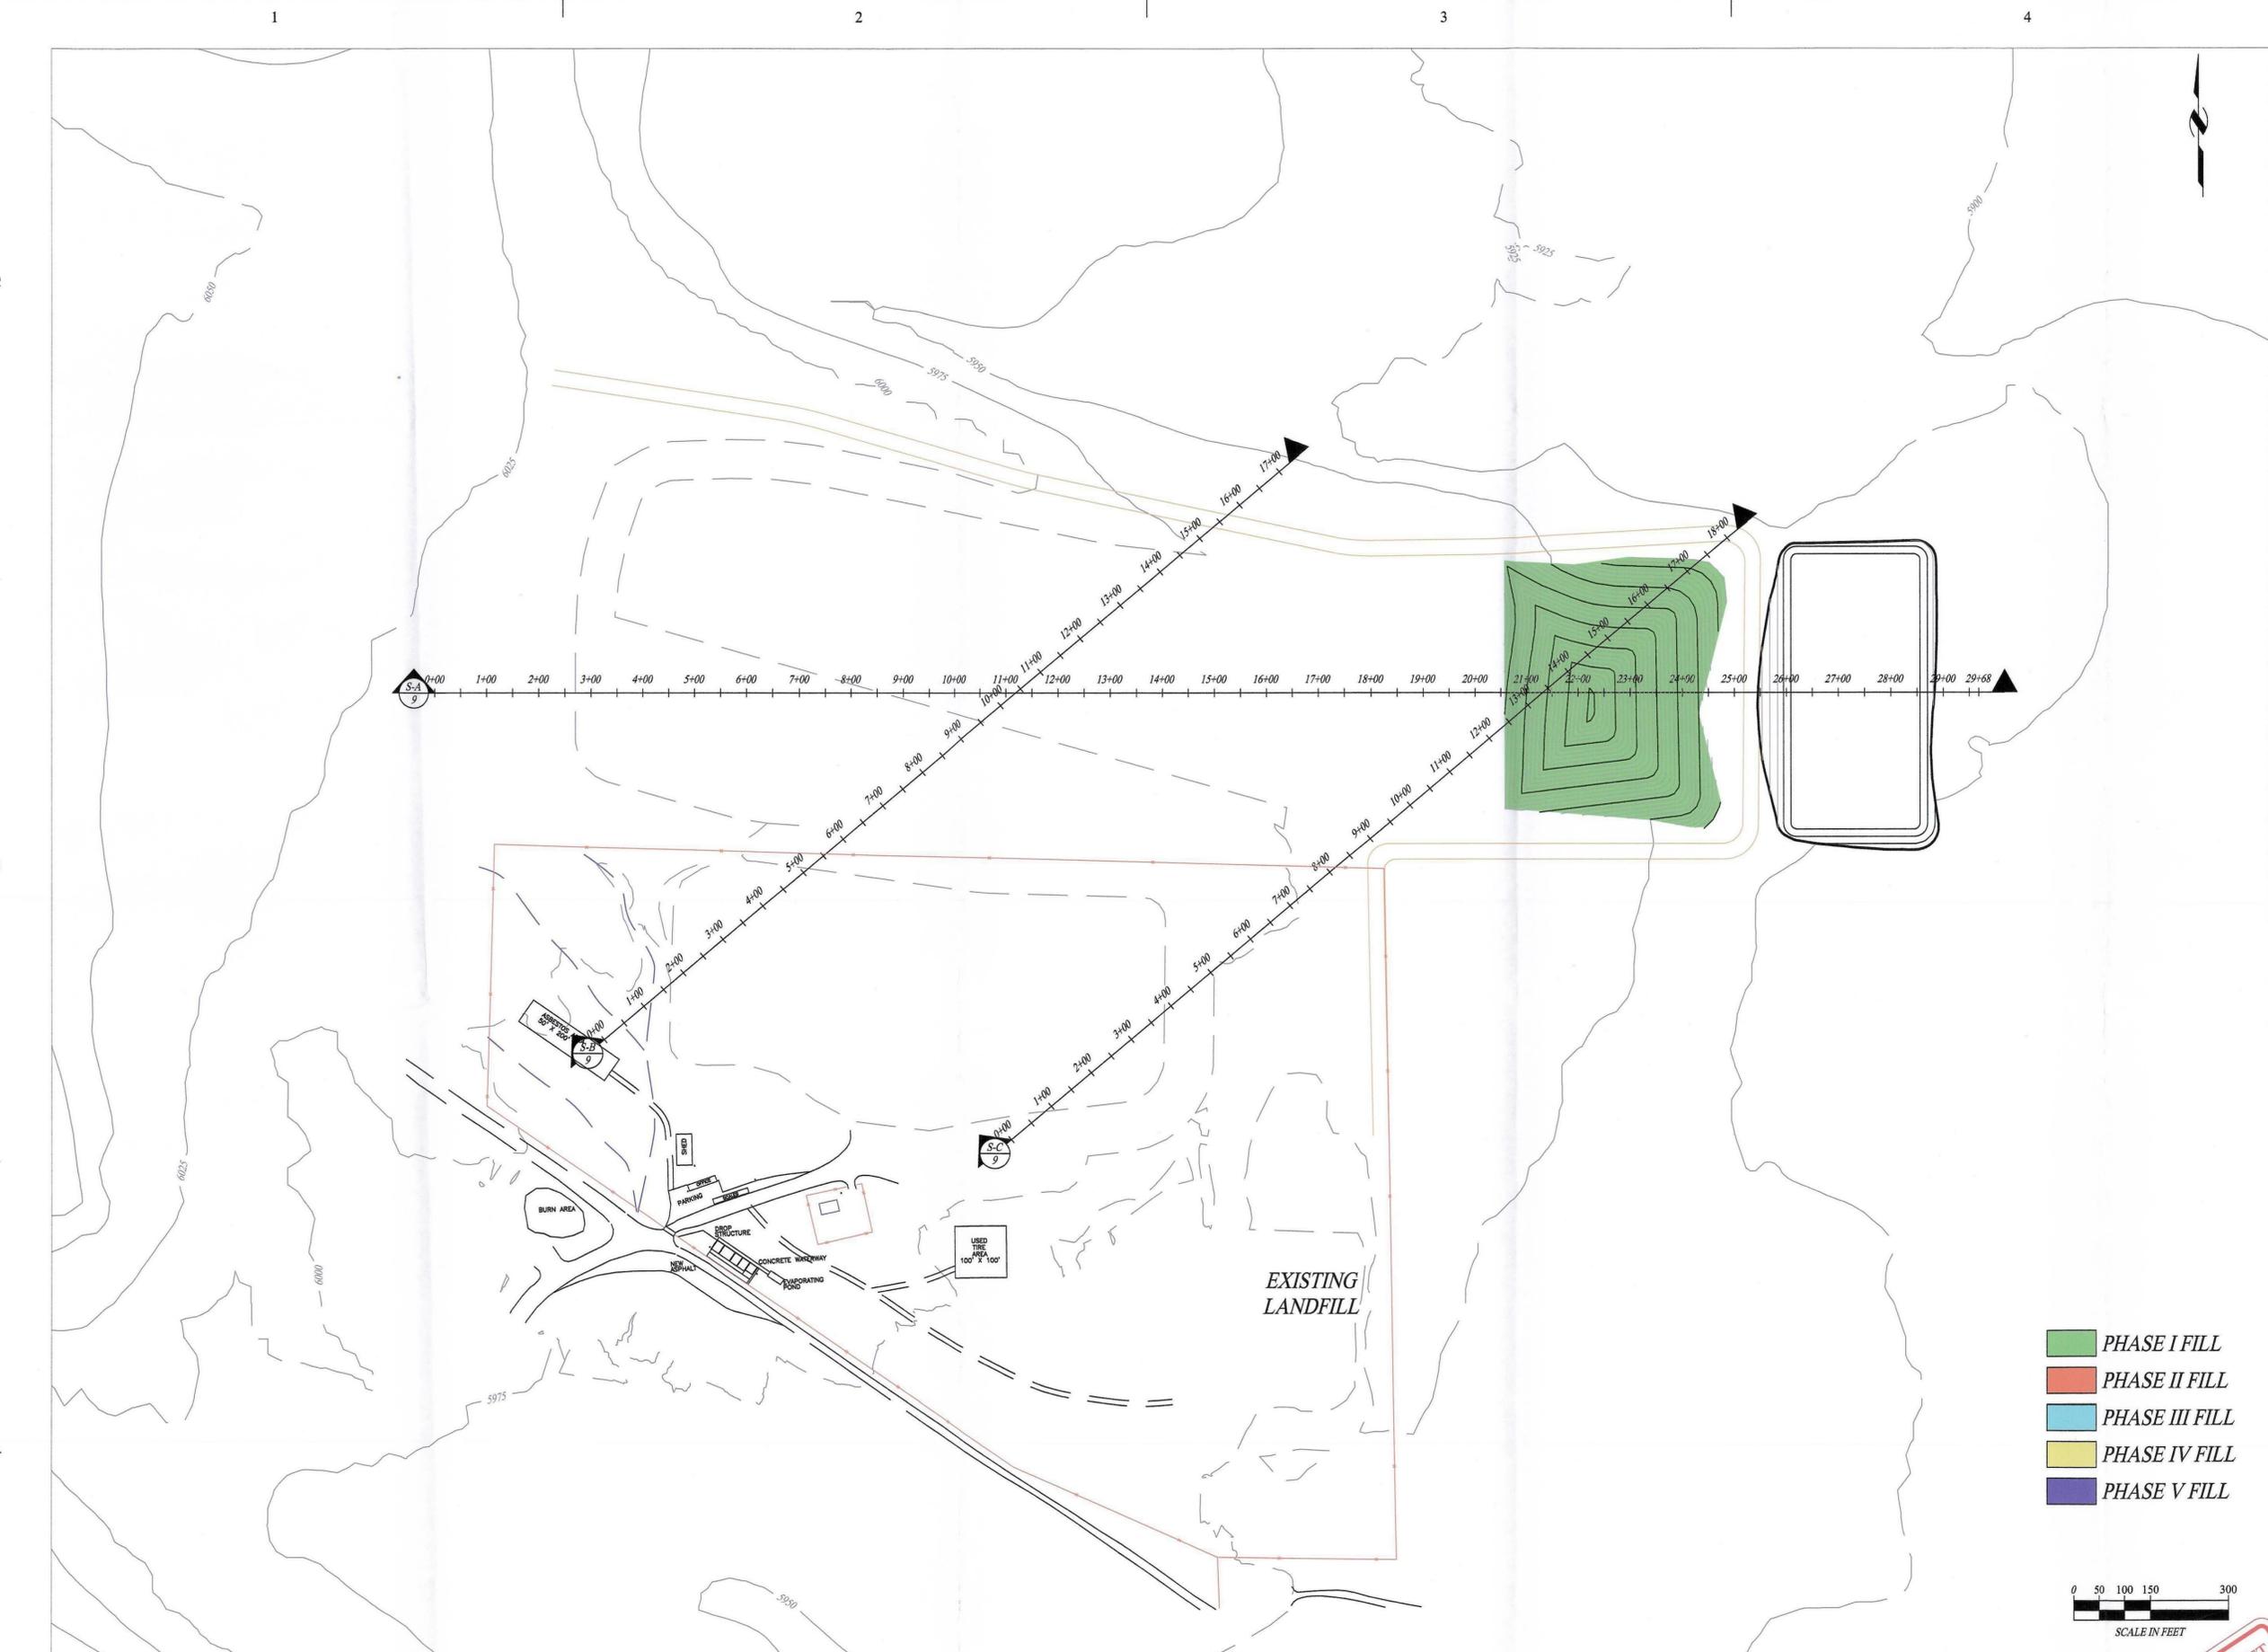

- PHASE I FILL
- PHASE II FILL
- PHASE III FILL
- PHASE IV FILL
- PHASE V FILL



REFERENCE:
 ADAPTED FROM USGS TOPO MAP AND DIGITAL ELEVATION MODEL (UTAH AGRC)
 "RED POINT, UTAH" 1979
 SITE TOPOGRAPHY BY JOHANSEN & TUTTLE, 1994
 UPDATED BASED ON AERIAL IMAGERY, 2010

EMERY COUNTY

Emery County
P.O. Box 889
Castle Dale, Utah
(435) 381-5450

CONSULTANTS



4153 South Commerce Drive
Salt Lake City, Utah 84107
(801)270-9400 Fax: (801)270-9401

NOTES:

PHASE II CAPACITY
GROSS AIRSPACE: 301,000 CYD
LESS 20% SOIL: 60,200 CYD
WASTE CAPACITY: 240,800 CYD

PERIMETER ACCESS ROAD

EXISTING FENCE

FOR PERMIT
PURPOSES ONLY
NOT FOR
CONSTRUCTION

MARK	DATE	DESCRIPTION
	6/24/11	PERMIT
	5/23/11	DRAFT

ISSUE:
PROJECT NO.: 00450-004
CAD DWG FILE: 00450\004\Emery County 2011.dwg
DRAWN BY: JAH
DESIGNED BY: BDM
CHECKED BY: BDM
COPYRIGHT: IGES 2011

SHEET TITLE
EMERY COUNTY LANDFILL
**PHASE II
FILL-PLAN**



REFERENCE:
ADAPTED FROM USGS TOPO MAP AND DIGITAL ELEVATION MODEL (UTAH AGRC)
"RED POINT, UTAH" 1979
SITE TOPOGRAPHY BY JOHANSEN & TUTTLE, 1994
UPDATED BASED ON AERIAL IMAGERY, 2010

DRAFT

EMERY COUNTY

Emery County
 P.O. Box 889
 Castle Dale, Utah
 (435) 381-5450

CONSULTANTS



4153 South Commerce Drive
 Salt Lake City, Utah 84107
 (801)270-9400 Fax: (801)270-9401

NOTES:

PHASE III CAPACITY
 GROSS AIRSPACE: 889,000 CYD
 LESS 20% SOIL: 177,800 CYD
 WASTE CAPACITY : 711,200 CYD

PERIMETER ACCESS ROAD

EXISTING FENCE


FOR PERMIT
 PURPOSES ONLY
 NOT FOR
 CONSTRUCTION

MARK	DATE	DESCRIPTION
	6/24/11	PERMIT
	5/23/11	DRAFT

ISSUE:

PROJECT NO.: 00450-004
 CAD DWG FILE: 00450\004\Emery County 2011.dwg
 DRAWN BY: JAH
 DESIGNED BY: BDM
 CHECKED BY: BDM
 COPYRIGHT: IGES 2011

SHEET TITLE
 EMERY COUNTY LANDFILL
**PHASE III
 FILL-PLAN**

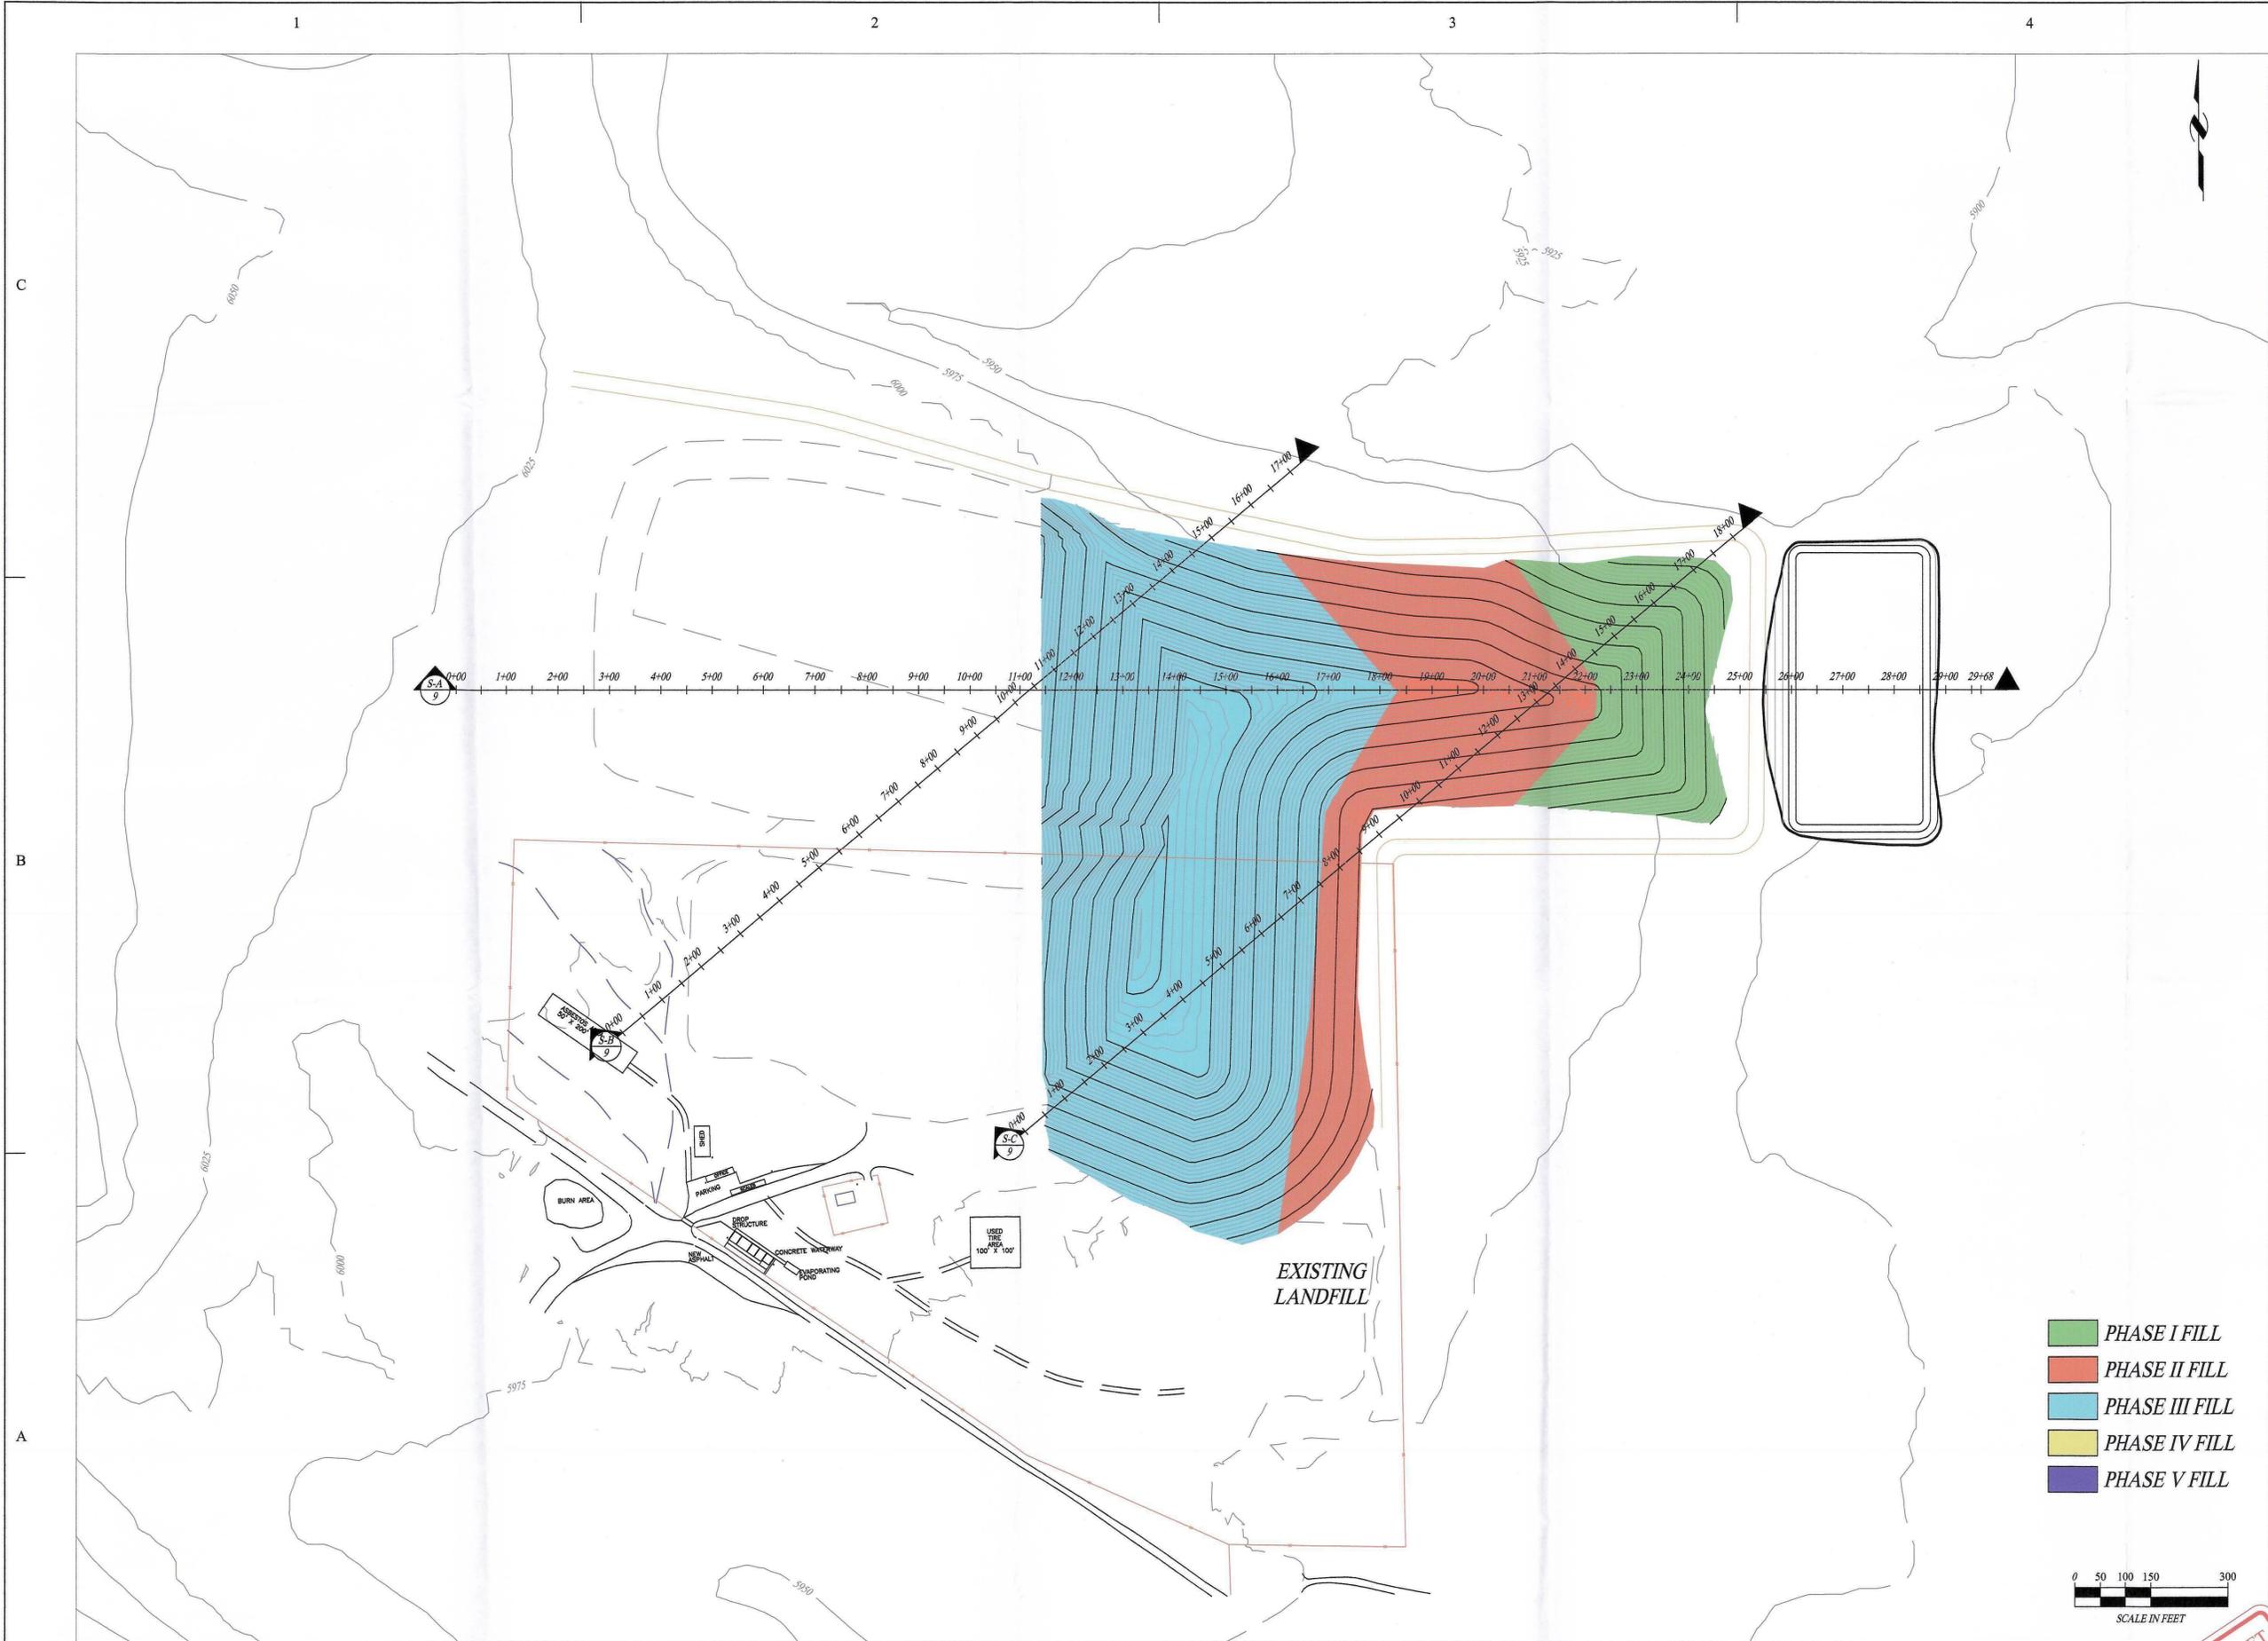

REFERENCE:
 ADAPTED FROM USGS TOPO MAP AND DIGITAL ELEVATION MODEL (UTAH AGRC)
 "RED POINT, UTAH" 1979
 SITE TOPOGRAPHY BY JOHANSEN & TUTTLE, 1994
 UPDATED BASED ON AERIAL IMAGERY, 2010

EMERY COUNTY

Emery County
P.O. Box 889
Castle Dale, Utah
(435) 381-5450

CONSULTANTS



ideas for a changing world

4153 South Commerce Drive
Salt Lake City, Utah 84107
(801)270-9400 Fax: (801)270-9401

NOTES:

PHASE IV CAPACITY
GROSS AIRSPACE: 1,140,000 CYD
LESS 20% SOIL: 228,000 CYD
WASTE CAPACITY: 912,000 CYD

PERIMETER ACCESS ROAD

EXISTING FENCE

FOR PERMIT
PURPOSES ONLY
NOT FOR
CONSTRUCTION


MARK	DATE	DESCRIPTION
	6/24/11	PERMIT
	5/23/11	DRAFT

ISSUE:

PROJECT NO.:	00450-004
CAD DWG FILE:	00450\004\Emery County 2011.dwg
DRAWN BY:	JAH
DESIGNED BY:	BDM
CHECKED BY:	BDM
COPYRIGHT:	IGES 2011

SHEET TITLE

EMERY COUNTY LANDFILL
**PHASE IV
FILL - PLAN**

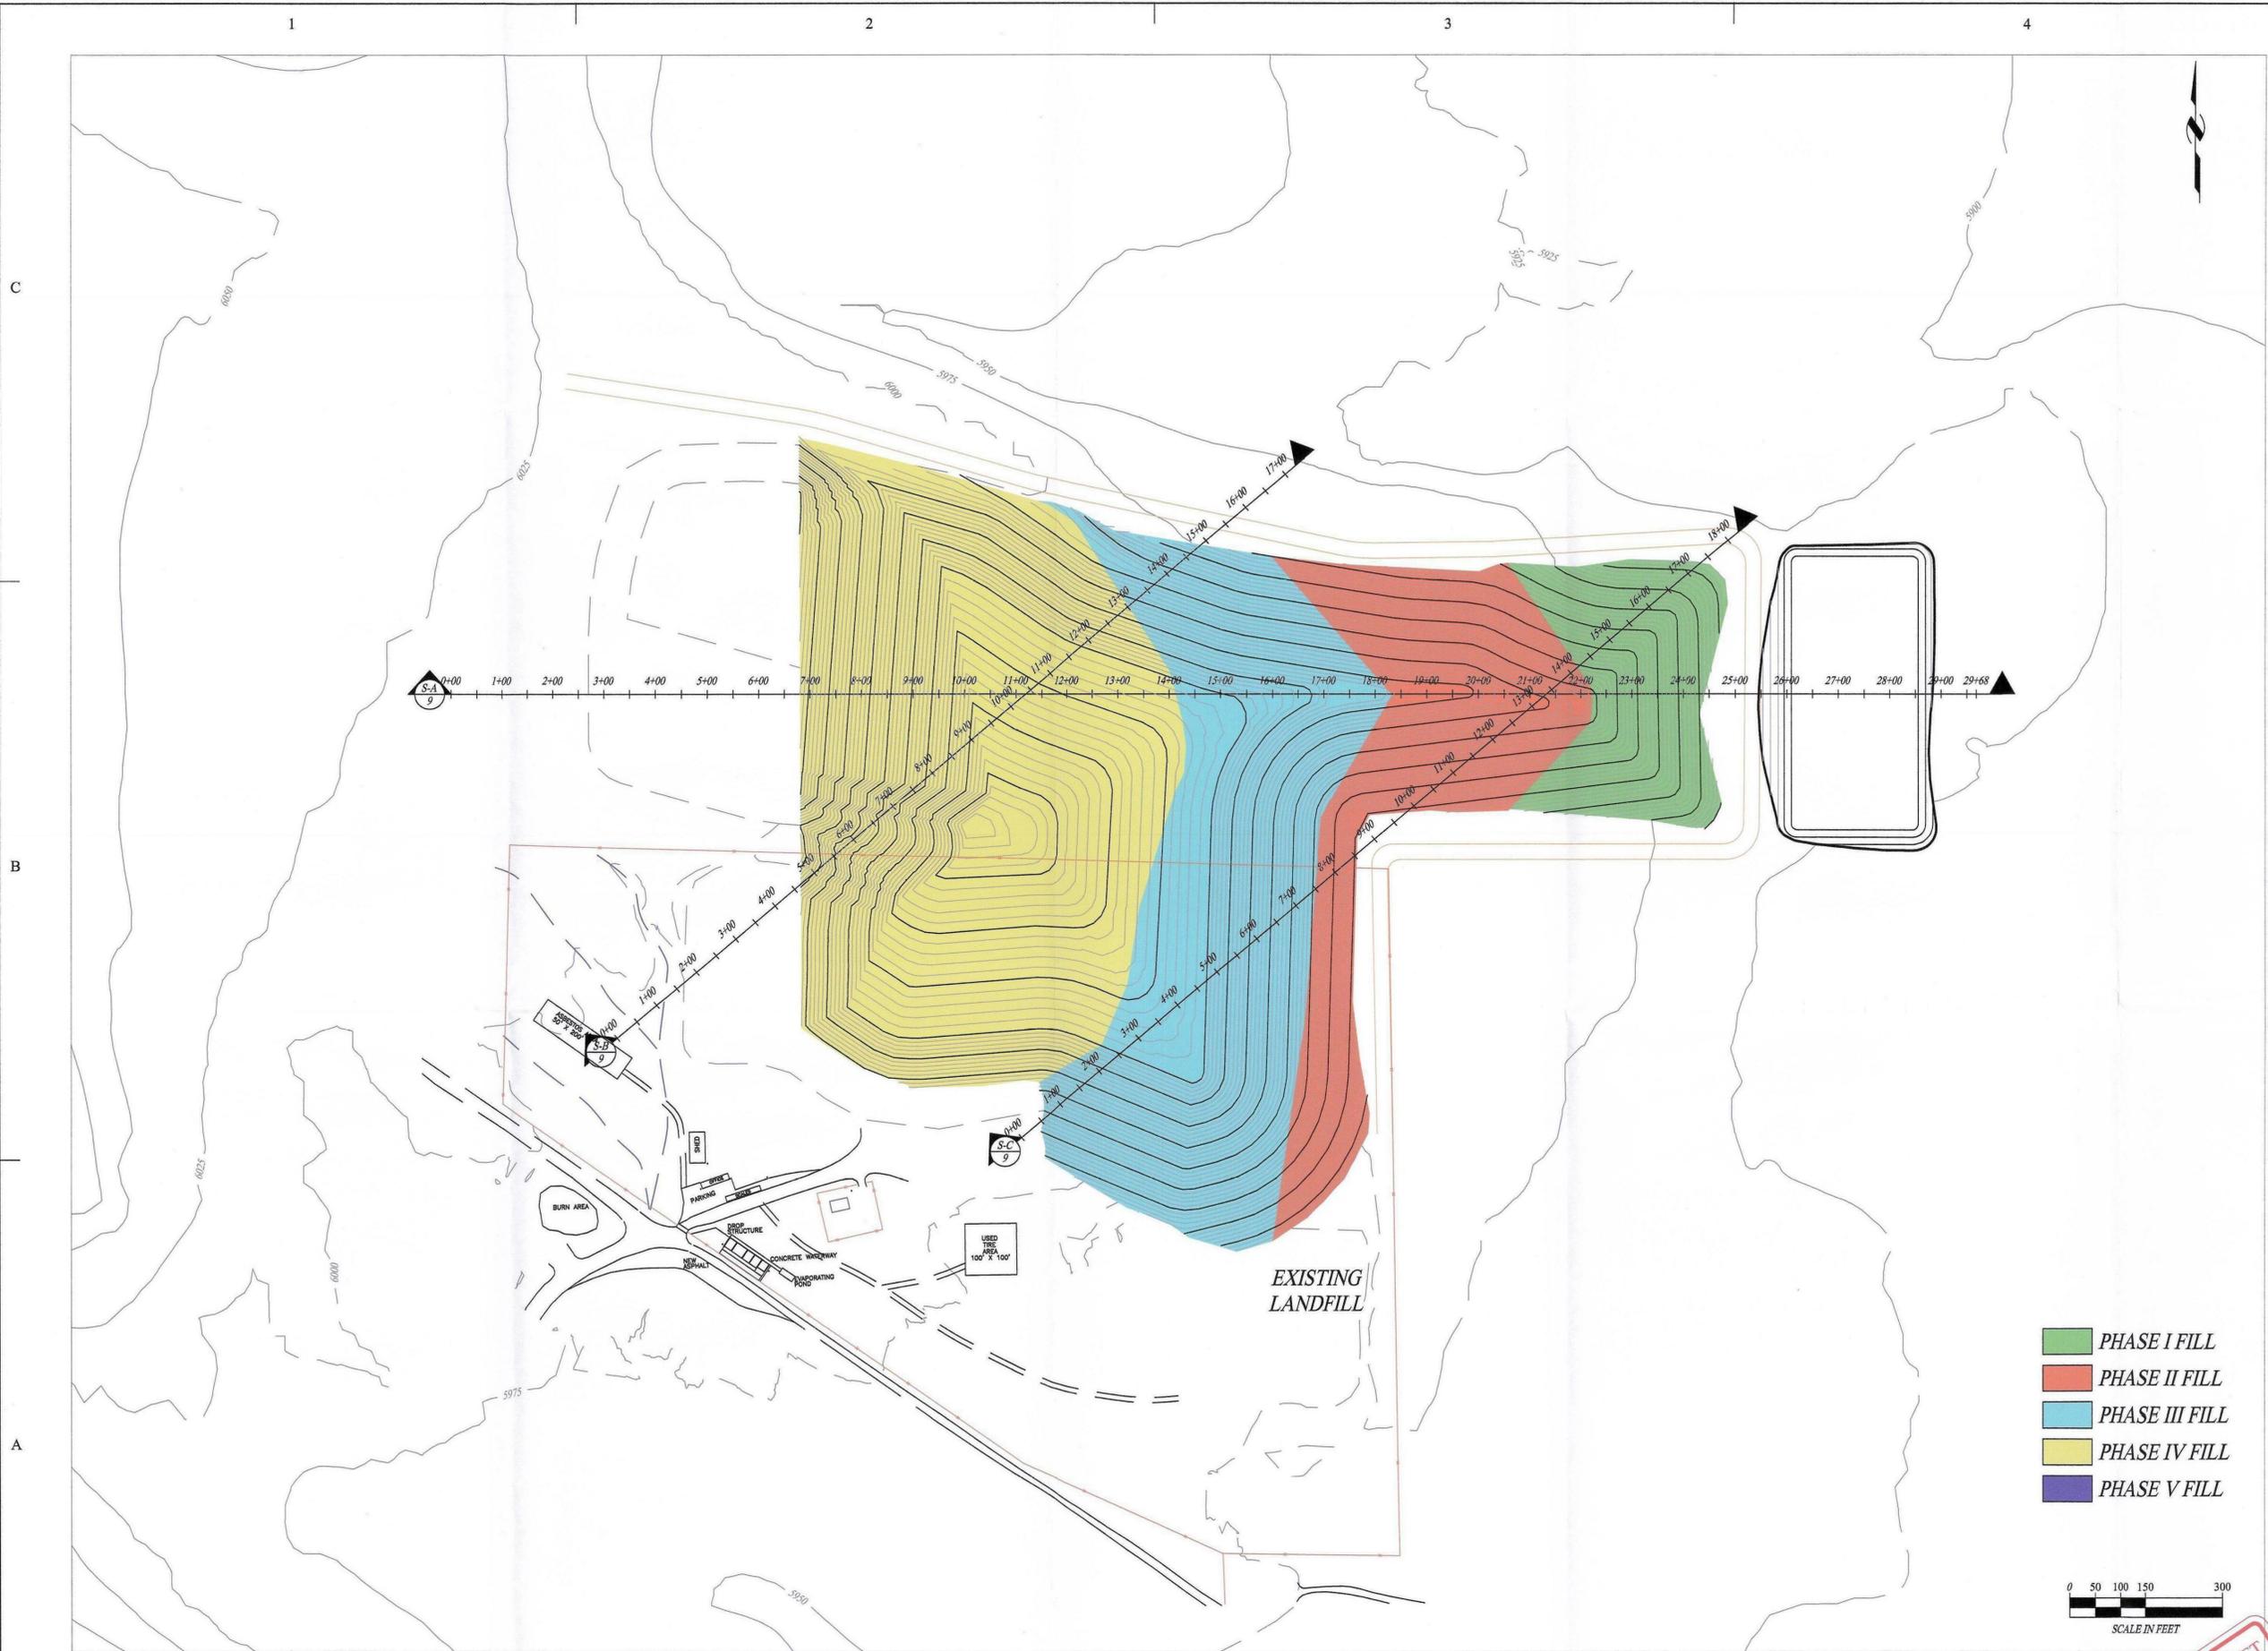

REFERENCE:
ADAPTED FROM USGS TOPO MAP AND DIGITAL ELEVATION MODEL (UTAH AGRC)
"RED POINT, UTAH" 1979
SITE TOPOGRAPHY BY JOHANSEN & TUTTLE, 1994
UPDATED BASED ON AERIAL IMAGERY, 2010

DRAFT

EMERY COUNTY

Emery County
P.O. Box 889
Castle Dale, Utah
(435) 381-5450

CONSULTANTS



4153 South Commerce Drive
Salt Lake City, Utah 84107
(801)270-9400 Fax: (801)270-9401

NOTES:

PHASE V CAPACITY
GROSS AIRSPACE: 1,026,000 CYD
LESS 20% SOIL: 205,200 CYD
WASTE CAPACITY: 820,800 CYD

PERIMETER ACCESS ROAD
 EXISTING FENCE

FOR PERMIT
PURPOSES ONLY
NOT FOR
CONSTRUCTION

MARK	DATE	DESCRIPTION
	6/24/11	PERMIT
	5/23/11	DRAFT
ISSUE:		
PROJECT NO.:		00450-004
CAD DWG FILE:		00450\004\Emery County 2011.dwg
DRAWN BY:		JAH
DESIGNED BY:		BDM
CHECKED BY:		BDM
COPYRIGHT:		IGES 2011

SHEET TITLE
EMERY COUNTY LANDFILL
**PHASE V-FINAL
COVER PLAN**



REFERENCE:
ADAPTED FROM USGS TOPO MAP AND DIGITAL ELEVATION MODEL (UTAH AGRC)
"RED POINT, UTAH" 1979
SITE TOPOGRAPHY BY JOHANSEN & TUTTLE, 1994
UPDATED BASED ON AERIAL IMAGERY, 2010

EMERY COUNTY

Emery County
P.O. Box 889
Castle Dale, Utah
(435) 381-5450


CONSULTANTS



ideas for a changing world

4153 South Commerce Drive
Salt Lake City, Utah 84107
(801)270-9400 Fax: (801)270-9401

NOTES:

 **POTENTIAL RUN-ON AREA**
~50 ACRES
PEAK FLOW: 31.3 CFS
(25-YR, 24-HR STORM)

 **EXISTING FENCE**

FOR PERMIT
PURPOSES ONLY
NOT FOR
CONSTRUCTION


MARK	DATE	DESCRIPTION
	6/24/11	PERMIT
	5/23/11	DRAFT

ISSUE:

PROJECT NO.:	00450-004
CAD DWG FILE:	00450\004\Emery County 2011.dwg
DRAWN BY:	JAH
DESIGNED BY:	BDM
CHECKED BY:	BDM
COPYRIGHT:	IGES 2011

SHEET TITLE

EMERY COUNTY LANDFILL RUN-ON CONTROL PLAN

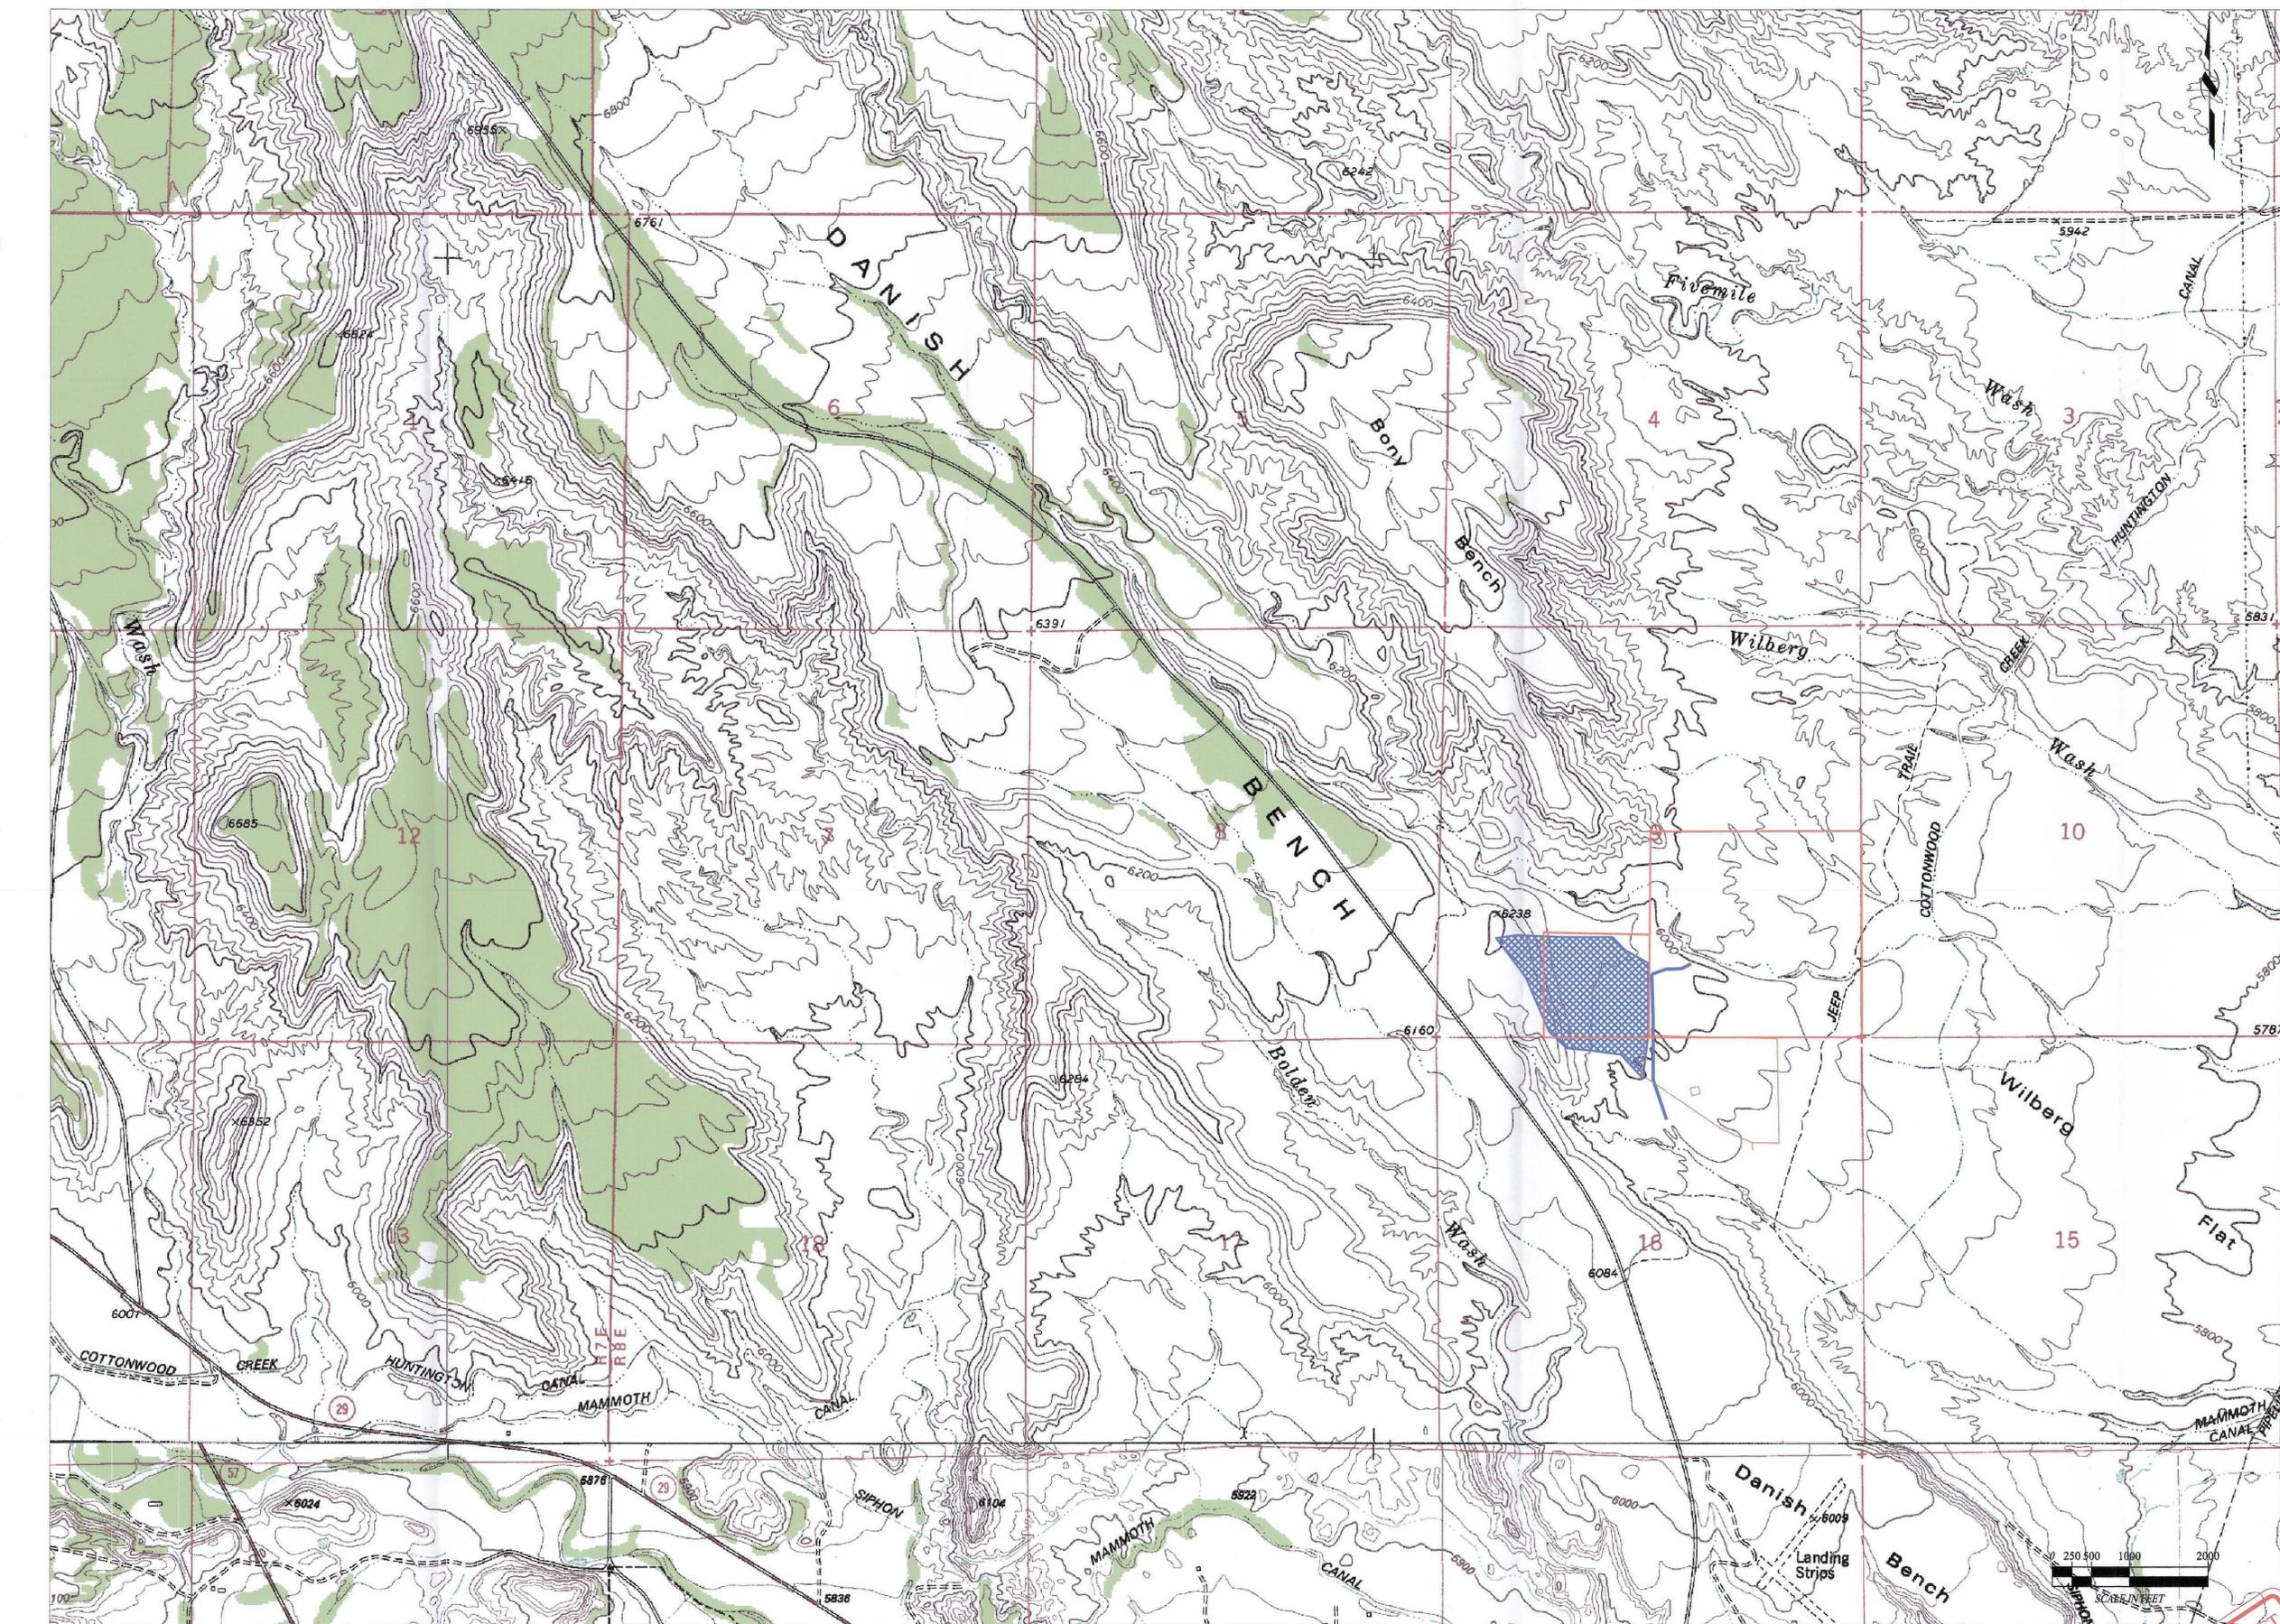

REFERENCE:
ADAPTED FROM USGS TOPO MAP AND DIGITAL ELEVATION MODEL (UTAH AGRC)
"RED POINT, UTAH" 1979
SITE TOPOGRAPHY BY JOHANSEN & TUTTLE, 1994
UPDATED BASED ON AERIAL IMAGERY, 2010

DRAFT

Emery County
P.O. Box 889
Castle Dale, Utah
(435) 381-5450

CONSULTANTS



4153 South Commerce Drive
Salt Lake City, Utah 84107
(801)270-9400 Fax: (801)270-9401


NOTES:

FOR PERMIT
PURPOSES ONLY
NOT FOR
CONSTRUCTION


MARK	DATE	DESCRIPTION
	6/24/11	PERMIT
	5/23/11	DRAFT
ISSUE:		
PROJECT NO.: 00450-004		
CAD DWG FILE: 00450\004\Emery County 2011.dwg		
DRAWN BY: JAH		
DESIGNED BY: BDM		
CHECKED BY: BDM		
COPYRIGHT: IGES 2011		

SHEET TITLE
**EMERY COUNTY LANDFILL
LANDFILL
DETAILS**

DRAFT

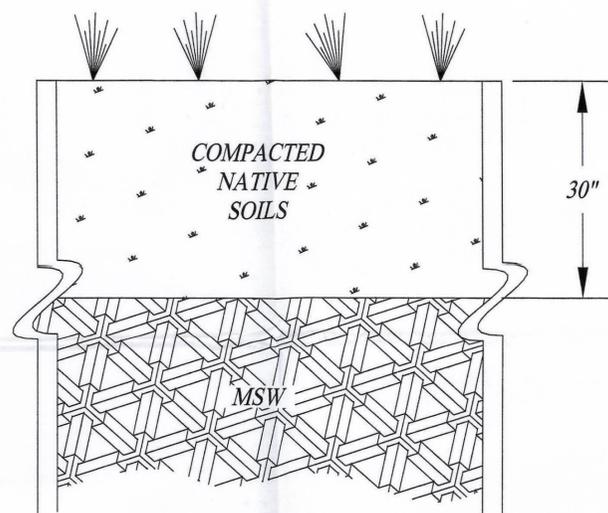

DT-1 DETAIL - FINAL COVER
- NOT TO SCALE

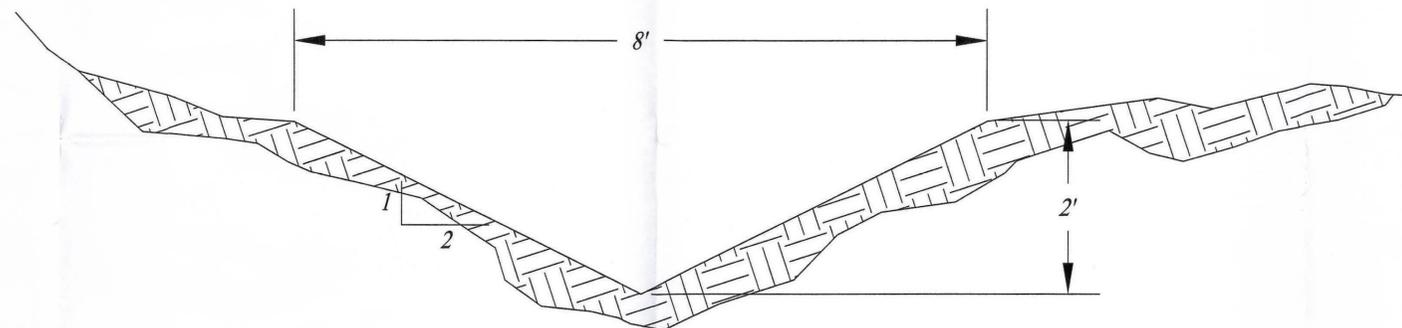

DT-2 DETAIL - DRAINAGE DITCH
- NOT TO SCALE


REFERENCE:
ADAPTED FROM USGS TOPO MAP AND DIGITAL ELEVATION MODEL (UTAH AGRC)
*RED POINT, UTAH 1979
SITE TOPOGRAPHY BY JOHANSEN & TUTTLE, 1994
UPDATED BASED ON AERIAL IMAGERY, 2010

APPENDIX B

SEP 01 1994

STATE OF UTAH)
) ss
COUNTY OF EMERY)

I, Ina Lee J. Magnuson, County Recorder
In and For Emery County, State of Utah, hereby certify
that the foregoing is a full, true, and correct copy
of the original Patent.
Recorded in Book 107, Page 57-58,
Filing No. 283787, now on file and record
at my office in Emery County, this 24th day
of March. A.D., 19 80.


County Recorder

ITEM B

When Recorded Return to:

EMERY COUNTY CLERK
P.O. Box 907
Castle Dale, Utah 84513

STATE OF UTAH
EMERY COUNTY CLERK'S OFFICE
FILED AND RECORDED FOR
Emery County
JUN 22 9 36 AM '87
IN BOOK 167
PAGE 812
UNIT 1

WARRANTY DEED

KIRK JOHANSEN and JULIE JOHANSEN, husband and wife, Grantors, of Castle Dale, Emery County, Utah, hereby CONVEYS and WARRANTS to EMERY COUNTY, a body corporate and politic of the State of Utah, Grantee for good and valuable consideration, receipt of which is hereby acknowledged, the following described tract of land in Emery County, State of Utah, to-wit:

The West 1/2 of the West 1/2 of the Northeast Quarter of the Northeast Quarter of Section 16, Township 18 South, Range 8 East, SLB&M. Containing 10.0 acres more or less.

WITNESS, the hands of said Grantors this 22 day of June, 1987.


Kirk Johansen
KIRK JOHANSEN

Julie Johansen
JULIE JOHANSEN

STATE OF UTAH)
) ss.
County of Emery)

On the 22nd day of June, 1987, personally appeared before me the undersigned signers of the above instrument, who duly acknowledged to me that they executed the same.

Julie D. Wilson
Notary Public

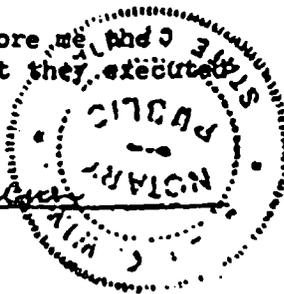

My Commission Expires:

4-29-91

Residing at Malen, Utah

(Reserving to the State of Utah) all coal and other minerals in the
233ive lands, and to it, or persons authorized by it, the right to
prospect for, mine and remove coal and other minerals from the
same, upon compliance with the conditions and subject to the
limitations of Title 55, Chapter 4, Utah Code Annotated 1953, and
amendments thereto

Rights of way for canals, ditches, tunnels, telephone and trans-
mission lines constructed by authority of the United States, as
reserved, U. S. Act, Aug. 30th, 1890 (26 Stat. 391); 65 - 2 - 3 Utah
Code Annotated 1953

containing Three Hundred and Twenty and no/100 (320.00) acres according to the said certificate.

TO HAVE AND TO HOLD the above described and granted premises unto the said _____
_____ EMERY COUNTY _____

_____ and to _____ its _____
_____ and assigns forever, subject to any easement or right of way of the public, to use all such highways as may have been estab-
lished according to law, over the same or any part thereof, and subject also to all rights of way for ditches, tunnels, and telephone
and transmission lines that may have been constructed by authority of the United States.

IN TESTIMONY WHEREOF, I have hereunto set my hand and caused the great seal of the State of Utah to be hereunto af-
fixed. Done at Salt Lake City, this 26th day of MARCE in the year of our Lord,
one thousand nine hundred and Seventy-Nine and of the independence of the
United States of America the two hundred and 203 and in the 84
year of the State of Utah.



By the Governor:
David S. Morgan
Lieutenant Governor — Secretary of State

William K. Dickhaut
Director, Division of State Lands

Recorded Patent Book 37 Page 32
Certificate of Sale No. 24180

STATE OF UTAH
COUNTY OF EMERY } SS
FILED AND RECORDED FOR
Emery County
MAY 25 4 55 PM '79
Eggen Lot PAGE 57-58
COUNTY RECORDER

283787

58

R 11311

APPENDIX C

EMERY COUNTY LANDFILL INSPECTION FORM

Performed by: _____ Date: _____

Overall Condition

Satisfactory Needs Work *

I. Structures and Roads

- | | | |
|--------------|-------|-------|
| 1. Buildings | _____ | _____ |
| 2. Fences | _____ | _____ |
| 3. Gates | _____ | _____ |
| 4. Roads | _____ | _____ |

*Specify recommended repairs and/or list actions taken:

II. Operations

- | | | |
|------------------------------------|-------|-------|
| 1. Litter and Weed Control | _____ | _____ |
| 2. Excavations | _____ | _____ |
| 3. Daily Cover / <i>Int. Cover</i> | _____ | _____ |
| 4. Final Cover | _____ | _____ |
| 5. Segregated Waste Piles | | |
| a. Scrap Metal | _____ | _____ |
| b. Appliances | _____ | _____ |
| c. Dead Animal Pit | _____ | _____ |
| d. Yard Waste | _____ | _____ |
| e. Construction Debris | _____ | _____ |
| f. Waste Oil/Anti-Freeze Tanks | _____ | _____ |
| g. Used Battery Skid | _____ | _____ |
| h. Recyclables/Reuse Storage Area | _____ | _____ |

*Specify recommended repairs and/or list actions taken:

Routine Waste Inspection Form

Date: _____ Time: _____

Truck Type: _____

Hauler: _____ License/Truck #: _____

Source of Material: _____

Other Information: _____

WEATHER: GOOD__ FAIR__ POOR__ WET__ DRY__ WINDY__

Waste Composition

Composition	Percent by Volume (estimated)
Food Wastes	
Paper/Cardboard	
Plastics	
Textiles/Rubber/Leather	
Dirt/Ashes/Brick	
Vegetative Wastes	
Wood	
Glass	
Metals	
Household Hazardous Waste	
Tires	
Drywall	
Other Hazardous Wastes	

Comments:

Inspector Signature: _____

Date: _____

Approval: _____ Date: _____



Utah Department of Environmental Quality

Division of Solid and Hazardous Waste

1-800-458-0145

NAME OF BUSINESS _____

DATE _____

UTAH DIYer USED OIL LOG

Acceptable Oil

Motor Oil
Hydraulic Oils
Transmission Fluids

Unacceptable Materials

Solvents
Paint & Varnishes
Household Chemicals
Anti-Freeze

Paint & Lacquer Thinners
Insecticides
Gasoline
Any combination/mix of unacceptable materials with acceptable oil

By signing this log, I certify that the materials submitted consist entirely of "Acceptable Oil" which was removed from a motor vehicle without charge.

Name

Address

Date

Volume

1. _____
2. _____
3. _____
4. _____
5. _____
6. _____
7. _____
8. _____
9. _____
10. _____
11. _____
12. _____
13. _____
14. _____
15. _____
16. _____
17. _____
18. _____
19. _____
20. _____

Emery County Municipal Landfill

HOT LOAD

Weather Conditions: _____

Date of Incident: _____ Time of Incident: _____ am/pm

Name of Carrier bringing in Hot Load: _____

Name of Driver: _____ Drivers License #: _____

Vehicle License #: _____ Vehicle Make or ID #: _____

1. Did driver advise employee that he had a hot load? Yes _____ No _____

Explain: _____

A. What instructions were given to the driver? _____

B. Where was the Hot Load deposited for observation? _____

C. Were Hot Load procedures followed? Yes _____ No _____ If no explain _____

D. Did screener communicate Hot Load information to the operator? Yes _____
No _____ If no explain _____

E. Did operator follow Hot Load to site? Yes _____ No _____ If no explain _____

2. Was the Landfill Supervisor called? Yes _____ No _____ If no explain _____

3. Was the Fire Department called to respond? Yes _____ No _____ If no explain _____

A. Name of responding Fire Department(s): _____

B. Number and type of fire units responding: _____

C. Method used by firefighters: Water _____ Other _____
If other explain _____

D. Name of Fire Crew Chief(s) at scene: _____

4. Was the Sheriff's Office called? Yes _____ No _____ If no explain _____

5. Were Landfill operational procedures followed? Yes _____ No _____ If no explain _____

6. Describe incident in detail: _____

7. Was this an avoidable incident? Yes _____ No _____ If yes explain _____

A. How could this incident have been avoided? _____

8. Was there property damage? Yes _____ No _____ If yes explain _____

9. Was damaged property insured: Yes _____ No _____

A. Insurance Company or Agency Name and Policy #: _____

10. Employee comments regarding incident/accident: _____

Operator's Signature _____

Screener's Signature: _____

Supervisor's Signature: _____

Date: _____

**EMERY COUNTY LANDFILL
QUARTERLY METHANE MONITORING REPORT**

Name: _____

Date: _____

Was the methometer calibrated before use?

Yes / No

LOCATION	READING	UNITS
Inside Operator's Shack (max 25% of LEL)		
Shop (max 25% of LEL)		
Front Gate (max 100% of LEL)		
NW Corner of Fence (max 100% of LEL)		
NE Corner of Fence (max 100% of LEL)		
SE Corner of Fence (max 100% of LEL)		
SW Corner of Fence (max 100% of LEL)		

Comments/Observations/Actions Taken:

APPENDIX D




Utah Division of Water Rights

Output Listing

Version: 2009.05.06.00 Rundate: 06/13/2011 09:06 AM

Radius search of 5280 feet from a point S13.75 E1226.21 from the N4 corner, section 16, Township 18S, Range 8E, SL
b&m Criteria: wrtypes=W,C,E,T podtypes=all status=all useypes=all

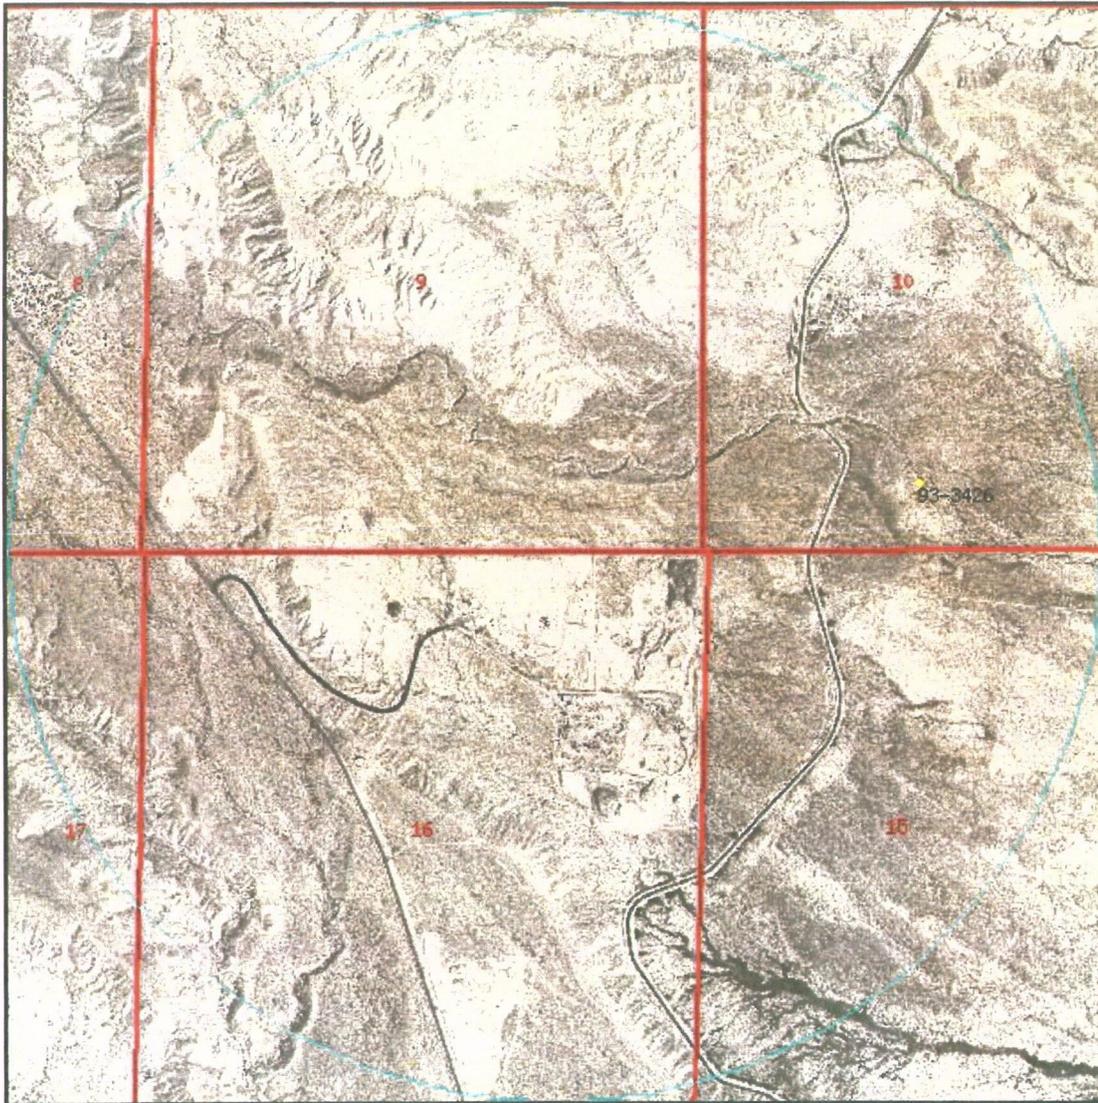

2016' E



Water Rights

WR Number	Diversion Type/Location	Well Log	Status	Priority	Uses	CFS	ACFT	Owner Name
-----------	-------------------------	----------	--------	----------	------	-----	------	------------

93-3426 Point to Point

P 18750000 S 0.000 0.000

UTAH SCHOOL AND INSTITUTIONAL
TRUST LANDS ADMIN.

N660 W660 S4 10
18S 8E SL

SALT LAKE CITY UT 84102

Utah Division of Water Rights | 1594 West North Temple Suite 220, P.O. Box 146300, Salt Lake City, Utah 84114-6300 | 801-538-7240
[Natural Resources](#) | [Contact](#) | [Disclaimer](#) | [Privacy Policy](#) | [Accessibility Policy](#) | [Emergency Evacuation Plan](#)

APPENDIX E

July 13, 1995

Jeff Emmons, Environmental Scientist
Division of Solid and Hazardous Waste
Utah Department of Environmental Quality
P.O. Box 144880
Salt Lake City, UT 84114-4880

SUBJECT: EMERY COUNTY CLASS I LANDFILL REQUEST FOR EXEMPTIONS

Dear Jeff:

Here's the document we've been discussing for the past months. It contains specific technological support for our request on behalf of Emery County to waive the liner construction, leachate control designs, and ground water monitoring requirements under Utah's Administrative Rules.

Our permit application does not include liner and leachate control designs or provisions for ground water monitoring, so very little would have to be rewritten if this exemption is approved.

We will have some changes to the general layout and operation of the landfill which will be incorporated into the application, but those changes are relatively minor and greatly enhance the Landfill as a public utility.

Gary and I would like to meet with you as soon as a decision is made on the exemption to facilitate final submission of the permit application. Unless you plan a trip to southern Utah in the next few weeks, that meeting should probably take place in Salt Lake City. Please get back with Gary or me to set the appointment.

Sincerely,



Corrie Lynne Player
President

Enclosure: Request for Exemption from Liner, Leachate Control, and Ground Water Monitoring dated July 13, 1995

CC: Bevan Wilson, Emery County Commissioner
Rex Funk, Emery County Road Department Superintendent

FILE: K:\CLIENTS\93683-3\CORRESVE-EXIMP.LTR

EMERY COUNTY LANDFILL

**REQUEST FOR EXEMPTION
FROM LINER, LEACHATE CONTROL,
AND GROUND WATER MONITORING**

Prepared for Emery County Commission

for the use of

**Dennis R. Downs, Director
Division of Solid and Hazardous Waste
Utah Department of Environmental Quality
Post Office Box 144880
Salt Lake City, Utah 84114-4880**

Dated

July 13, 1995

Prepared by

**TAHOMA COMPANIES, INCORPORATED ♦ WDBE
444 South Main Street, Suite C-7
Cedar City, Utah 84720
(801) 865-0131 (fax) 865-0161
FILE: SHARE\CLIENTS\REPORTS\WAIVER.RPT.**

TABLE OF CONTENTS

	<i>Page</i>
INTRODUCTION	1
LEGAL BASIS FOR GRANTING AN EXEMPTION	1
LANDFILL LINER	1
LEACHATE COLLECTION SYSTEM	2
GROUND WATER MONITORING	2
SCOPE OF WORK	2
CLIMATE	3
INITIAL MOISTURE CONTENT OF WASTE AND SOILS	4
Basis for Initial Moisture Content Assumptions	4
GEOLOGICAL SETTING	5
Areal Distribution of the Mancos Shale near the Emery County Landfill	5
Porosity and Permeability of Fractured Blue Gate Member Rocks	6
Regional Hydrogeology of the Ferron Sandstone Aquifer	7
Regional Hydrogeology of the Blue Gate Member of the Mancos Shale	8
Site Specific Hydrogeology of the Blue Gate Member of the Mancos Shale	9
SUMMARY OF HYDROGEOLOGICAL CONDITIONS	10
LANDFILL DESIGN AND OPERATION	11
NEW LANDFILL UNIT	11
SURFACE WATER CONTROLS	11
Run-On Control	11
Run-Off Control	12
LIQUID WASTE	12
DAILY AND FINAL COVER	13
SUMMARY OF LANDFILL DESIGN AND OPERATIONAL FEATURES TO MINIMIZE LEACHATE GENERATION AND INFILTRATION ..	13
COMPUTER MODELING OF LEACHATE GENERATION AND INFILTRATION (HELP3)	15
DESIGN OF LANDFILL MODEL	15
LEACHATE GENERATION	16

TABLE OF CONTENTS (CONTINUED)

	<i>Page</i>
PROBABLE CHEMICAL COMPOSITION OF LEACHATE	16
SUMMARY AND CONCLUSIONS	18

APPENDICES

Appendix No.

- | | |
|---|---------------------|
| A | CLIMATOLOGICAL DATA |
| B | FIGURES |
| C | LABORATORY ANALYSIS |
| D | HELP3 RESULTS |

INTRODUCTION

The Emery County Landfill (ECL) is an operating Class I landfill near Castle Dale, Emery County, Utah. It was constructed in 1983 in the NE 1/4 of section 16, T. 18 S., R. 8 E., Salt Lake Baseline and Meridian. The ECL originally operated under older regulations but has now been upgraded in order to meet the Utah Solid Waste Permitting and Management Rules (UAR R513-301-2). Tahoma Companies, Incorporated of Cedar City, Utah, has been retained by Emery County to design future landfill units and to prepare the permit application and other documents needed for compliance under the current regulations.

Tahoma has concluded that the site is adequate for operation of the ECL without installation of a landfill liner system, leachate control or ground water monitoring. This Request for Exemption contains the technical justification for operation of the ECL without those systems.

LEGAL BASIS FOR GRANTING AN EXEMPTION

LANDFILL LINER

The basis for obtaining an exemption from the requirement for construction of a landfill liner is described in Subsection R315-303-4(3)(c)(i) of the UAR. It states:

The owner or operator may use, as approved by the Executive Secretary, alternative design, operating practices, and location characteristics which will minimize the migration of solid waste constituents or leachate into the ground or surface water which are at least as effective as the liners of Subsections R315-303-4(3)(a) or (b).

The regulation further states in Subsection R315-303-4(3)(c)(ii) that:

The owner or operator must demonstrate the standard of Subsection R315-303-3(1) can be met. The demonstration must be approved by the Executive Secretary, and must be based upon:

- A) the hydrogeologic characteristics of the facility and the surrounding land;

- B) the climatic factors of the area;
- C) the volume and physical and chemical characteristics of the leachate;
and
- D) predictions of contaminate fate and transport in the subsurface that maximize contaminant migration and consider impacts on human health and the environment;

LEACHATE COLLECTION SYSTEM

Subsection R315-303-4(2) states that a leachate collection system is required only for "a landfill required to install liners." The ECL will not construct a leachate collection system if a landfill liner is not required.

GROUND WATER MONITORING

The basis for obtaining a waiver from ground water monitoring is found in UAR Section R315-308. The rule states that the requirements "may be suspended by the Executive Secretary if the owner or operator of a solid waste disposal facility can demonstrate that there is no potential for migration of hazardous constituents from the facility to the ground water during the active life of the facility and the post-closure care period."

The demonstration must be based on measurements collected at specific field sites, including sampling and analysis of physical, chemical and biological processes affecting the fate and transportation of contaminants. Predictions of the fate and transportation of contaminants should be based on the maximum possible distance of the migration of contaminants and a consideration of the impacts on public health and safety and the environment.

SCOPE OF WORK

This report presents technical data and interpretations of the data that demonstrate that little or no leachate will be generated by the ECL. The report also shows that any leachate generated will not adversely impact ground water, human health or the environment.

The most important factors governing leachate generation and migration at the Emery County Landfill are:

- 1) Climate;
- 2) Initial moisture content of the waste and soils at the site;
- 3) Local and regional geological setting of the site; and
- 4) Surface and ground water hydrology at the site.

Initial studies for the landfill permit application included literature reviews of published information about (1) the climate at Castle Dale and other communities with analogous climates, (2) regional and site-specific geology of Emery County, and (3) surface and ground water hydrology of the Emery County Landfill. Initial studies were followed by the construction of several test pits and one test boring to obtain subsurface information from the site.

The potential for leachate generation was studied by modeling with the Help3 computer program, version 3.04 (March 13, 1995). This program was written by the U.S. Army Corps of Engineers for the U.S. Environmental Protection Agency specifically for the evaluation of landfills and leachate generation.

CLIMATE

The climate at Castle Dale is semiarid. Average annual precipitation is 7.52 inches (Ashcroft, et. al., 1992). Most of the precipitation occurs from July through October as thunder storms. Normal mean temperatures range from 21.7 degrees Fahrenheit in January to 71.7 degrees Fahrenheit in July. The maximum recorded temperature is 103 degrees F., while the record minimum temperature reported is 35 degrees F. below zero. Evapotranspiration averages 48.07 inches per year.

Pan evaporation from open bodies of fresh water has not been measured at Castle Dale. An approximation of pan evaporation for Castle Dale can be made by comparing evapotranspiration values with pan evaporation values. Pan evaporation averaged about 30 percent greater than evapotranspiration at six Utah desert climate stations (Moab, Arches National Park, Green River Aviation, Milford, St. George and Hite). If the relationship is correct for Castle Dale, then pan evaporation at Castle Dale would be about 62.5 inches per year.

Default records for temperature and precipitation were not provided for Castle Dale, Utah in the Help3 computer program. Therefore, temperature and precipitation from several

communities with climates similar to Castle Dale that were provided were used to approximate Castle Dale's climate. The two most similar climates are found in Grand Junction, Colorado and Milford, Utah. Grand Junction has virtually the same precipitation, but averages about 5 degrees Fahrenheit warmer every month. Milford's temperatures are very similar to those reported for Castle Dale, although average rainfall is about 25 percent greater.

The best "fit" to Castle Dale climate information was determined to be a combination of rainfall records from Grand Junction, Colorado, with temperature and solar radiation records from Milford, Utah. Climatological data for Castle Dale and Milford have been provided as Appendix A.

INITIAL MOISTURE CONTENT OF WASTE AND SOILS

This discussion of initial moisture content in layers of a proposed landfill unit is presented in sequence from the top down. The uppermost materials are 6 (six) inches of silty sands with a moisture content of about 15 percent to be used for revegetation of the closed landfill unit. The next layer is 18 (eighteen) inches of compacted clay with initial moisture content of about 25 percent. The next units modeled consist of alternating 36 (thirty six) inch layers of compacted municipal waste with initial moisture contents ranging from 15 to 20 percent, and six (inch) layers of silty sand used for daily cover soils. Initial moisture content for the daily cover sands was 10 percent.

Basis for Initial Moisture Content Assumptions

Few observations are available about the initial moisture content of municipal waste in Utah. Vector Engineering (1991) conducted a waste sort at the Winnemucca, Nevada, landfill. Vector concluded that the initial moisture content for waste at Winnemucca was 13.64 percent, or .1364 volume per volume.

A relatively high proportion of Winnemucca waste consists of food wastes from casinos, restaurants and hotels. Food waste is one of the major contributors of moisture (Tchobanoglous, 1977). The Emery County waste stream has a lower food waste content because there are very few restaurants and no known casinos in the county. However, in order to present conservative results, relatively high initial moisture values (17.5 percent through 22.50 percent) for Emery County wastes were used in computer simulations of leachate generation.

Daily cover soils at the ECL are prepared by crushing soft sandstone cobbles and boulders found in the pediment gravel that mantles the landfill site. The resulting gravelly silty sands are virtually dry. They have been assigned an initial moisture content of 10 percent for use in the Help3 computer model.

Fractured shales of the Blue Gate member of the Mancos Shale formation directly underlie the proposed landfill unit. The shales have about 0.041 percent fracture porosity. The open fractures have been assigned an initial moisture content of 0.035 percent (based on known moisture contents of similar soils) for use in the computer model.

GEOLOGICAL SETTING

The Emery County Landfill is underlain by approximately 3,000 feet of Mancos Shale Cretaceous bedrock covered with a thin (less than 25 feet) veneer of pediment gravel. The only bedrock unit exposed at the landfill is the Blue Gate Member of the Mancos Shale (Ellis and Frank, 1981). A portion of their map is included in Appendix B as Figure A.

Areal Distribution of the Mancos Shale near the Emery County Landfill

Middle and upper Cretaceous rocks are widespread throughout much of central and eastern Utah. The largest region of relatively level land in the area is underlain by Mancos Shale. The Mancos Shale lowlands form a broad border on the west, north and northeast sides of the San Rafael Swell and then swing eastward parallel with the Book Cliffs into western Colorado. Most of the agricultural settlements of Emery, Carbon and Grand Counties are located in the Mancos Shale Lowlands.

The Emery County Landfill (ECL) is located on the western edge of the Castle Valley portion of the Mancos Shale Lowlands. The rocks are gently folded and dip variably to the northeast, north and northwest at about six degrees or less. The thick shales continue to the west but disappear into the subsurface under younger Cretaceous sandstones that form cliffs along the eastern boundary of the Wasatch Mountains.

A published geologic map and cross section (Witkind, 1988) show that the Blue Gate Member of the Mancos Shale extends eastward across Castle Valley towards its outcrop edge approximately five miles east of Castle Dale. The Mancos Shale has been eroded away east of Castle Valley but is visible again to the north and east on the flanks of the San Rafael Swell. Part of Witkind's cross section is included with Appendix B as Figure B.

The Blue Gate Member, of middle to upper Cretaceous age, consists of about 1600 feet of light bluish gray and gray shale and shaly siltstone. The shale is thin to medium bedded and contains rare, thin silty sandstone layers. The shale weathers into thin, tabular fragments and forms low, rounded hills.

The lower portion the Emery Sandstone Member of the Mancos Shale is exposed on property owned by Emery County, about 1,000 feet west of the landfill. This unit consists of about 90 feet of interbedded gray to yellow sandstone, siltstone and silty shale. The rocks occur on slopes uphill from the landfill and do not extend under the ECL.

Porosity and Permeability of Fractured Blue Gate Member Rocks

Surface measurements of fracture spacing in the Blue Gate Member by Tahoma Companies, Incorporated showed that effective porosity in the weathered zone may be as high as four percent. This high value was obtained by artificially fracturing the rocks with a ripper tooth, measuring the joint spacing in the resulting rubble and assuming an average width for open fractures of 0.05 inches (1.27 millimeters, or 1,270 microns).

David T. Snow (1968) compiled information on fracture porosity and permeability in bedrock from more than 5,000 pressurized water-injection measurements at 35 dam sites. His data showed that porosity decreases immediately below the weathered zone to an average of about 0.05 percent near the surface. Measured porosity decreases to 0.005 percent at a depth of 200 feet and to 0.0005 percent at 400 feet below the surface. He also reported that the average size of fracture openings decreases from about 100 microns near the surface to about 50 microns at 200 feet.

Snow concluded that fracture porosity distribution was essentially the same for all competent rock types whose intergranular permeability is very small compared to fracture permeability, including shales and siltstones such as those present in the Blue Gate Member. Decreasing permeability with depth was found to be the result of decreasing fracture openings. Snow's fourth conclusion (pages 89 and 90) best describes fracture porosity to be expected at the Emery County Landfill:

...At any site on fractured rock, fracture porosity decreases with depth. Other sites on the same rock type have different trends, but the maximum porosity is about 0.05 percent near the surface, decreasing by an order of magnitude each 200 feet within the depth of usual dam-site explorations. Shattered or weathered rock near the surface *or rocks disturbed by excavation* doubtless exceed these limits. [*Italics added*].

Snow (page 88) stated that highly porous fractured rocks in the weathered zone generally were present to depths of 5 to 10 feet below ground level. Virtually all of the leachate predicted by worst case modeling with HELP3 would be stored in the weathered zone at the top of the Blue Gate Member under the ECL.

Regional Hydrogeology of the Ferron Sandstone Aquifer

The only significant aquifer near the ECL is the Ferron Sandstone Member of the Mancos Shale. The Ferron occurs directly below the Blue Gate Member about 1,600 feet below ground at the ECL.

Permeable sandstones in the Ferron Member contain potable ground water near Emery, Utah, about 25 miles southwest of the ECL. Several analyses of water from townships closer to the landfill all disclosed salinities ranging from 3,800 to 21,000 mg/Liter--unsuitable for human consumption (Lines and Morrissey, 1983).

The closest sample of Ferron ground water tested by Lines and Morrissey was obtained from a well only four miles northwest of the ECL. Water from that location had a total dissolved solids content of 14,541 mg/Liter.

The largest source of recharge to the Ferron Sandstone aquifer is subsurface inflow from the west under the Wasatch Plateau. Subsurface inflow near Emery was estimated by Lines and Morrissey at 2.4 cubic feet per second. Most of this moves laterally through crushed zones in the Joes Valley fault system. Lines and Morrissey also stated that "little" water is recharged to the aquifer by precipitation on the outcrop area.

Data from Lines and Morrissey suggest the following conclusions about water in the Ferron Sandstone aquifer at the Emery County Landfill:

- 1) Regional subsurface ground water flow in the Ferron Sandstone is from west to east;
- 2) Water four miles northwest of the ECL has a total dissolved solids content of about 14,000 mg/Liter;
- 3) Infiltration from the surface to the Ferron Sandstone is negligible;
- 4) Water quality in the Ferron Sandstone under the ECL is probably comparable to that in a well four miles to the northwest.

Regional Hydrogeology of the Blue Gate Member of the Mancos Shale

Hydrogeology of the Blue Gate Member of the Mancos Shale has not been studied in detail by published authors. The reason for this is that the Blue Gate Member is not considered a good aquifer. An aquifer is defined as: *a permeable geologic unit that can transmit and store significant quantities of water* (Maidment, 1992). The Blue Gate is permeable where fractured, but neither transmits nor stores significant quantities of ground water. Lines and Morrissey reported five analyses of water from the Blue Gate Member in Emery County. Only two of their analyses are from localities within 10 miles of the ECL:

Water from an exploratory boring 10 miles northeast of the ECL was analyzed by Chemical and Geological Laboratories in 1954. Water from 120 to 200 feet below ground contained 22,600 mg/Liter total dissolved solids. This water was sampled from an elevation of about 6,000 feet.

Water has also been analyzed from a spring in the Mancos Shale about five miles southeast of the ECL. Water from the spring contained 5,080 mg/Liter total dissolved solids. The spring was sampled in May of 1978. Seasonal variations in flow and salinity from analogous springs suggest that the total dissolved solids could be much higher in the summer months. This water is produced from a small perched aquifer on Oil Well Dome at an elevation of about 5,700 feet.

On Friday, February 17, 1995, Tahoma's geologist, Gary F. Player, visited the spring referenced by Lines and Morrissey and made the following observations:

- 1) The spring does not issue from the Blue Gate Member of the Mancos Shale. The Blue Gate Member is that portion of the Mancos Shale above the Ferron Sandstone.
- 2) Water from rain and snow-melt that accumulates on Oil Well Dome percolates downward through Ferron Sandstone outcrops to the top of the Lower Member of the Mancos Shale. Water moves laterally on and above the contact between the Ferron Sandstone and underlying low permeability shales. Water then surfaces in springs in a gully along the northwest side of Oil Well Dome.
- 3) The Ferron Sandstone aquifer that transmits water to the spring is restricted to that portion of Oil Well Dome above 5,700 feet.

- 4) The Ferron Sandstone aquifer at Oil Well Dome is not connected to the rocks that underlie the Emery County Landfill. Sandstone beds have been eroded away west of the dome and are not continuous to the west.
- 5) Water issuing from the spring is captured in Dutchman's Wash, a tributary of Cottonwood Creek that flows eastward, ultimately, to the San Rafael River.

Waters from the other three, more distant, Blue Gate sample locations ranged from 4,040 to 19,400 mg/Liter total dissolved solids.

Site Specific Hydrogeology of the Blue Gate Member of the Mancos Shale

Hydrogeology of the Blue Gate Member of the Mancos Shale at the ECL has been investigated with a test boring, ECL #1. The test boring was drilled upgradient from the active landfill at a point 50 feet west from the fence along the western boundary of the landfill.

ECL #1 was drilled to a depth of 440 feet below ground level (BGL). Cobbles and boulders of the Pediment Gravel were encountered from the surface to 19 feet BGL. Materials in the remainder of the boring consisted of dark gray to black mudstone shale mixed with blue-gray siltstone. The hole was drilled with compressed air so that any ground water would be readily observable.

A few drops of vadose zone water were encountered in drill cuttings at about 140 feet BGL. A small amount of this water (less than 10 gallons) accumulated in the boring over night after the hole had been advanced to 180 feet on May 30, 1995. This water was blown out of the hole with compressed air when drilling resumed on May 31, 1995. The hole then remained dry until the drill reached a depth of 372 feet BGL. A small quantity of water in fine grained sandstone was encountered at that depth. Just enough water was present to mix with the cuttings and form a thick mud that could not be lifted to the surface by compressed air.

The driller then switched over from air circulation to fresh water and drilled ahead to 440 feet BGL, the total depth of the test boring. The driller then switched back to circulating with air and was able to blow the hole clean of mud and some ground water. The hole was allowed to sit for one hour and forty five minutes, after which about 5 gallons of Blue Gate Member ground water were air-lifted to the surface and sampled for analysis.

Water from ECL #1 was analyzed by the Southern Utah University Water Laboratory. Total dissolved solids (TDS) was 38,400 mg/Liter. This TDS value may be somewhat lower than the actual ground water concentration, as dilution by fresher drilling water probably occurred. The laboratory value can be considered the minimum background TDS concentration of naturally occurring ground water upgradient from the landfill. The complete laboratory analysis of this sample is included as Appendix C.

SUMMARY OF HYDROGEOLOGICAL CONDITIONS

The results of the literature search and site specific field investigations have been incorporated in the following conclusions about the ECL:

- 1) Rocks beneath the landfill consist of a thin (less than 25 feet) veneer of pebbles, cobbles and boulders overlying about 1,600 feet of siltstone and mudstone shale of the Blue Gate Member of the Mancos Shale formation.
- 2) An unconfined water-bearing zone exists in the Blue Gate Member at about 370 feet BGL. Small quantities of vadose water were encountered at about 140 feet BGL, but the rocks were dry from 140 to 372 feet BGL in test boring ECL #1.
- 3) Ground water sampled from the Blue Gate Member upgradient from the ECL is high in dissolved solids, with TDS equal to at least 38,400 mg/Liter.
- 4) A field measurement of permeability in weathered siltstones at the top of the fractured Blue Gate Member disclosed a permeability of 1×10^{-3} cm/second.
- 5) Blue Gate Member rocks contain about 4.1 percent fracture porosity in the weathered zone from about 5 (five) to 10 (ten) feet below the top of the shale.
- 6) Over 5,000 studies of similar rocks show that the fracture porosity of the Blue Gate Member will decrease to 0.005 percent at 200 feet below ground level and 0.0005 percent at 400 feet below ground level.

LANDFILL DESIGN AND OPERATION

Important elements of the landfill design and operation will minimize leachate generation and subsequent migration. Design elements include proposed landfill unit geometry, run-on and run-off control, waste screening, waste placement, daily cover and final closure cover. The design and operational elements summarized below are discussed in the application for a permit to operate the ECL previously submitted to the Utah Division of Solid and Hazardous Waste.

NEW LANDFILL UNIT

Proposed new landfill units at the Emery County Landfill will be constructed by excavating through surface pediment gravel to the underlying Mancos Shale. Average thickness of the surface gravel, as determined from backhoe-excavated test pits, is less than 25 feet.

The excavated gravel will be crushed and stockpiled. Fine materials unsuitable for use as road fill by Emery County Road Department will be retained at the landfill for use as daily cover.

Each landfill unit will be excavated as a rectangular pit with a floor depth of about 30 feet BGL. All pit walls will be laid back at slopes of one (horizontal distance) to one (vertical distance).

SURFACE WATER CONTROLS

Run-On Control

The proposed design locations for two new landfill units at the Emery County Landfill are in the extreme northeast corner of the landfill property. The landfill units will be placed in a 10 acre parcel described as follows:

West 1/2 of the West 1/2 of the Northeast quarter of the Northeast quarter of Section 16, Township 18 South, Range 8 East.

Potential run-on from areas north and west of the existing fenced landfill is deflected by topography into a deeply incised (approximately 15 feet deep) northwest- to southeast-trending channel that runs parallel to the landfill fence, approximately 500 feet southwest of the fence line.

Flooding potential for the existing landfill is low. However, Tahoma has recommended that a ditch be constructed along the entire northern perimeter of the fenced landfill area. This ditch would deflect all potential run-on from the north of the facility into natural drainages east of the Emery County Landfill.

Two existing drainages in the westernmost portion of the landfill capture any sheetflow entering the landfill from the west. Water from these existing drainages is carried out of the landfill under the landfill access road in a 36-inch diameter corrugated metal pipe culvert.

Run-Off Control

Proposed new landfill units for the Emery County Landfill will be excavated 30 feet BGL. As long as run-on is minimized, run-off control is not necessary. Water could run-off from the active pits only if an unanticipated record storm dropped sufficient rainfall directly into a landfill unit to saturate the compacted waste and cover material and then fill the remaining unused space.

LIQUID WASTE

Keeping prohibited wastes, including liquid wastes, out of the landfill is of primary concern for the safe operation of the landfill. The landfill operators are required to receive periodic training using materials developed by SWANA.

A detailed description of the waste screening program can be found in the *Emery County Landfill Operator's Manual*, including definitions of hazardous wastes and how to identify them.

All loads will be visually inspected as they enter the landfill. Random inspections of incoming loads will be conducted according to the schedule determined by the Landfill Supervisor. SWANA recommends that one load per week be considered the minimum effort required.

DAILY AND FINAL COVER

Solid waste accepted at the landfill is spread in thin layers and compacted. The materials are allowed to dry out at the landfill face before daily cover is applied. Daily cover consists of a minimum of six inches of dry mineral soils. Daily application of cover materials reduces the area of waste directly exposed to precipitation and minimizes infiltration. Compacted daily cover also retains moisture from precipitation near the surface within the zone of evaporation.

Final cover will be applied at the end of the active life of each landfill unit. The final cover will be graded to enhance run-off and minimize infiltration into the closed landfill. Careful maintenance of the closed landfill will limit the volume of water available for leachate generation and migration.

The cover will consist of at least 18 inches of mineral soils with a permeability less than or equal to 1×10^{-5} cm/second. The 18 inches of low permeability mineral soils will be covered with an additional 6 inches of soils capable of supporting native vegetation in order to minimize erosion. The final cover is described in detail in the Closure Plan submitted with the landfill permit application.

SUMMARY OF LANDFILL DESIGN AND OPERATIONAL FEATURES TO MINIMIZE LEACHATE GENERATION AND INFILTRATION

The design and operation of the landfill as discussed above will protect the waters of the State from degradation and protect public health and the environment. The following conclusions are pertinent:

- 1) Each planned landfill unit has a small surface area (less than 5 acres) to minimize direct precipitation.
- 2) Compacted waste will be allowed to dry before being covered each day with at least six inches of mineral soils.
- 3) Daily cover will minimize infiltration from precipitation.
- 4) Each landfill unit will receive final cover as soon as it is filled.

- 5) Final cover will be graded, vegetated and maintained to minimize infiltration from direct precipitation.
- 6) Liquid wastes will be excluded from the landfill.
- 7) Appropriately sized dikes and/or ditches will exclude surface water run-on from entering the active landfill unit(s).

COMPUTER MODELING OF LEACHATE GENERATION 'AND INFILTRATION (HELP3)

An estimate of leachate to be generated at the ECL is necessary in order to evaluate the need for landfill liners, leachate controls, and ground water monitoring. The total volume of leachate can be compared to effective porosity and permeability of the underlying Blue Gate Member of the Mancos Shale in order to estimate vertical migration of leachate from the landfill.

The Hydrologic Evaluation of Landfill Performance (HELP) model was developed to help evaluate the hydrologic performance of proposed landfill designs. The model accepts weather, soil and design data and uses solution techniques that account for the effects of surface storage, snowmelt, runoff, infiltration, evapotranspiration, vegetative growth, soil moisture storage, subsurface drainage, unsaturated vertical drainage, and leakage through soils. Various combinations of layers and materials may be modeled. Results are expressed as monthly, annual, and long-term average water budgets.

DESIGN OF LANDFILL MODEL

The landfill model is described in the first seven pages of each Help3 output report (see Appendix D). This summary discussion of the layers includes information on initial moisture content for each layer.

Initial moisture content in layers of a proposed landfill unit is presented in sequence from the top down. The uppermost materials are six inches of silty sands with a moisture content of about 15 percent to be used for revegetation of the closed landfill unit. The next layer is 18 inches of compacted clay with initial moisture content of about 25 percent. The next units modeled consist of alternating 36 inch layers of compacted municipal waste with initial moisture contents ranging from 17.5 to 22.5 percent, and six inch layers of silty sand used for daily cover soils. Initial moisture content for the daily cover sands was 10 percent. The lowermost layer (layer 19) is a 10 foot thick (120 inch) zone of weathered and fractured Blue Gate Member shale with an initial moisture content of 3.5 percent.

LEACHATE GENERATION

None of the Help3 model runs showed leachate percolation through layer 19, the lowermost layer of the Emery County Landfill model.

For Help3 Run 16, an initial moisture content of 22.5 percent was assigned to the compacted municipal waste. The maximum amount of water stored in layer 19 at the end of the five year simulation was 4.278 inches. That is sufficient to raise the moisture content in layer 19 from the initial moisture content of 3.5 percent water to 3.56 percent water.

The following table summarizes the results of the three most representative Help3 computer model "runs:"

HELP3: SUMMARY DATA

HELP3 RUN NUMBER	INITIAL MOISTURE IN WASTE (%)	AVERAGE PRECIPITATION (INCHES)	LEAKAGE THROUGH LAYER 19 (INCHES)	FINAL WATER STORAGE IN LAYER 19 (IN.)
14	17.5	7.24	0.00000	4.2498
15	20.0	7.24	0.00000	4.2583
16	22.5	7.24	0.00000	4.2780

PROBABLE CHEMICAL COMPOSITION OF LEACHATE

No leachate has ever been observed at the Emery County Landfill. Therefore, no chemical analyses of leachate have been obtained. Analyses of typical leachate from municipal solid waste landfills in humid portions of the United States have been summarized by the Solid Waste Association of North America (SWANA). The following table lists expected constituents and concentrations for leachate generated from municipal solid waste landfills:

TYPICAL LEACHATE CHARACTERISTICS

CONSTITUENT	CONCENTRATION RANGE (mg/Liter)	TYPICAL CONCENTRATION (mg/Liter)
5 day BOD	2,000 - 30,000	10,000
Total Organic Carbon	1,500 - 20,000	6,000
Chemical Oxygen Demand	3,000 - 45,000	18,000
Total Suspended Solids	200 - 1,000	500
Alkalinity as CaCO ₃	1,000 - 10,000	3,000
pH	5.3 - 8.5	6
Total Hardness as CaCO ₃	300 - 10,000	3,500
Calcium	200 - 3,000	1,000
Potassium	200 - 2,000	300
Sodium	200 - 2,000	500
Chloride	100 - 3,000	500
Sulfate	100 - 1,500	300
Total Iron	50 - 600	60
Magnesium	50 - 1,500	250

Other leachate constituents may include small concentrations of volatile organic compounds.

SUMMARY AND CONCLUSIONS

Tahoma Companies, Incorporated, consultant to Emery County, recommends that the Emery County Landfill continue to operate without the construction of a landfill liner, monitoring wells or a leachate control system. The design of the landfill, climate at Castle Dale, operating procedures, hydrogeological setting and physical characteristics of waste accepted for disposal combine to minimize potential contaminant migration. Impacts on public health, safety and the environment will be minimal.

Emery County is currently operating the landfill near Castle Dale, Utah. The landfill has been upgraded to conform to the current Utah Solid Waste Permitting and Management Rules. The rules allow waivers of requirements for landfill liners, ground water monitoring and leachate control if the climate, hydrogeology, and predicted volume of leachate generation and migration meet criteria described in the regulations.

The climate at Castle Dale is semi-arid, with average precipitation of about 7.5 inches. Evapotranspiration exceeds precipitation by a factor of more than 6 times, while probable pan evaporation exceeds precipitation by a factor of more than eight. Temperatures are virtually the same as at Milford, Utah, while precipitation is the same as at Grand Junction, Colorado.

Soils and compacted municipal wastes both have very low initial moisture contents in Emery County. The low moisture contents are important factors that reduce the predicted generation of landfill leachate and consequent risks to ground water.

The Emery County Landfill site has a safe natural setting that would protect ground water in the unlikely event of leachate generation. Relatively impermeable shales under the site are more than 3,000 feet thick. Small quantities of ground water are present at about 375 feet below ground, and the water contains 38,400 milligrams per liter of total dissolved solids. Fractures occur near the surface in the shales, but the fractures are greatly reduced below 200 feet and virtually closed by a depth of 400 feet below ground. Surface waters are diverted around the landfill by natural and man-made drainages.

Computer modeling of leachate generation and infiltration has shown that no leachate will migrate out of the landfill into ground water. Enough moisture is added by landfill operations only to raise the moisture content of fractured shale under the landfill from 3.50 percent to 3.56 percent over a postulated five year period of landfill unit operation.

REFERENCES CITED

Ashcroft, G.L., Donald T. Jensen, and Jeffrey L. Brown, 1992, Utah Climate: Utah Climate Center, USU, Logan, Utah

Ellis, E.G. and Frank, J.R., 1981, Geologic Map and Coal Sections of the Red Point Quadrangle, Emery County, Utah: U.S. Geol. Survey Open File Report 81-1356.

Lines, G.C. and D.J. Morrissey, Hydrology of the Ferron Sandstone Aquifer and Effects of Proposed Surface-Coal Mining in Castle Valley, Utah: U.S. Geol. Survey Open File Report 81-0535, 126 p.

Maidment, David R., Editor in Chief, 1993, Handbook of Hydrology: McGraw-Hill, Inc., 29 Chapters, Appendices, Index.

Snow, David T., 1968, Rock Fracture Spacings, Openings, and Porosities: Journal of the Soil Mechanics and Foundations Division, Proceedings of the American Society of Civil Engineers, Volume 94, Paper 5736, No. SM 1, p. 73-91.

Solid Waste Association of North America (SWANA), 1993, Training Sanitary Landfill Operating Personnel, Instructor's Guidelines: SWANA, Silver Spring, Maryland.

Tchobanaglou, G., H. Theisen, and R. Eliassen, 1977, Solid Wastes: Engineering Principles and Management Issues: McGraw Hill Book Company, New York.

Vector Engineering, Inc., 1991, Nevada Rural Landfill Study, Landfill Inventory, Site Selection, and Detailed Characterization-Phase I Report: Unpublished Report Prepared for the Nevada Division of Environmental Protection, Bureau of Waste Management, 32 pp.

Witkind, I.J., 1988, Geologic Map of the Huntington 30' x 60' Quadrangle, Carbon, Emery, Grand and Uintah Counties, Utah: U.S. Geol. Survey Misc. Inv. Series Map I-1764.

CASTLE DALE CLIMATOLOGICAL DATA

County: Emery Lat: 39° 12' Long: 111°, 16' Elevation: 5619 feet Period: 1928-1992

Element	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Annual
Normal max temp	35.8	42.9	53.2	63.1	73.1	83.9	89.6	86.9	78.8	66.9	50.7	38.5	63.6
Normal min temp	7.6	14.5	23.3	30.4	38.9	46.9	53.8	51.4	42.3	32.0	21.6	11.3	31.2
Normal mena temp	21.7	28.7	38.3	46.8	56.0	65.4	71.7	69.2	60.5	49.5	36.1	24.9	47.4
Record high temp	62	70	81	85	91	100	103	101	95	87	74	64	103
Record low temp	-34	-35	3	12	18	25	35	32	22	3	-7	-28	-35
Normal pcpn	0.56	0.48	0.56	0.50	0.65	0.46	0.83	0.99	0.76	0.74	0.48	0.52	7.52
Record mly pcpn	1.96	1.69	1.93	1.96	2.73	2.01	3.21	3.27	3.68	3.65	2.68	1.74	3.68
Record dly pcpn	0.73	1.10	0.95	0.92	1.07	1.09	1.43	1.35	1.39	1.24	1.49	0.96	1.49
Normal snowfall	6.6	3.8	1.7	0.6	0.0	0.0	0.0	0.0	0.0	0.2	1.3	3.8	18.0
Record mly snow	24.5	19.9	7.0	6.0	4.0	0.0	0.0	0.0	0.0	4.0	12.1	18.4	24.5
Record dly snow	10.5	8.0	7.0	6.0	4.0	0.0	0.0	0.0	0.0	4.0	7.0	9.5	10.5
Evapotranspiration	0.79	1.31	2.69	4.21	6.05	7.58	8.16	7.05	4.94	3.03	1.42	0.84	48.07

*Percentage of period with data: 91% for temperature, 88% for precipitation, 84% for snowfall.

Reference: Ashcroft, G.L., Donald T. Jensen, and Jeffrey L. Brown, 1992, Utah Climate: Utah Climate Center, USU, Logan, Utah

Milford

County: Beaver Latitude: 38°26' Longitude: 113°01' Elevation: 5030 feet Period: 1928-1992*


Element	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Annual
Normal max temp	38.5	45.4	53.3	62.5	73.2	85.0	92.4	89.8	79.9	67.1	51.5	40.2	64.9
Normal min temp	12.5	18.5	24.2	30.4	38.1	46.6	55.3	54.1	43.8	32.5	22.9	14.0	32.7
Normal mean temp	25.5	32.0	38.7	46.4	55.8	65.8	73.8	71.9	61.9	49.8	37.3	27.1	48.8
Record high temp	68	75	80	87	96	105	104	103	99	90	82	66	105
Record low temp	-34	-29	-14	9	17	24	30	34	23	-2	-13	-35	-35
Normal pcprn	0.67	0.67	1.04	0.92	0.86	0.49	0.65	0.99	0.84	0.79	0.73	0.72	9.36
Record mly pcprn	1.86	1.67	2.64	2.28	2.26	2.43	2.85	2.52	3.64	3.75	2.21	2.45	3.75
Record dly pcprn	0.87	0.78	1.14	1.00	1.35	1.29	1.51	1.37	1.42	1.47	0.85	0.93	1.51
Normal snowfall	7.4	7.1	10.5	6.5	1.8	0.0	0.0	0.0	0.4	1.6	4.9	7.1	47.3
Record mly snow	29.8	24.5	29.4	24.4	107.2	0.0	0.0	0.0	8.4	17.4	20.1	30.6	107.2
Record dly snow	11.8	11.2	11.8	9.6	101.5	0.0	0.0	0.0	6.1	6.4	8.3	13.0	101.5
Evapotranspiration	0.95	1.48	2.81	4.35	6.25	7.75	8.72	7.53	5.26	3.21	1.55	0.96	50.82

*Percentage of period with data: 97% for temperature, 99% for precipitation, 97% for snowfall.

Castle Dale

County: Emery Latitude: 39°12' Longitude: 111°01' Elevation: 5619 feet Period: 1928-1992*

Element	Jan	Feb	Mar	Apr	May	Jun	Jul	Aug	Sep	Oct	Nov	Dec	Annual
Normal max temp	35.8	42.9	53.2	63.1	73.1	83.9	89.8	86.9	78.8	66.9	50.7	38.5	63.6
Normal min temp	7.5	14.5	23.3	30.4	38.9	46.9	53.8	51.4	42.3	32.0	21.6	11.3	31.2
Normal mean temp	21.7	28.7	38.3	46.8	56.0	65.4	71.7	69.2	60.5	49.5	36.1	24.9	47.4
Record high temp	62	70	81	85	91	100	103	101	95	87	74	64	103
Record low temp	-34	-35	3	12	18	25	35	32	22	3	-7	-28	-35
Normal pcprn	0.56	0.48	0.56	0.50	0.65	0.46	0.83	0.88	0.78	0.74	0.48	0.52	7.52
Record mly pcprn	1.96	1.69	1.93	1.96	2.73	2.01	3.21	3.27	3.68	2.85	2.68	1.74	3.68
Record dly pcprn	0.73	1.10	0.95	0.92	1.07	1.09	1.43	1.35	1.39	1.24	1.49	0.98	1.49
Normal snowfall	6.6	3.8	1.7	0.6	0.0	0.0	0.0	0.0	0.0	0.2	1.3	3.8	18.0
Record mly snow	24.5	19.9	7.0	6.0	4.0	0.0	0.0	0.0	0.0	4.0	12.1	18.4	24.5
Record dly snow	10.5	8.0	7.0	6.0	4.0	0.0	0.0	0.0	0.0	4.0	7.0	9.5	10.5
Evapotranspiration	0.79	1.31	2.69	4.21	6.05	7.58	8.16	7.06	4.92	2.66	1.11	0.71	47.82

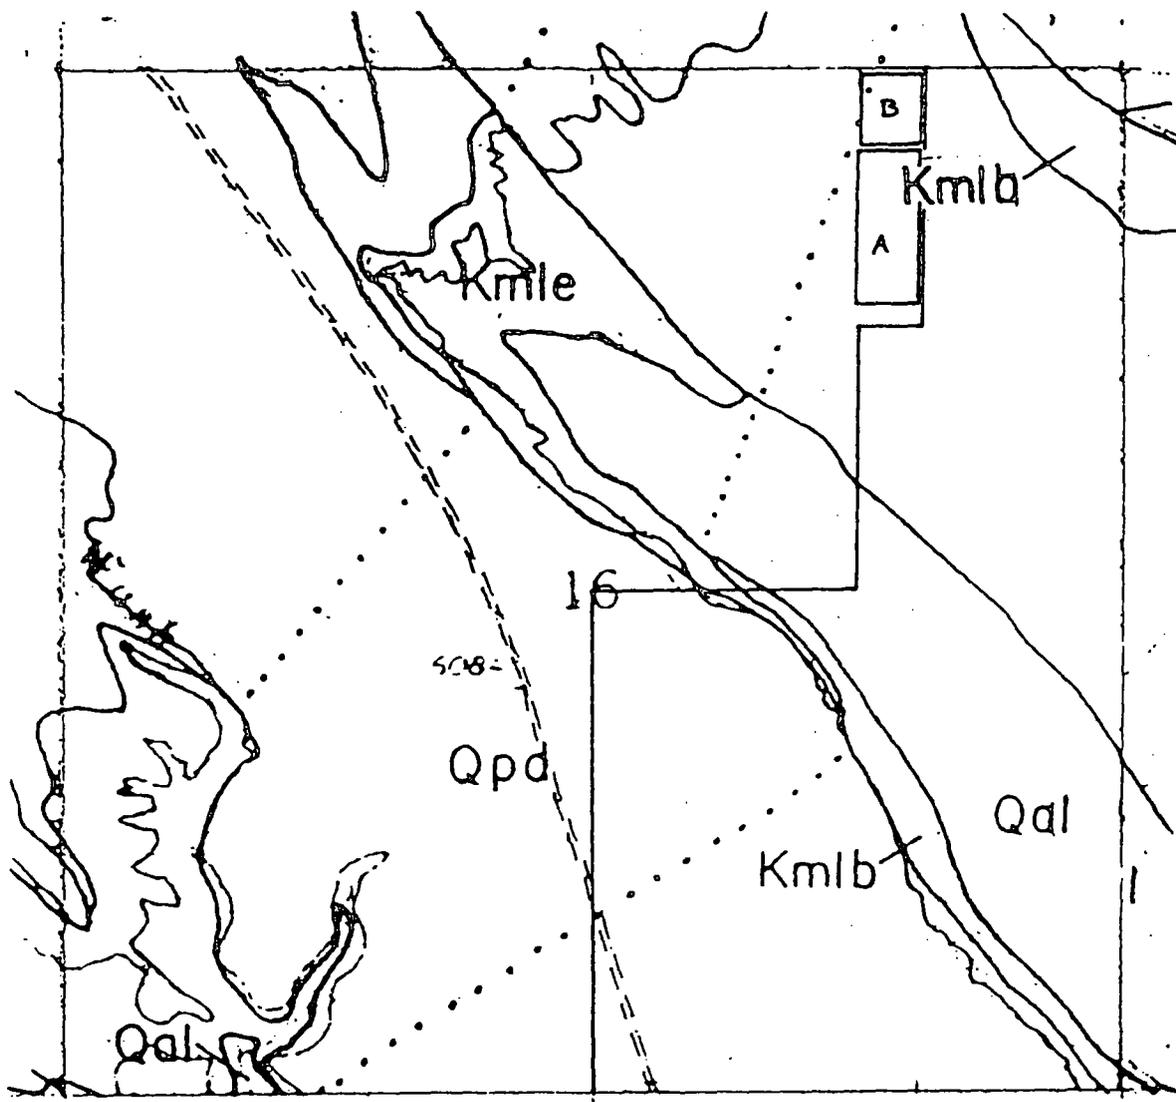


**EMERY COUNTY LANDFILL
APPLICATION FOR A PERMIT TO OPERATE A CLASS I LANDFILL**

FIGURE A Generalized Geologic Map of the Emery County Landfill
From Ellis and Frank, 1981.

Approximate Scale = 1:12,000 (one inch = 1,000 feet)
(Xerographically enlarged)

LEGEND

- Qal** Quaternary Alluvium—sand and gravel in wash channels
- Qpd** Quaternary Pediment Deposits—sand and gravel mantling ridge tops
- Kmlc** Lower Part of Emery Sandstone Member of the Mancos Shale
- Kmlb** Lower Part of the Blue Gate Member of the Mancos Shale

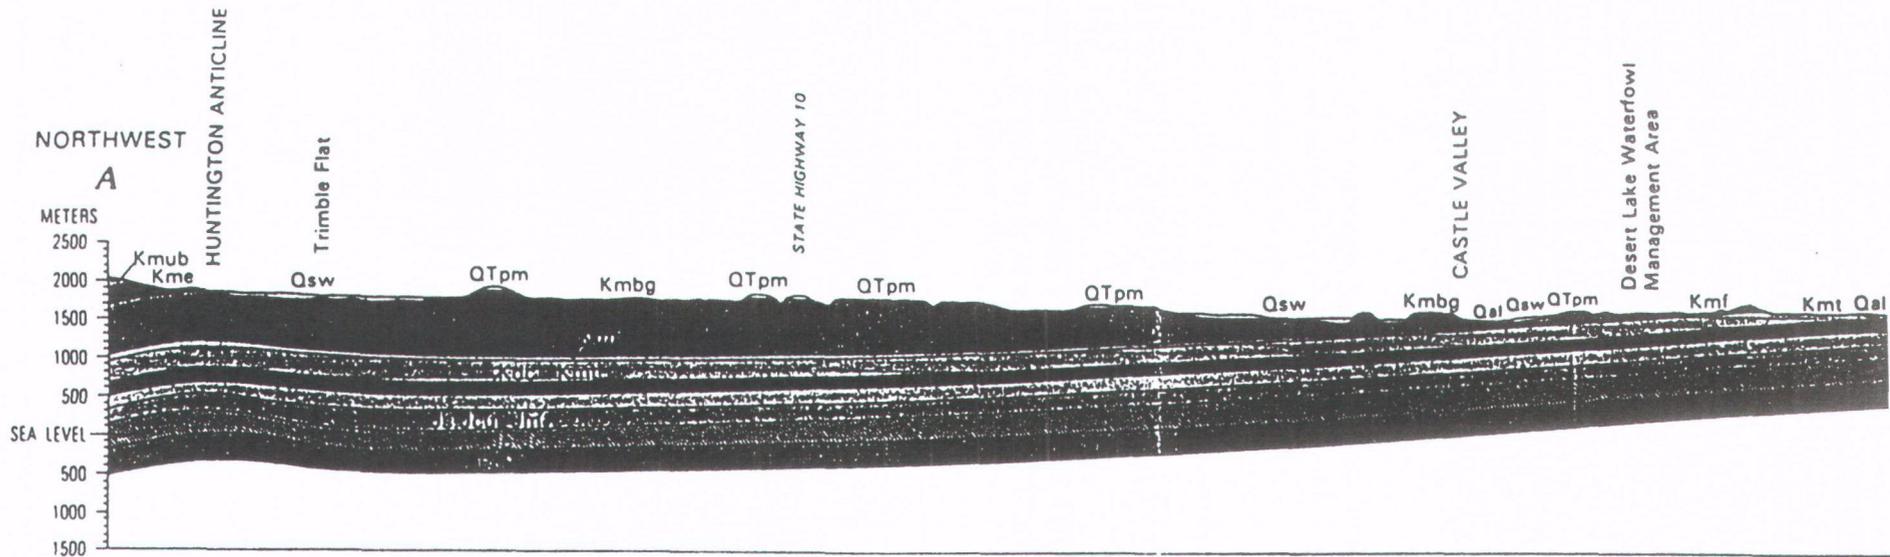

EMERY COUNTY LANDFILL
APPLICATION FOR A PERMIT TO OPERATE A CLASS I LANDFILL

FIGURE B Geological Cross Section of Castle Valley
 Showing Regional Extent of the Blue Gate Member of the Mancos Shale
 From Witkind, 1988.

LEGEND

Bearing: North 67 degrees West

Vertical and Horizontal Scales = 1:100,000

- Qsw Quaternary Sand in washes
- QTpm Quaternary and Late Tertiary Pediment sand and gravel
- Kme Emery Sandstone Member of the Mancos Shale
- Kmbg Blue Gate Member of the Mancos Shale
- Kmf Ferron Sandstone Member of the Mancos Shale

SOUTHERN UTAH UNIVERSITY TESTING LAB
SCIENCE BLDG. - ROOM 206
351 WEST CENTER
CEDAR CITY, UT 84720

SAMPLE NUMBER : K0950492

COST : 103.00

TIME COLLECTED :

DATE COLLECTED : 6-2-95

DATE RECIVED : 2-JUN-1995

DATE COMPLETED : 14-JUN-1995

DATE SENT :

INVOICE NUMBER :

COLLECTOR : C PRAVETTE

SITE LOCATION : E.C.L.1

SEND RESULTS TO : TAHOMA

444 S MAIN SUITE C7
CEDAR CITY, UT 84720

ALL RESULTS IN MILLIGRAMS/LITER (ppm)

ANIONS	CATIONS	CATIONS	GEN PRAM	OXYGEN	CHECKS
--------	---------	---------	----------	--------	--------

339.9 BICAR

1. CO3

* 18781.7 Cl

* 3.40 Fe-T

44200. COND

174.0 Mg

1486.0 HARD

* 0.060 Mn

7.7 PH

< 1.00 OH

84.50 K

308.3 Ca

0.020 Se

* 13110.0 Na

* 38400. TDS

364.4 SO4

< 0.10 NO3/2

NOTES :



State of Utah

DEPARTMENT OF ENVIRONMENTAL QUALITY DIVISION OF SOLID AND HAZARDOUS WASTE

Michael O. Leavitt
Governor

Dianne R. Nielson, Ph.D.
Executive Director

Dennis R. Downs
Director

288 North 1460 West
P.O. Box 144880
Salt Lake City, Utah 84114-4880
(801) 538-6170 Voice
(801) 538-6715 Fax
(801) 536-4414 T.D.D.

February 29, 1996

MAR 0 - 1996

Commissioner Bevan Wilson
Emery County
P. O. Box 629
Castle Dale, Utah 84513

Subject: Emery County Landfill (#9427) Request for Ground Water Monitoring, Liner, and Leachate Collection Exemption

Dear Commissioner Wilson:

The *Utah Solid Waste Permitting and Management Rules* (Rule) require municipal landfills, which receive over 20 tons of solid waste per day, to have a ground water monitoring system and the disposal cells to include a composite liner with a leachate collection system. However, these requirements may be suspended by the Executive Secretary of the Solid and Hazardous Waste Control Board if a demonstration can be made that meets the conditions of Section R315-308-1 and Section R315-303-4(3) of the Rule.

Section R315-308-1. Ground Water Monitoring Requirements

(3) *Ground water monitoring requirements may be suspended by the Executive Secretary if the owner or operator of a solid waste disposal facility can demonstrate that there is no potential for migration of hazardous constituents from the facility to the ground water during the active life of the facility and the post-closure care period. This demonstration must be certified by a qualified ground water scientist and approved by the Executive Secretary, and must be based upon:*

- (a) *site-specific field collected measurements, sampling, and analysis of physical, chemical, and biological processes affecting contaminant fate and transport; and*
- (b) *contaminant fate and transport predictions that maximize contaminant migration and consider impacts on human health and the environment.*

Section R315-303-4(3(c)). Equivalent Design

- (i) *The owner or operator may use, as approved by the Executive Secretary, alternative design, operating practices, and location characteristics which will minimize the migration of solid waste constituents or leachate into the ground or surface water which are at least as effective as the liners of Subsections R315-303-4(3)(a) or (b);*
- (ii) *The owner or operator must demonstrate that the standard of Subsection R315-303-3(1) can be met. The demonstration must be approved by the Executive Secretary, and must be based upon:*
 - (A) *the hydrogeologic characteristics of the facility and the surrounding land;*
 - (B) *the climatic factors of the area;*
 - (C) *the volume and physical and chemical characteristics of the leachate, and*
 - (D) *predictions of contaminate fate and transport in the subsurface that maximize contaminant migration and consider impacts on human health and the environment;*



February 28, 1996

Page 2

The design and operational plan for the Emery County Landfill will be based on the determination of whether or not groundwater monitoring, liner, and leachate collection will be required. Therefore, it would be helpful for the Division to make an early determination of whether the exemption is likely to be approved.

Emery County's consultant, Tahoma Companies, has submitted a request for a exemption from the ground water monitoring, liner, and leachate collection system. Tahoma Companies has also submitted additional supportive information on separate occasions. Attached is the review of the *Response to Request for Additional Information* which was submitted September 26, 1995.

The final determination of the groundwater monitoring suspension and alternative design request can only be made with the issuance of a permit. A permit is issued only after all permit application information has been reviewed, the opportunity for public comment has been presented, and the entire permitting process has been completed. However, based on the initial information submitted, it is anticipated that the Emery County Landfill may be granted a permit that will incorporate the suspension of the groundwater monitoring requirement and the approval of the alternative no liner design. The anticipated approval assumes that no conflicting information becomes evident during the permitting process, and the plan of operation and the closure plan ensure that the development and migration of leachate are minimized.

If you have questions or need further information, please contact Ralph Bohn or Jeff Emmons at 801-538-6170.

Sincerely,



Dennis R. Downs, Director

Division of Solid and Hazardous Waste

enclosure (2)

c: David Cunningham, B.S.N., R.N., Health Officer/Dept. Director, Southeastern Utah District Health Department
David Ariotti, DEQ District Engineer
Rex Funk, Emery County Landfill Manager
Gary Player, Tahoma Companies, Inc.

DRD/JTE/sm

EMERY COUNTY CLASS LANDFILL
REQUEST FOR GROUND WATER MONITORING,
LINER, AND LEACHATE COLLECTION EXEMPTION

REQUEST FOR ADDITIONAL INFORMATION #2

August 25, 1995

To obtain an exemption from ground water monitoring, the owner of the landfill must demonstrate there is no potential for the migration of leachate to ground water. The no potential requirement mandates the use of conservative assumptions in the landfill evaluation. Following is the additional information requested to be included in the demonstration.

HELP MODEL GENERAL COMMENTS

Three model runs were provided in Appendix D of the exemption request. Each of the runs varied in their initial waste moisture content. The model incorporated a design that had a final cover over the waste. The design also used a bottom barrier layer that consisted of ~~52~~ ¹²⁰ inches of mancos shale with a hydraulic conductivity of 1×10^{-3} .

The Help model is designed for evaluation of liquid migration through soils, wastes, and synthetic liners. The HELP model was not designed to evaluate flow through fractured rock. Flow through fractures may be the most important component of flow through the rock.

1. Additional model runs should be made with the waste as the bottom-most layer. A time of travel analysis needs to be provided for the leachate generated.

The model runs should represent the actual or more conservative conditions at the landfill. The model runs should be of sufficient time to determine the equilibrium leachate generation rate. Equilibrium is reached when the water balance for each year is zero or consistently near zero.

Additional computer runs of sufficient years to reach equilibrium need to be submitted.

3. The model runs need to simulate the landfill operation. The model runs need to simulate the number of years the landfill cell is operated without a final cover and the years with a final cover.

4. The data files used in the computer runs, need to be included with the response to the request for additional information.

→ include a diskette with data files on submission

Another model run was conducted to specifically show the effects of freezing of low permeable layer in the landfill cap. The hydraulic conductivity was increased to replicate increased moisture through the cap as a result of frost damage. However, increasing the hydraulic conductivity of the lower permeable layer in the model simulation results in a *uniformly* higher permeability for the material, rather than the cracks and channels that would result from freezing. As stated above, the model can not simulate the preferential flow through cracks and channels.

In summary, the integrity of the low permeable final cover layer must be preserved to minimize infiltration of water. This can only be accomplished by covering the low permeable layer with a soil layer with a thickness that equals or exceeds the depth of penetration of roots, desiccation, and frost. The Utah Department of Transportation (UDOT) has estimated that the maximum frost penetration depth at the landfill site is between 40 and 50 inches. Enclosed is formula used by UDOT to determine maximum frost depth and the map showing frost depth at the Emery County Landfill. It may be useful to use the UDOT formula to determine the site specific maximum frost penetration depth. If the UDOT map is solely used in the design criteria for the landfill cover, 50 inches of cover soil must be provided above the lower permeable soil.

Hydraulic Conductivity of Lower Permeable Cover Layer

The output from the 20-years closed HELP model run was included with the last submittal. The low permeable soil layer (layer 2) consisted of a silty clay (soil type 12) which has a hydraulic conductivity of 4.2×10^{-5} cm/sec. This hydraulic conductivity provides a conservative estimate of leachate generation and is appropriate for computer modeling. However, it needs to be noted that a hydraulic conductivity of 1×10^{-5} cm/sec or less is required in the landfill cover design.

Time of Travel Calculations

The time of travel calculations, included in the submittal, provides an estimate of how long it would take leachate to move through the Mancos Shale and reach first ground water. The time of travel formula uses the percolation rate as an equivalent to hydraulic conductivities. Although these two term are not equivalent, this time of travel measurement appears to be a conservative assumption. Ideally, the unsaturated hydraulic conductivity would be the most appropriate to use in the calculation. The unsaturated hydraulic conductivity, as calculated in the February 26, 1996, submittal, is several orders of magnitude less than the saturated hydraulic conductivity.

February 28, 1996

Page 3

Landfill Equilibrium

The long-term leachate production rate is reached in the landfill model when the change in water storage of the landfill mass stabilizes near zero. The Division incorrectly asked Tahoma Companies to extend the Help model runs until equilibrium is reached or when the water budget balance equals zero. The submitted model run showed the landfill reach the water budget balance of near zero almost immediately. Using the data files contained in the submittal, the closed landfill model run was extended to 25 years. At the end of 25 years the landfill was producing less than 0.019 inches of leachate per year and was approaching equilibrium.

TAHOMA COMPANIES, INCORPORATED ❖ WDBE

444 South Main Street, Suite C-7, Cedar City, Utah 84720 ☎ (801) 865-0131 fax 865-0161

February 26, 1996

Mr. Jeff Emmons
Environmental Scientist
Utah Division of Solid and Hazardous Waste
P.O. Box 144880
Salt Lake City, Utah 84114-4880

FILE COPY

Dear Jeff:

This letter will further clarify our conclusion that there is no potential for migration of hazardous constituents from the Emery County Landfill to ground water during the active life of the landfill and the post-closure care period.

In a letter to Box Elder County dated January 29, 1996, Mr. Phil Burns of the Utah Division of Solid and Hazardous stated that:

“this (leachate) percolation rate is still probably one of the limiting factors in the potential for ground water contamination.”

In our opinion, the leachate percolation rate is the most important limiting factor.

The HELP program simulates daily water movement into, through and out of a landfill. Surface and subsurface processes are modeled. The surface processes modeled are snowmelt, interception of rainfall by vegetation, surface runoff, and evaporation of water, interception and snow from the surface. The subsurface processes modeled are evaporation of water from the soil, plant transpiration, vertical unsaturated drainage, geomembrane liner leakage, and barrier soil liner percolation (not applicable in this case, as no liner was included in model runs), and lateral saturated drainage. In summary, the HELP program considers all sources of water when calculating a percolation rate for the leachate.

Any percolating leachate will descend vertically in unsaturated materials for at least 140 feet, as there are no aquifers present beneath the landfill site in that distance to deflect the flow. Unsaturated hydraulic conductivity in the fractured Mancos Shale underlying the Emery County Landfill has been calculated to be about 15 orders of magnitude less than saturated hydraulic conductivity in the same rocks using equations included in the *Engineering Documentation for Version 3* of the HELP model and in Maidment, ed., 1992. The calculations that substantiate these unsaturated hydraulic conductivity values are attached.

Unsaturated hydraulic conductivity of the naturally occurring soils will determine the rate at which leachate initially moves through the soils. This rate is substantially slower than the percolation of leachate out the bottom of the landfill. Once a partial column of soil becomes saturated with leachate,

the rate of leachate percolation through the natural soils will increase until percolation is limited by the quantity of leachate available. Percolation at the "leachate front" (the lowermost limit of leachate percolation) will then stabilize at a rate intermediate between the saturated and unsaturated hydraulic conductivities of the Mancos Shale.

The actual rate of infiltration into Mancos Shale is difficult to determine, but it will be somewhere between the unsaturated hydraulic conductivity (about 10^{-20} cm/second) and the saturated hydraulic conductivity (about 5×10^{-5} cm/second) of the natural substrate. The HELP model predicts that only enough leachate will be generated by the landfill to provide moisture to the natural soils at the rate of about 4.2×10^{-9} cm/second (equivalent to .05 inches per year), and it is unlikely that leachate will saturate the uniformly layered natural soils any faster than it is generated by the landfill.

Sincerely,



Gary F. Player
Vice President and Principal Geologist

cc: Mr. Rex Funk
Elaine Forbes

K:\CLIENTS\93683-3\CORRES\UNSATHYC.LTR

TAHOMA COMPANIES, INCORPORATED							
for EMERY COUNTY, UTAH		EMERY COUNTY LANDFILL, CASTLE DALE, UTAH					
CALCULATIONS OF UNSATURATED HYDRAULIC CONDUCTIVITY							
REFERENCE: Campbell, G.S., 1974, <i>A Simple Method for Determining Unsaturated Hydraulic Conductivity from Moisture Retention Data</i> , Soil Science, Vol 117, No. 6, pp. 311-314.							
FOR FRACTURED MANCOS SHALE							
ACTUAL SOIL WATER CONTENT = SM =				0.015	VOL/VOL		
RESIDUAL SOIL WATER CONTENT = RS =				0.01	VOL/VOL		
SATURATED WATER CONTENT (POROSITY) = UL =				0.06	VOL/VOL	(EFFECTIVE)	
PORE SIZE DISTRIBUTION INDEX = LAMBDA =				0.165	DIMENSIONLESS		
Ks = SATURATED HYDRAULIC CONDUCTIVITY =				0.00005	CM/SEC	(MEASURED)	
Ku = UNSATURATED HYDRAULIC CONDUCTIVITY							
				$Ku = Ks((SM-RS)/(UL-RS))^{(3+2/LAMBDA)}$			
FOR MANCOS SHALE		Ku =		3.7823E-20	CM/SEC		
FOR SAND:							
ACTUAL SOIL WATER CONTENT = SM =				0.05	VOL/VOL		
RESIDUAL SOIL WATER CONTENT = RS =				0.02	VOL/VOL		
SATURATED WATER CONTENT (POROSITY) = UL =				0.437	VOL/VOL	(EFFECTIVE)	
PORE SIZE DISTRIBUTION INDEX = LAMBDA =				0.694	DIMENSIONLESS		
Ks = SATURATED HYDRAULIC CONDUCTIVITY =				0.03	CM/SEC	(MEASURED)	
Ku = UNSATURATED HYDRAULIC CONDUCTIVITY							
				$Ku = Ks((SM-RS)/(UL-RS))^{(3+2/LAMBDA)}$			
FOR SAND:		Ku =		5.6766E-09	CM/SEC		



STATE OF UTAH
DEPARTMENT OF ENVIRONMENTAL QUALITY
DIVISION OF SOLID AND HAZARDOUS WASTE

Michael O. Leavitt
Governor

Dianne R. Nielson, Ph.D.
Executive Director

Dennis R. Downs
Director

288 North 1460 West
P.O. Box 144880
Salt Lake City, Utah 84114-4880
(801) 538-6170 Voice
(801) 538-6715 Fax
(801) 536-4414 T.D.D.

AUG 30 1995

August 25, 1995

Commissioner Bevan Wilson
Emery County
P. O. Box 629
Castle Dale, Utah 84513

Subject: Emery County Landfill (#9427) Request for Ground Water
Monitoring and Liner Exemption

Dear Commissioner Wilson:

I have reviewed the *Emery County Landfill Request for Exemption from Liner, Leachate Control, and Ground Water Monitoring*, prepared by Tahoma Companies Inc. As with any technical document review, I have some questions. The specific questions are contained in the enclosed *Request For Additional Information #2*. Two copies of the response to the *Request For Additional Information #2*, need to be submitted for review.

Exemptions from groundwater monitoring may be granted for disposal facilities that demonstrate there is no potential for migration of hazardous constituents from the facility to ground water. Exemptions from the use of a landfill liner requires a design which will minimize the migration of solid waste constituents or leachate into the ground water which is as least as effective as the one or more barrier layers with an effective hydraulic conductivity of 1×10^{-7} cm/sec. These requirements mandate the use of conservative assumptions in the exemptions.

I understand the landfill design contained in the *Emery County Landfill Application for a Permit to Operate A Class I Landfill*, will be significantly modified. The modification includes a size reduction of the next landfill cell; the separate construction/demolition waste cell will be eliminated; and the landfill bottom layer of crushed mancos shale will be eliminated. Therefore, references to the submitted application design should be eliminated from the *Request for Exemption from Liner, Leachate Control, and Ground Water Monitoring*. The request for exemptions should be a stand alone document. All the information required to complete the evaluation should be contained in the exemption request.



EMERY COUNTY CLASS LANDFILL
REQUEST FOR GROUND WATER MONITORING,
LINER, AND LEACHATE COLLECTION EXEMPTION
REQUEST FOR ADDITIONAL INFORMATION #2
August 25, 1995

To obtain an exemption from ground water monitoring, the owner of the landfill must demonstrate there is no potential for the migration of leachate to ground water. The no potential requirement mandates the use of conservative assumptions in the landfill evaluation. Following is the additional information requested to be included in the demonstration.

HELP MODEL GENERAL COMMENTS

Three model runs were provided in Appendix D of the exemption request. Each of the runs varied in their initial waste moisture content. The model incorporated a design that had a final cover over the waste. The design also used a bottom barrier layer that consisted of 52 inches of mancos shale with a hydraulic conductivity of 1×10^{-3} . 120

The Help model is designed for evaluation of liquid migration through soils, wastes, and synthetic liners. The HELP model was not designed to evaluate flow through fractured rock. Flow through fractures may be the most important component of flow through the rock.

1. Additional model runs should be made with the waste as the bottom-most layer. A time of travel analysis needs to be provided for the leachate generated.

The model runs should represent the actual or more conservative conditions at the landfill. The model runs should be of sufficient time to determine the equilibrium leachate generation rate. Equilibrium is reached when the water balance for each year is zero or consistently near zero.

*> 10 years open
10 years capped*

Additional computer runs of sufficient years to reach equilibrium need to be submitted.

3. The model runs need to simulate the landfill operation. The model runs need to simulate the number of years the landfill cell is operated without a final cover and the years with a final cover.
4. The data files used in the computer runs, need to be included with the response to the request for additional information.

→ include a diskette with data files on submission

→ the frost penetration depth is 40"
depth of two to four feet. The plant roots under the current design could penetrate the clay barrier and drastically reduce its ability to retard moisture from entering the landfill. Channeling due to root penetration can be accounted in the model by selecting different soil textures or by selecting different default soil textures. Default soil textures result in the root channeling adjustments for only the top half of the evaporative zone. Increasing the thickness of the cover materials can also ensure the integrity of the cap.

Two other climatic conditions may jeopardize the integrity of the clay cover. The frost depth and the evapotranspiration depth on-site may increase the moisture flow through the clay barrier.

8. The landfill cover design needs to address the concerns of root depth, frost depth, and evapotranspiration depth. If a different cap design is needed, it should be reflected in the data files.
9. For each layer in the landfill design, a discussion needs to be provided for each data input selected. Those inputs include:
- * Layer Classification (Vertical percolation, Lateral drainage, barrier soil/liners)
 - * Soil texture number, total porosity, field capacity, wilting point, initial moisture

DEPTH TO GROUND WATER

Page 9 of the exemption request states:

A few drops of vadose zone water were encountered in drill cuttings at about 140 feet BGL. A small amount of this water (less than 10 gallons) accumulated in the boring over night after the hole had been advanced to 180 feet on May 30, 1995.

Section 301-2(27) defines ground water as subsurface water which is in the zone of saturation including perched ground water. Saturated zones will release water to a bore hole.

Discuss to that upper zone drain overnight

10. What is the rationale for assuming the water encountered at 140 feet is vadose zone water?

MANCOS SHALE AS A LEACHATE MIGRATION BARRIER

The exemption request summary and conclusion states on page 18:

The Emery County Landfill site has a safe natural setting that would protect ground water in the unlikely event of leachate generation. Relatively impermeable shales under the site are more than 3,000 feet thick.

The only site specific measurements were the fracture porosity and hydraulic conductivity at the surface of the mancos shale. The resulting fracture porosity of 4% and a hydraulic conductivity of 1×10^{-3} cm/s are expected to be representative of the shale at increased depths. The exemption request also refers to a published report by David Snow.

drop this out as not representative

minimize the migration of solid waste constituents or leachate into the ground or surface water..... are at least as effective as the liners.

.....[ground water monitoring may be suspended if there is] no potential for migration of hazardous constituents from the facility to ground water during the active life of the facility and post-closure care period.

In summary, to make the above demonstrations, the exemption requests needs to provide the following:

- * Additional HELP Model simulations which incorporate different assumptions and which provide expanded discussions of the rational for selecting the model input data.
- * Additional site specific data or other documentation to support the assumption that the mancos shale underlying the landfill will protect groundwater. The documentation needs to include time of travel calculation for the migration of the leachate generated.

F:\SHW\SPBUEMMONS\WPEMERYC\RA1#2
File: Emery County Class I Landfill #9427

APPENDIX F

location
Stan

TAHOMA COMPANIES, INCORPORATED. WDBE
444 S. MAIN STREET, SUITE C-7
CEDAR CITY, UTAH 84720
(801) 865 0131 FAX (801) 865 0161

April 5, 1994

Mr. Tom Gnojek
U.S. Bureau of Land Management
San Rafael River Resource Area
900 North 700 East
Price, Utah 84501

Dear Mr. Gnojek:

Thank you for your useful advice on wilderness and recreation land issues associated with landfill licensing given in our telephone conversation of Tuesday morning, April 5, 1994.


You and I briefly discussed the Emery County Landfill (ECL) near Castle Dale, Utah. The ECL is located on the western edge of Wilberg Flat in section 16, T. 18 S., R. 8 E., SLB&M. The landfill has been operating since 1984, but must now be licensed under new state regulations effective September, 1993. The area to be licensed is within a fenced, disturbed area, adjacent to an operating landfill cell.

You informed me that the ECL is not located within a designated wilderness or wilderness study area. You also assured me that the only wilderness or WSA in Emery County is east of Highway 10.

It is our opinion that the ECL will not impact wilderness or recreation areas.

Thanks again for the prompt advice from your agency. Tahoma Companies will soon be involved in license applications for several other Utah landfills. It is nice to know where we can get help on wilderness area issues so readily.

Sincerely,



Gary F. Player
Principal Geologist

TAHOMA COMPANIES, INCORPORATED WDBE
444 S. MAIN STREET, SUITE C-7
CEDAR CITY, UTAH 84720
(801) 865 0131 FAX (801) 865 0161

Emery
location
Stam

March 31, 1994

USFW 524 5001

Mr. Robert Williams
U.S. Fish and Wildlife Service
2060 Administration Building
1745 West 1700 South
Salt Lake City, Utah 84104

Dear Mr. Williams:

Please thank Mr. Clark D. Johnson for his useful advice on Threatened and Endangered Species issues associated with landfill licensing given on Tuesday afternoon, March 29, 1994. At his suggestion, I have reviewed the USFWS list of Endangered, Threatened and Candidate Species in Utah by Latilong Block, dated September 24, 1992.

Clark and I briefly discussed the Emery County Landfill (ECL) near Castle Dale, Utah. The ECL is located on the western edge of Wilberg Flat in section 16, T. 18 S., R. 8 E., SLB&M. The landfill has been operating since 1984, but must now be licensed under new state regulations effective September, 1993. The area to be licensed is within a fenced, disturbed area, adjacent to an operating landfill cell.

Mr. Johnson informed me that the ECL is not located within a designated Critical Habitat Zone for any terrestrial species. He assured me that the only critical habitat officially recognized in Emery County is aquatic habitat identified for the Colorado River squawfish and the associated native fish community in most drainages of the Colorado, Green and San Juan river basins.

It is our opinion that the ECL will not impact aquatic habitats for the following reasons:

- (1) The lands have been previously disturbed by old landfill operations; and
- (2) No water courses or impoundments occur on the property.

At Mr. Clark's suggestion, I also contacted Mr. Larry England of your staff for further information on endangered, threatened and candidate plant species in Emery County. He (Mr. England) told me that critical habitat for listed or candidate plant species is not present at the Emery County Landfill.

Thanks again for the prompt advice from your agency personnel. Tahoma Companies will soon be involved in license applications on several other Utah landfills. It is nice to know where we can get help on biological issues so readily.

Sincerely,



Gary F. Player
Principal Geologist

Enclosure: Topographic Map of Emery County Landfill site.

File:TT&A\license\usfwsltr

TAHOMACOMPANIES, INCORPORATED WDBE
444 S. MAIN STREET, SUITE C-7
CEDAR CITY, UTAH 84720
(801) 865 0131 FAX (801) 865 0161

Emery
location
Stand

March 30, 1994

Mr. Kyle "Jake" Jacobson
Utah Department of Agriculture
350 North Redwood Road
Salt Lake City, Utah 84116


Dear Jake:

Thank you for our beneficial discussion of Important Farmland issues associated with landfill licensing yesterday afternoon. At your suggestion, I have reviewed Utah Agricultural Experiment Station Research Report Number 76, "Important Farmlands of parts of Carbon, Emery, Grand and Sevier Counties." I have concluded that no classified "Important Farmlands" are present at the Emery County Landfill.

We briefly discussed the Emery County Landfill (ECL) near Castle Dale, Utah. The ECL is located on the western edge of Wilberg Flat in section 16, T. 18 S., R. 8 E., SLB&M. The landfill has been operating since 1984, but must now be licensed under new state regulations effective September, 1993. The area to be licensed is within a fenced, disturbed area, adjacent to an operating landfill cell.

Thank you again for a very productive meeting.

Sincerely,



Gary F. Player
Principal Geologist

Enclosure: Topographic Map of Emery County Landfill site.

File:TT8A\license\udagltr



State of Utah

Department of Community & Economic Development
Division of State History
Utah State Historical Society



Michael O. Leavitt
Governor
Max J. Evans
Director

300 Rio Grande
Salt Lake City, Utah 84101-1182
(801) 533-3500
FAX: (801) 533-3503

April 12, 1994

Gary F. Player
Principal Geologist
Tahoma Companies, Incorporated WDBE
444 South Main Street, Suite C-7
Cedar City, Utah 84720

RE: Emery County Landfill (ECL)

In Reply Please Refer to Case No. 94-0450

Dear Mr. Player:

The Utah State Historical Preservation Office received the above referenced project on April 4, 1994. After review of the material provided, the Utah Preservation Office recommends that there would be No Effect upon cultural resources by the project.

If you have questions, please contact me at (801) 533-3555.

Sincerely,

Janice Reed Campbell
James L. Dykmann
for Compliance Archaeologist

JLD:94-0450 OR/NP/NE

TAHOMA COMPANIES, INCORPORATED WDBE
444 S. MAIN STREET, SUITE C-7
CEDAR CITY, UTAH 84720
(801) 865 0131 FAX (801) 865 0161

Emer.
licenc
locat
- Stan

March 30, 1994

Mr. Jim Dykmann
Compliance Archaeologist
Utah Division of State History
300 Rio Grande
Salt Lake City, Utah 84101-1182

Dear Jim:

Thank you for our beneficial discussion of archaeological issues associated with landfills this morning. At your suggestion, I am requesting a consultation with your Division for the Emery County Landfill (ECL) near Castle Dale, Utah.

The ECL is located on the western edge of Wilberg Flat in section 16, T. 18 S., R. 8 E., SLB&M. The landfill has been operating since 1984, but must now be licensed under new state regulations effective September, 1993. The area to be licensed is within a fenced, disturbed area, adjacent to an operating landfill cell.

It is my opinion that this area will not require a field site archaeological clearance for the following reasons:

- (1) The lands have been disturbed by old landfill operations;
- (2) No water courses or impoundments occur on the property;
and
- (3) No registered Historic Places have been identified within a mile of the landfill site.

I look forward to your comments on this site.

Sincerely,



Gary F. Player
Principal Geologist

Enclosure: Topographic Map of Emery County Landfill site.

File:TT&A\license\shpolet

TAHOMA COMPANIES, INCORPORATED
444 S. MAIN STREET, SUITE C-7
CEDAR CITY, UTAH 84720
(801) 865 0131 FAX (801) 865 0161

April 11, 1944

Mr. Dave Rodda
Aviation Safety Inspector
Federal Aviation Agency
116 N 2400 W
Salt Lake City, Utah 84116

Dear Mr. Rodda:

Thanks for your help in our efforts to obtain a license for the Emery County Landfill under new Utah state regulations. We spoke on the telephone a couple of weeks ago.

You and I briefly discussed the Emery County Landfill (ECL) near Castle Dale, Utah. The ECL is located on the western edge of Wilberg Flat in section 16, T. 18 S., R. 8 E., SLB&M. The landfill has been operating since 1984, but must now be licensed under new state regulations effective September, 1993. The area to be licensed is within a fenced, disturbed area, adjacent to an operating landfill cell.

After I told you the location of the landfill you provided me with the following information:

The facility is not within ten thousand feet of any airport runway end used by turbojet aircraft or within 5,000 feet of any airport runway end used only by piston-type aircraft. The northeast end of an unimproved dirt landing strip on Danish Bench is 5,000 feet southeast from the currently operating cell of the landfill. The following is known about the dirt strip:

- (1) The dirt landing strip is not listed by the FAA as either a public or a private airport; and
- (2) The dirt strip is not shown on current editions of the Las Vegas and Denver Sectional Aeronautical Charts published by the Federal Aviation Agency.

In Tahoma's opinion the dirt ~~strip~~ landing strip has been abandoned.

o o o


Thanks again for the prompt advice from your agency. Tahoma Companies will soon be involved in license applications for several other Utah landfills. It is nice to know where we can get help on aviation issues so readily.

Sincerely,

Gary Farnsworth Player
Principal Geologist
Registered California Geologist No. 4984
file:TTBA\license\faalet


APPENDIX G

APPENDIX G

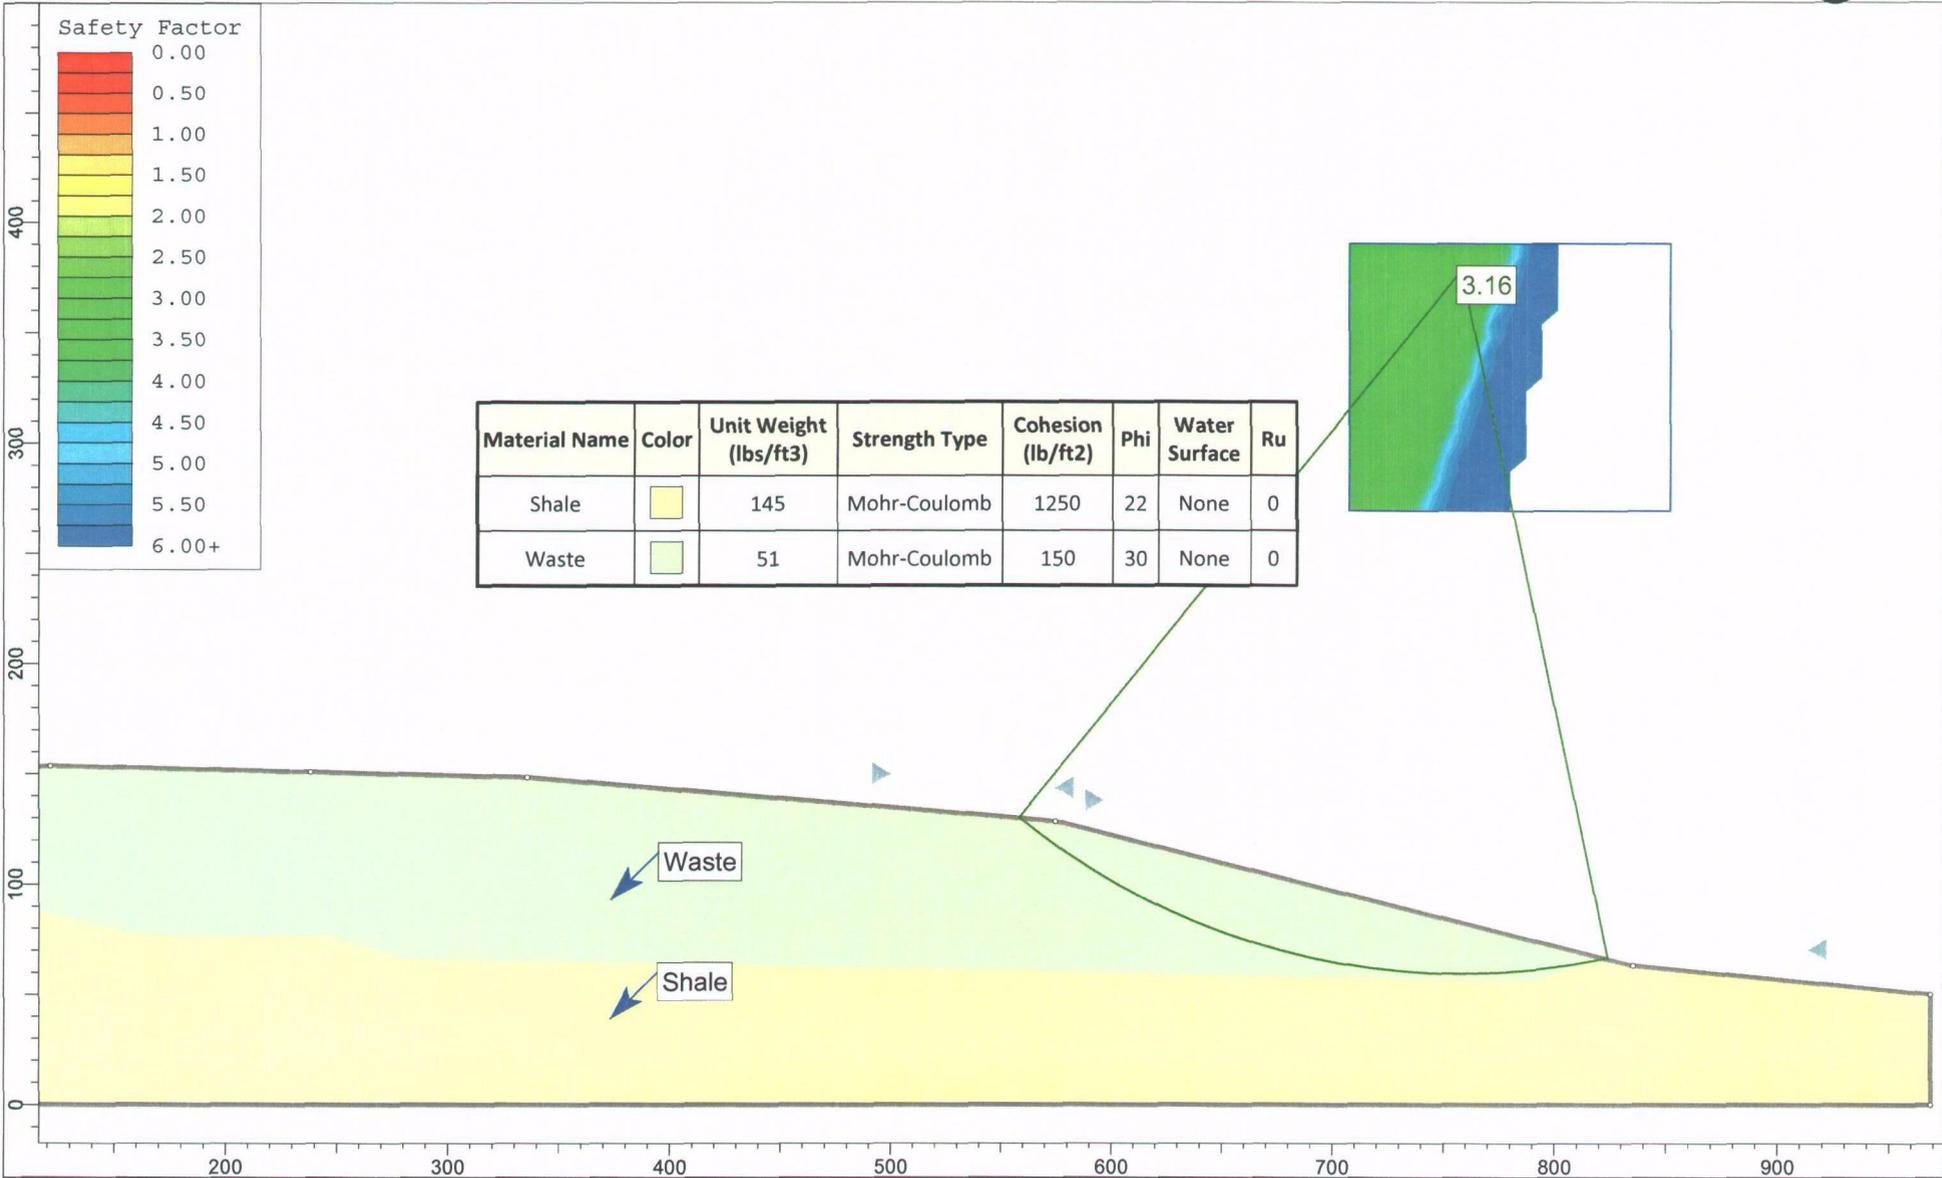


SLIDEINTERPRET 6.012

Project				Emery County Landfill - Profile 2			
Analysis Description				Static			
Drawn By		JMG		Scale		1:1000	
Date		6/17/2011, 3:44:49 PM		Company		IGES, Inc	
				File Name		Profile_2static.slm	

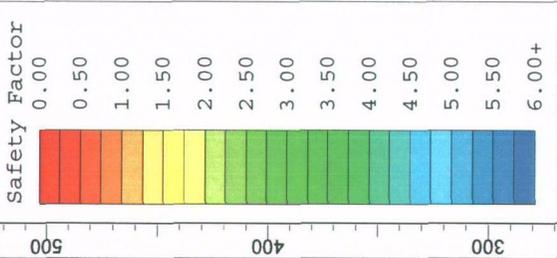

Material Name	Color	Unit Weight (lbs/ft ³)	Strength Type	Cohesion (lb/ft ²)	Phi	Water Surface	Ru
Shale		145	Mohr-Coulomb	1250	22	None	0
Waste		51	Mohr-Coulomb	120	25	None	0

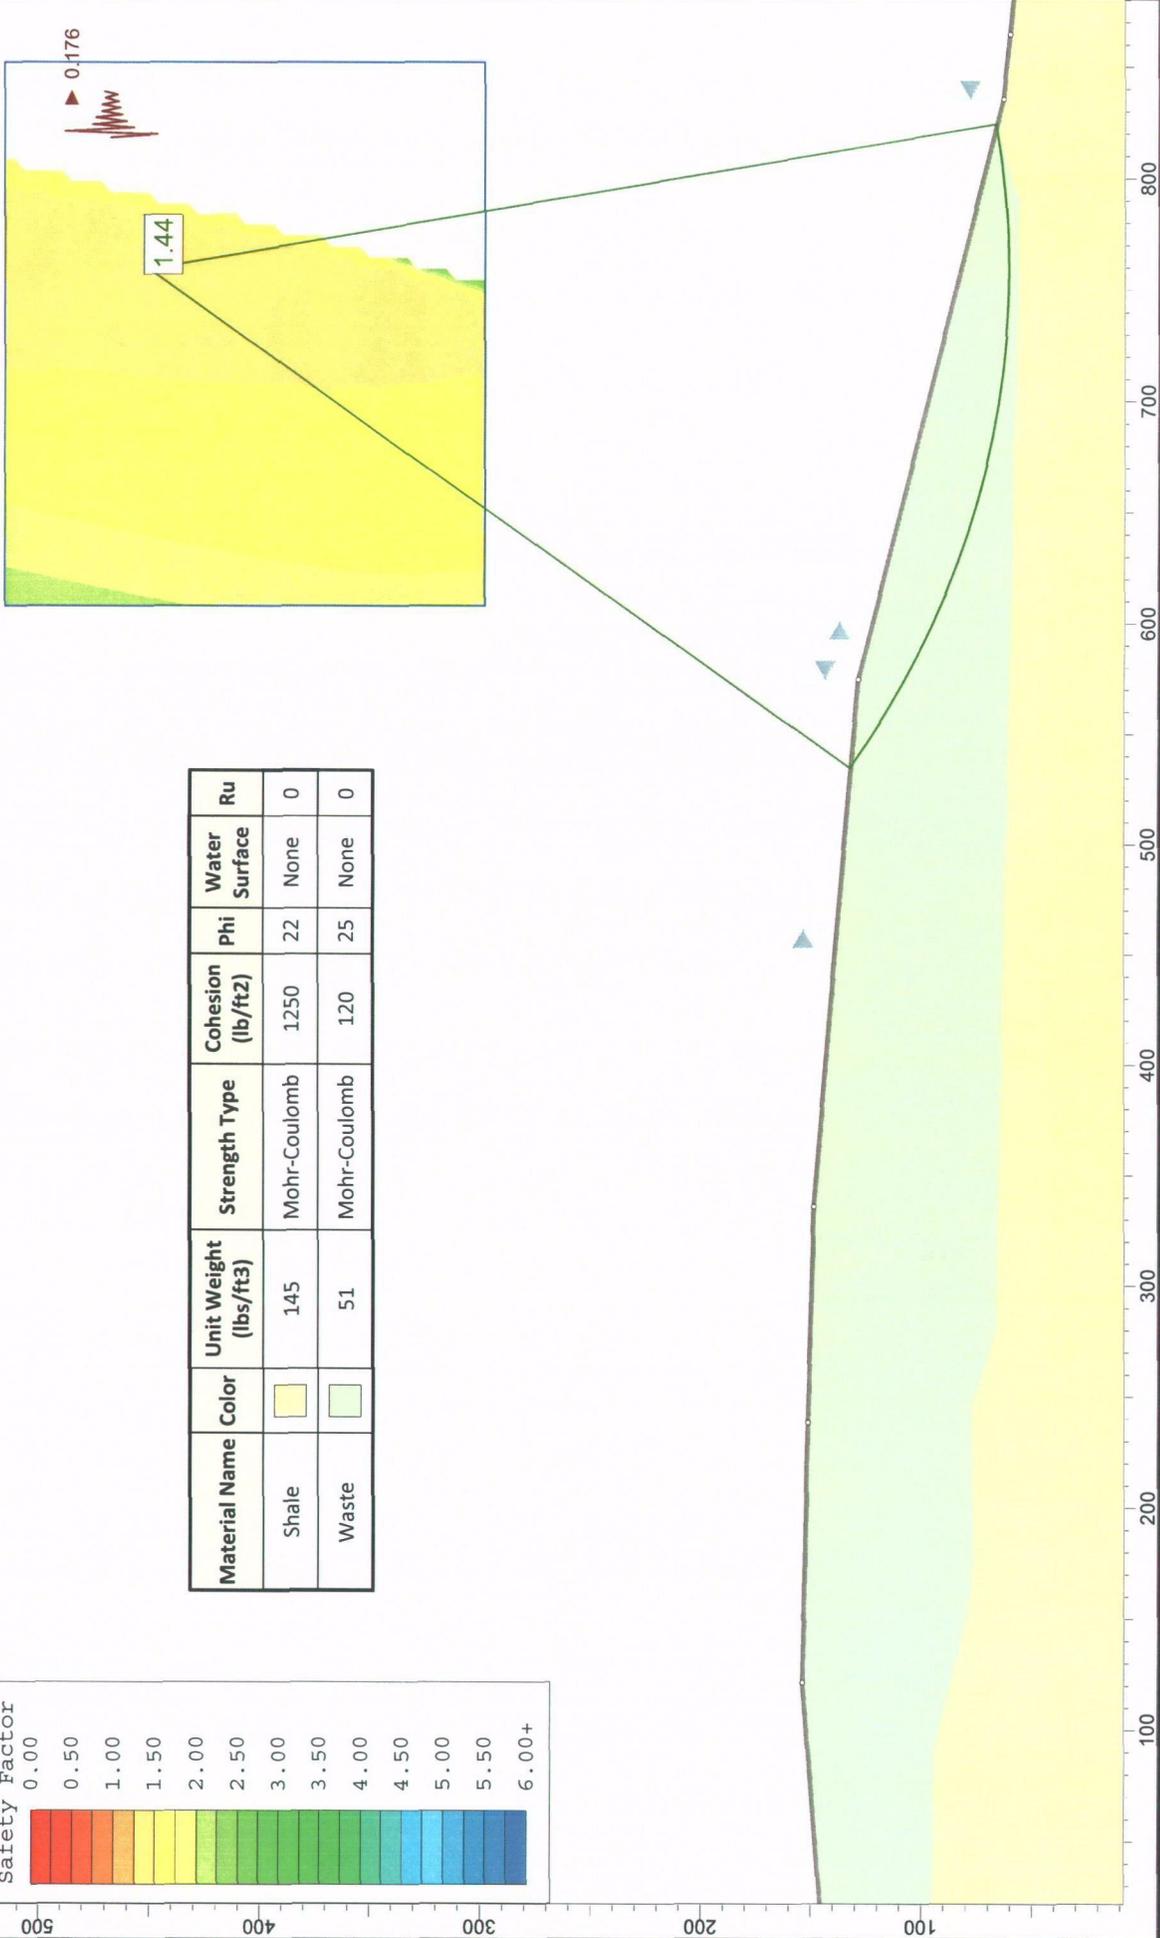




SLIDEINTERPRET 6.012

Project Emery County Landfill - Profile 2


Analysis Description Seismic

Drawn By JMG **Scale** 1:1000 **Company** IGES, Inc


Date 6/17/2011, 3:44:49 PM **File Name** Profile_2 seismic.slim

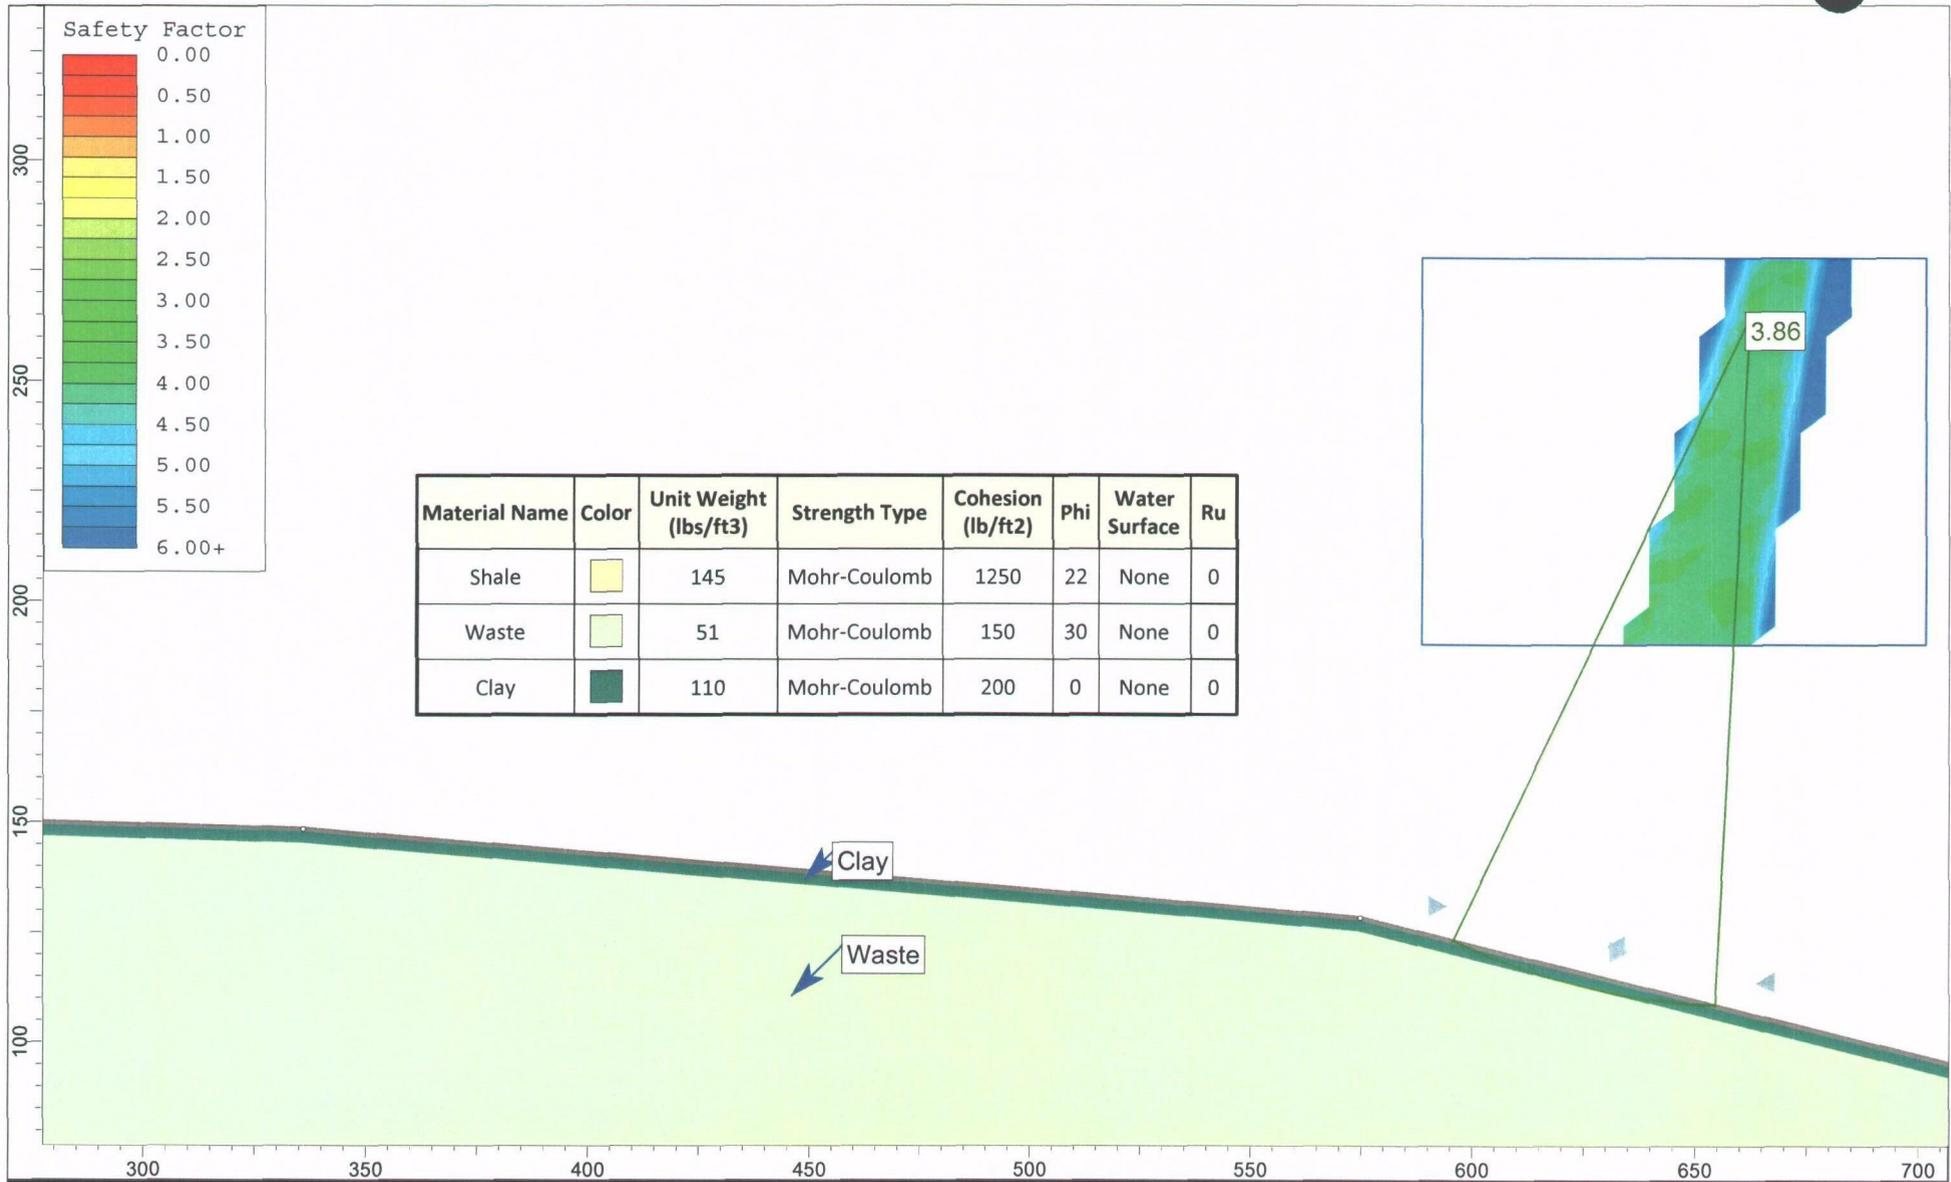

Material Name	Color	Unit Weight (lbs/ft ³)	Strength Type	Cohesion (lb/ft ²)	Phi	Water Surface	Ru
Shale		145	Mohr-Coulomb	1250	22	None	0
Waste		51	Mohr-Coulomb	150	30	None	0
Clay		110	Mohr-Coulomb	200	0	None	0

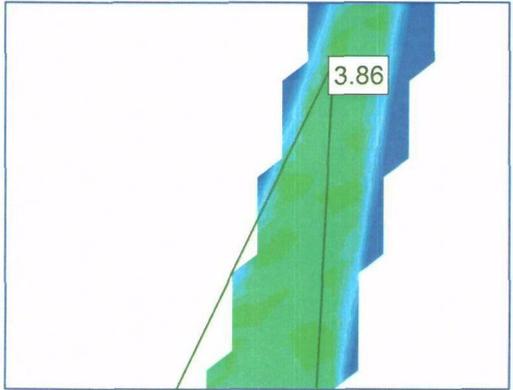

Project				Emery County Landfill - Profile 2			
Analysis Description				Static - Clay Landfill Cap			
Drawn By		JMG		Scale		1:500	
Date		6/17/2011, 3:44:49 PM		Company		IGES, Inc	
				File Name		Profile_2static cap stability.slim	

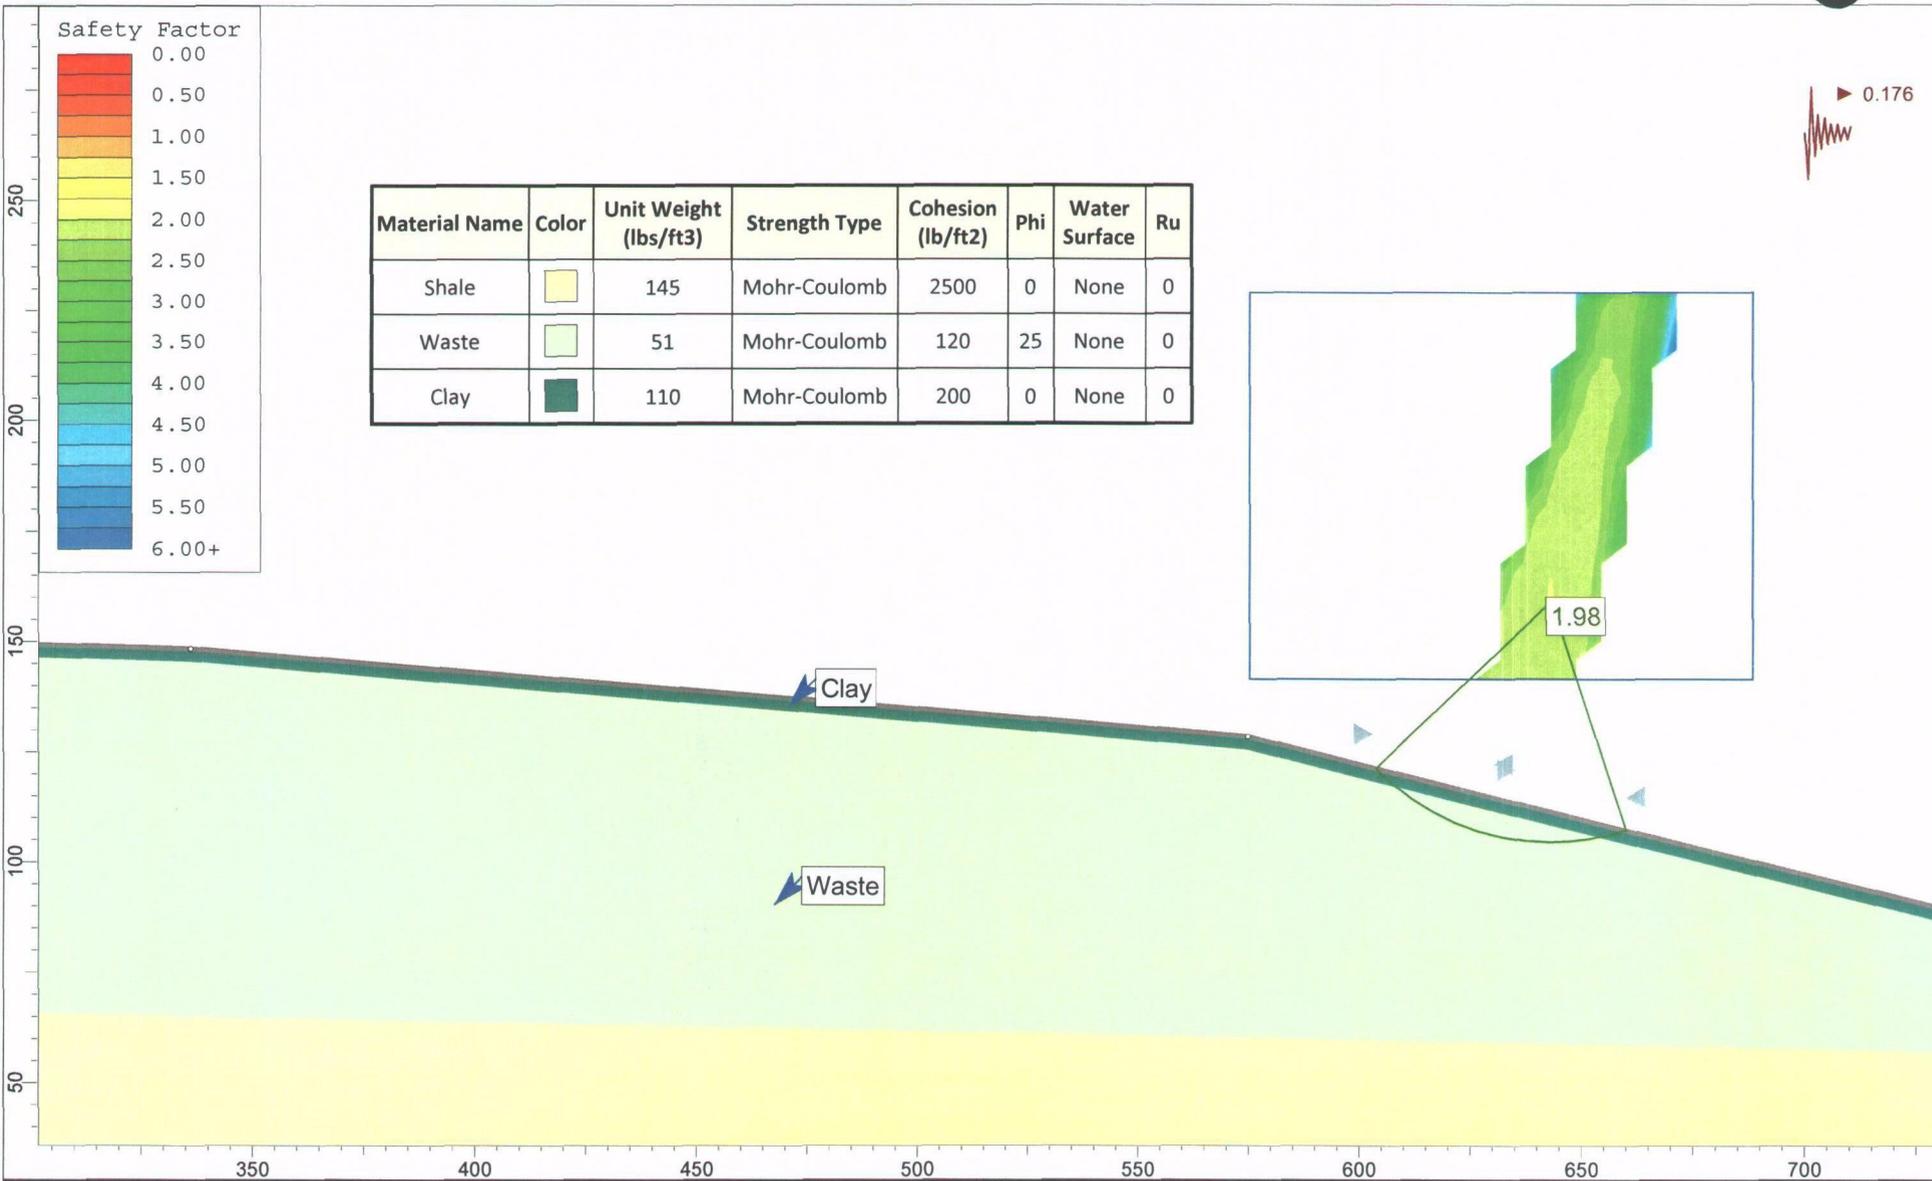

Material Name	Color	Unit Weight (lbs/ft3)	Strength Type	Cohesion (lb/ft2)	Phi	Water Surface	Ru
Shale		145	Mohr-Coulomb	2500	0	None	0
Waste		51	Mohr-Coulomb	120	25	None	0
Clay		110	Mohr-Coulomb	200	0	None	0

SLIDEINTERPRET 6.012

Project				Emery County Landfill - Profile 2			
Analysis Description				Seismic - Clay Landfill Cap			
Drawn By	JMG	Scale	1:500	Company	IGES, Inc		
Date	6/17/2011, 3:44:49 PM			File Name	Profile_2seismic cap stability.slim		


APPENDIX H

SUMMARY OF LABORATORY TEST RESULTS

Emery County Landfill Permit and Final Cover - 2003

Sample	Classification	Max. DD	OPT. %M	LL	PI	% - 200 Sieve	% -No. 4	Field Cap.	Wilting Pt.	Permeability
Cover No. 1	CL w/ Sand	125.4	11.5	32	19	58.9	72.3	35.5	17	7.90E-08
Liner No. 1	CL w/ Sand	122	12	28	10	62.5	94.9			2.38E-06
Liner No. 2	CL w/ Sand	121.5	12	27	9	63	94.9			1.29E-07
Borrow No. 1 (Southwest Borrow Slope - 1/14/03)	Shale	126.1	11.3	34	15			37.8	17.9	
Borrow No. 2 (Existing Stockpile 1/14/03)	Shale	124.5	11.2	31	14			34.4	16.9	
Borrow No. 3 (South Central Borrow Slope - 1/14/03)	Shale	125.4	11.6	36	16			37.2	19.3	
Borrow No. 4 (Excavation for Cells 5 through 7)	Shale	127.8	9.8	29	12			30.5	13.2	
AVERAGE	ALL							35.1	16.9	

Moisture Content with Depth		
Sample	Depth	% Moisture
TP-1 (ponded area)		
TP-1	3	11.3
TP-1	6	10.5
TP-1	9	11.4
TP-1	12	10.9
TP-1	15	6.3
TP-1	18	6.3
TP-1	21	6.1
TP-1	24	5.2
TP-2 (native area)		
TP-2	0	8.8
TP-2	3	8.7
TP-2	6	8.4
TP-2	9	7.2
TP-2	12	5.6
TP-2	15	5.2
TP-2	18	4.6
TP-2	21	5.3
TP-2	24	5.3

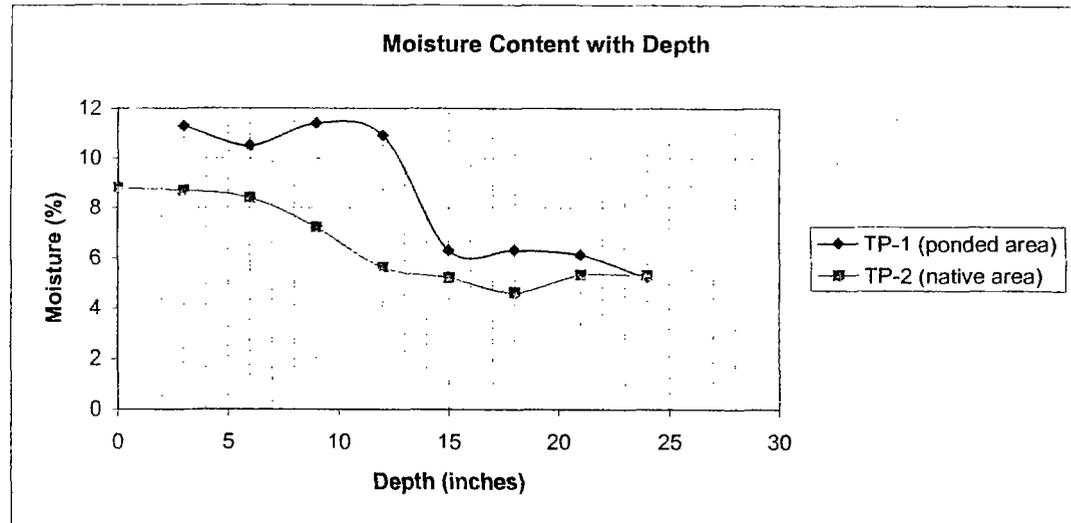

APPENDIX I

Annual cycle of precipitation-evapotranspiration-storage for Emery County Landfill (1980 x 3)

Average Annual ave Precip total = 45.14 8.4 inches (average annual over last 100 years)
 Average Annual Evapo-Transpiration = 45.14 4.5 inches (including sublimation)
 Field Capacity of Cover Soil = 35.1 % (Moisture Content in Percent of Volume)
 Wilting Point of Soil = 16.9 % (Moisture Content in Percent of Volume)
 Runoff = 0 % (Percent of Precipitation)
 Initial Moisture Content of Cover Soil = 20 % (Percent of Volume)
 Thickness of Cover Soil = 24 inches
 Penman-Wilson ET Reduction = 0.6 (fraction of total potential evapo-transpiration expressed as actual soil evaporation)
 Maximum Storage Capacity of Cover Soil = 4.37 inches ((field capacity - wilting point) * layer thickness)
 Initial Storage Capacity = 3.62 inches

YEAR	Day of the Year	Available Storage Capacity (in.)	Daily Precipitation (in.)	Daily Infiltration (in.)	Daily ET (in.)	Actual ET (in.)	Change in Storage (in.)	Ending Storage (in.)	Percolation	Sum of Yearly Percolation (in.)
1980	1	3.62	0	0.00	0.0130	0.01	0.01	3.63	none	1 0.00
	2	3.63	0	0.00	0.0165	0.01	0.01	3.64	none	2 0.00
	3	3.64	0	0.00	0.0173	0.01	0.01	3.65	none	3 0.00
	4	3.65	0	0.00	0.0102	0.01	0.01	3.66	none	
	5	3.66	0	0.00	0.0102	0.01	0.01	3.66	none	
	6	3.66	0	0.00	0.0106	0.01	0.01	3.67	none	
	7	3.67	0	0.00	0.0240	0.01	0.01	3.69	none	
	8	3.69	0	0.00	0.0319	0.02	0.02	3.70	none	
	9	3.70	0	0.00	0.0400	0.02	0.02	3.73	none	
	10	3.73	0.27	0.27	0.0331	0.02	-0.25	3.48	none	
	11	3.48	0.06	0.06	0.0343	0.02	-0.04	3.44	none	
	12	3.44	0.16	0.16	0.0130	0.01	-0.17	3.27	none	
	13	3.27	0.13	0.13	0.0193	0.01	-0.12	3.15	none	
	14	3.15	0.02	0.02	0.0244	0.01	-0.01	3.14	none	
	15	3.14	0	0.00	0.0370	0.02	0.02	3.17	none	
	16	3.17	0	0.00	0.0390	0.02	0.02	3.19	none	
	17	3.19	0	0.00	0.0197	0.01	0.01	3.20	none	
	18	3.20	0.69	0.69	0.0232	0.01	-0.68	2.52	none	
	19	2.52	0.39	0.39	0.0327	0.02	-0.37	2.15	none	
	20	2.15	0	0.00	0.0307	0.02	0.02	2.17	none	
	21	2.17	0	0.00	0.0323	0.02	0.02	2.19	none	
	22	2.19	0	0.00	0.0339	0.02	0.02	2.21	none	
	23	2.21	0	0.00	0.0303	0.02	0.02	2.23	none	
	24	2.23	0	0.00	0.0297	0.02	0.02	2.25	none	
	25	2.25	0	0.00	0.0354	0.02	0.02	2.27	none	
	26	2.27	0	0.00	0.0452	0.02	0.02	2.29	none	
	27	2.29	0	0.00	0.0409	0.02	0.02	2.32	none	
	28	2.32	0	0.00	0.0406	0.02	0.02	2.34	none	
	29	2.34	0.51	0.51	0.0256	0.02	-0.49	1.85	none	
	30	1.85	0.19	0.19	0.0425	0.03	-0.16	1.68	none	
	31	1.68	0	0.00	0.0291	0.02	0.02	1.70	none	
	32	1.70	0	0.00	0.0343	0.02	0.02	1.72	none	
	33	1.72	0	0.00	0.0359	0.02	0.02	1.74	none	
	34	1.74	0	0.00	0.0378	0.02	0.02	1.77	none	
	35	1.77	0	0.00	0.0382	0.02	0.02	1.79	none	
	36	1.79	0	0.00	0.0405	0.03	0.03	1.82	none	
	37	1.82	0	0.00	0.0406	0.02	0.02	1.84	none	
	38	1.84	0	0.00	0.0421	0.03	0.03	1.87	none	
	39	1.87	0	0.00	0.0327	0.02	0.02	1.89	none	
	40	1.89	0	0.00	0.0335	0.02	0.02	1.91	none	
	41	1.91	0	0.00	0.0339	0.02	0.02	1.93	none	
	42	1.93	0	0.00	0.0315	0.02	0.02	1.95	none	
	43	1.95	0	0.00	0.0306	0.02	0.02	1.97	none	
	44	1.97	0	0.00	0.0390	0.02	0.02	1.99	none	
	45	1.99	0.08	0.08	0.0441	0.03	-0.05	1.94	none	
	46	1.94	0.36	0.36	0.0272	0.02	-0.34	1.60	none	
	47	1.60	0.02	0.02	0.0449	0.03	0.01	1.60	none	
	48	1.60	0.14	0.14	0.0539	0.03	-0.11	1.50	none	
	49	1.50	0.1	0.10	0.0420	0.03	-0.07	1.42	none	
	50	1.42	0.43	0.43	0.0697	0.04	-0.39	1.03	none	
	51	1.03	0.36	0.36	0.0306	0.02	-0.34	0.70	none	
	52	0.70	0.05	0.05	0.0543	0.03	-0.02	0.68	none	
	53	0.68	0.24	0.24	0.0280	0.02	-0.22	0.46	none	
	54	0.46	0.02	0.02	0.0610	0.04	0.02	0.47	none	
	55	0.47	0	0.00	0.0518	0.03	0.03	0.50	none	
	56	0.50	0	0.00	0.0539	0.03	0.03	0.54	none	
	57	0.54	0	0.00	0.0507	0.04	0.04	0.57	none	
	58	0.57	0	0.00	0.0701	0.04	0.04	0.61	none	
	59	0.61	0	0.00	0.0752	0.05	0.05	0.66	none	
	60	0.66	0	0.00	0.0732	0.04	0.04	0.70	none	
	61	0.70	0	0.00	0.0654	0.04	0.04	0.74	none	
	62	0.74	0	0.00	0.0685	0.04	0.04	0.78	none	
	63	0.78	0	0.00	0.0681	0.04	0.04	0.82	none	
	64	0.82	0	0.00	0.0697	0.04	0.04	0.86	none	
	65	0.86	0	0.00	0.0713	0.04	0.04	0.91	none	
	66	0.91	0.02	0.02	0.0646	0.04	0.02	0.93	none	
	67	0.93	0.93	0.93	0.0520	0.03	-0.90	0.03	none	
	68	0.03	0	0.00	0.0921	0.06	0.06	0.08	none	
	69	0.08	0	0.00	0.0669	0.04	0.04	0.12	none	
	70	0.12	0	0.00	0.0534	0.04	0.04	0.16	none	
	71	0.16	0.08	0.08	0.0728	0.04	-0.04	0.12	none	
	72	0.12	0	0.00	0.0699	0.04	0.04	0.17	none	
	73	0.17	0	0.00	0.0512	0.03	0.03	0.20	none	
	74	0.20	0	0.00	0.0799	0.05	0.05	0.24	none	
	75	0.24	0	0.00	0.0929	0.06	0.06	0.30	none	
	76	0.30	0	0.00	0.1020	0.06	0.06	0.36	none	
	77	0.36	0	0.00	0.0457	0.03	0.03	0.39	none	
	78	0.39	0	0.00	0.0657	0.04	0.04	0.43	none	
	79	0.43	0	0.00	0.0803	0.05	0.05	0.48	none	
	80	0.48	0	0.00	0.0894	0.05	0.05	0.53	none	
	81	0.53	0	0.00	0.0972	0.06	0.06	0.59	none	
	82	0.59	0	0.00	0.0892	0.05	0.05	0.64	none	
	83	0.64	0.15	0.15	0.0583	0.03	-0.12	0.53	none	
	84	0.53	0	0.00	0.0645	0.05	0.05	0.58	none	

85	0.58	0.02	0.02	0.0732	0.04	0.02	0.60	none
86	0.60	0	0.00	0.0657	0.04	0.04	0.64	none
87	0.64	0	0.00	0.0717	0.04	0.04	0.68	none
88	0.68	0	0.00	0.0780	0.05	0.05	0.73	none
89	0.73	0	0.00	0.0772	0.05	0.05	0.78	none
90	0.78	0	0.00	0.0874	0.05	0.05	0.83	none
91	0.83	0	0.00	0.0654	0.04	0.04	0.87	none
92	0.87	0.03	0.03	0.0492	0.03	0.00	0.87	none
93	0.87	0	0.00	0.0736	0.04	0.04	0.91	none
94	0.91	0	0.00	0.0783	0.05	0.05	0.96	none
95	0.96	0	0.00	0.0839	0.05	0.05	1.01	none
96	1.01	0	0.00	0.1138	0.07	0.07	1.08	none
97	1.08	0	0.00	0.1287	0.08	0.08	1.15	none
98	1.15	0	0.00	0.1161	0.07	0.07	1.22	none
99	1.22	0	0.00	0.0732	0.04	0.04	1.27	none
100	1.27	0	0.00	0.1079	0.06	0.06	1.33	none
101	1.33	0	0.00	0.1413	0.08	0.08	1.42	none
102	1.42	0	0.00	0.1122	0.07	0.07	1.49	none
103	1.49	0	0.00	0.0905	0.05	0.05	1.54	none
104	1.54	0	0.00	0.1008	0.06	0.06	1.60	none
105	1.60	0	0.00	0.1236	0.07	0.07	1.67	none
106	1.67	0	0.00	0.1661	0.10	0.10	1.77	none
107	1.77	0	0.00	0.1504	0.09	0.09	1.86	none
108	1.86	0	0.00	0.1539	0.09	0.09	1.96	none
109	1.96	0	0.00	0.1697	0.10	0.10	2.06	none
110	2.06	0	0.00	0.1925	0.12	0.12	2.17	none
111	2.17	0	0.00	0.2051	0.12	0.12	2.30	none
112	2.30	0	0.00	0.2067	0.12	0.12	2.42	none
113	2.42	0	0.00	0.1657	0.10	0.10	2.52	none
114	2.52	0.08	0.08	0.1610	0.10	0.02	2.54	none
115	2.54	0.22	0.22	0.1110	0.07	-0.15	2.38	none
116	2.38	0	0.00	0.1516	0.09	0.09	2.47	none
117	2.47	0	0.00	0.1504	0.09	0.09	2.56	none
118	2.56	0	0.00	0.1650	0.10	0.10	2.66	none
119	2.66	0	0.00	0.1768	0.11	0.11	2.77	none
120	2.77	0	0.00	0.1677	0.10	0.10	2.87	none
121	2.87	0.24	0.24	0.1475	0.09	-0.15	2.72	none
122	2.72	0	0.00	0.1409	0.08	0.08	2.80	none
123	2.80	0.27	0.27	0.1102	0.07	-0.20	2.60	none
124	2.60	0	0.00	0.1571	0.09	0.09	2.69	none
125	2.69	0	0.00	0.1780	0.11	0.11	2.80	none
126	2.80	0	0.00	0.1831	0.11	0.11	2.91	none
127	2.91	0.31	0.31	0.1766	0.11	-0.20	2.71	none
128	2.71	0.19	0.19	0.1390	0.08	-0.11	2.60	none
129	2.60	0.08	0.08	0.1551	0.09	0.01	2.61	none
130	2.61	0.01	0.01	0.1559	0.09	0.08	2.70	none
131	2.70	0	0.00	0.1311	0.08	0.08	2.78	none
132	2.78	0	0.00	0.1555	0.09	0.09	2.87	none
133	2.87	0.06	0.06	0.0975	0.06	0.00	2.87	none
134	2.87	0	0.00	0.1303	0.08	0.08	2.95	none
135	2.95	0.1	0.10	0.1453	0.09	-0.01	2.93	none
136	2.93	0.4	0.40	0.1343	0.08	-0.32	2.61	none
137	2.61	0.01	0.01	0.1382	0.08	0.07	2.69	none
138	2.69	0.02	0.02	0.1720	0.10	0.08	2.77	none
139	2.77	0	0.00	0.1335	0.08	0.08	2.85	none
140	2.85	0	0.00	0.1638	0.10	0.10	2.95	none
141	2.95	0	0.00	0.1953	0.12	0.12	3.06	none
142	3.06	0	0.00	0.2114	0.13	0.13	3.19	none
143	3.19	0	0.00	0.2235	0.13	0.13	3.33	none
144	3.33	0.21	0.21	0.2303	0.14	-0.07	3.25	none
145	3.25	0	0.00	0.1720	0.10	0.10	3.36	none
146	3.36	0	0.00	0.1256	0.08	0.08	3.43	none
147	3.43	0	0.00	0.1153	0.07	0.07	3.50	none
148	3.50	0	0.00	0.1713	0.10	0.10	3.61	none
149	3.61	0	0.00	0.1865	0.11	0.11	3.72	none
150	3.72	0	0.00	0.1941	0.12	0.12	3.84	none
151	3.84	0	0.00	0.1886	0.11	0.11	3.95	none
152	3.95	0	0.00	0.1980	0.12	0.12	4.07	none
153	4.07	0	0.00	0.1795	0.11	0.11	4.17	none
154	4.17	0	0.00	0.1858	0.11	0.11	4.29	none
155	4.29	0	0.00	0.2055	0.12	0.12	4.37	none
156	4.37	0	0.00	0.2146	0.13	0.13	4.37	none
157	4.37	0	0.00	0.2260	0.14	0.14	4.37	none
158	4.37	0	0.00	0.2260	0.14	0.14	4.37	none
159	4.37	0	0.00	0.2138	0.13	0.13	4.37	none
160	4.37	0	0.00	0.2193	0.13	0.13	4.37	none
161	4.37	0	0.00	0.2433	0.15	0.15	4.37	none
162	4.37	0	0.00	0.2508	0.15	0.15	4.37	none
163	4.37	0	0.00	0.2622	0.16	0.16	4.37	none
164	4.37	0	0.00	0.2740	0.16	0.16	4.37	none
165	4.37	0	0.00	0.2498	0.15	0.15	4.37	none
166	4.37	0	0.00	0.2543	0.15	0.15	4.37	none
167	4.37	0	0.00	0.2189	0.13	0.13	4.37	none
168	4.37	0	0.00	0.2193	0.13	0.13	4.37	none
169	4.37	0	0.00	0.2461	0.15	0.15	4.37	none
170	4.37	0	0.00	0.2528	0.15	0.15	4.37	none
171	4.37	0	0.00	0.2634	0.16	0.16	4.37	none
172	4.37	0	0.00	0.2358	0.14	0.14	4.37	none
173	4.37	0	0.00	0.2735	0.16	0.16	4.37	none
174	4.37	0	0.00	0.2535	0.15	0.15	4.37	none
175	4.37	0	0.00	0.2732	0.16	0.16	4.37	none
176	4.37	0	0.00	0.2626	0.16	0.16	4.37	none
177	4.37	0	0.00	0.2693	0.16	0.16	4.37	none
178	4.37	0	0.00	0.2799	0.17	0.17	4.37	none
179	4.37	0	0.00	0.2870	0.17	0.17	4.37	none
180	4.37	0	0.00	0.2508	0.15	0.15	4.37	none
181	4.37	0	0.00	0.2768	0.17	0.17	4.37	none
182	4.37	0.02	0.02	0.2677	0.16	0.14	4.37	none
183	4.37	0.08	0.08	0.2634	0.16	0.08	4.37	none
184	4.37	0.08	0.08	0.2087	0.13	0.05	4.37	none
185	4.37	0	0.00	0.2173	0.13	0.13	4.37	none
186	4.37	0	0.00	0.2409	0.14	0.14	4.37	none

187	4.37	0	0.00	0.2642	0.16	0.16	4.37	none
188	4.37	0	0.00	0.2803	0.17	0.17	4.37	none
189	4.37	0	0.00	0.2630	0.16	0.16	4.37	none
190	4.37	0.02	0.02	0.2063	0.12	0.10	4.37	none
191	4.37	0.19	0.19	0.2268	0.14	-0.05	4.31	none
192	4.31	0	0.00	0.2461	0.15	0.15	4.37	none
193	4.37	0.01	0.01	0.2374	0.14	0.13	4.37	none
194	4.37	0	0.00	0.2646	0.16	0.16	4.37	none
195	4.37	0	0.00	0.2496	0.15	0.15	4.37	none
196	4.37	0.05	0.05	0.2459	0.15	0.10	4.37	none
197	4.37	0	0.00	0.2453	0.15	0.15	4.37	none
198	4.37	0	0.00	0.2634	0.16	0.16	4.37	none
199	4.37	0	0.00	0.2539	0.15	0.15	4.37	none
200	4.37	0	0.00	0.2776	0.17	0.17	4.37	none
201	4.37	0	0.00	0.2921	0.18	0.18	4.37	none
202	4.37	0	0.00	0.2587	0.16	0.16	4.37	none
203	4.37	0	0.00	0.2654	0.16	0.16	4.37	none
204	4.37	0	0.00	0.2575	0.15	0.15	4.37	none
205	4.37	0	0.00	0.2591	0.16	0.16	4.37	none
206	4.37	0.03	0.03	0.2461	0.15	0.12	4.37	none
207	4.37	0	0.00	0.2756	0.17	0.17	4.37	none
208	4.37	0	0.00	0.2591	0.16	0.16	4.37	none
209	4.37	0	0.00	0.2669	0.16	0.16	4.37	none
210	4.37	0	0.00	0.2642	0.16	0.16	4.37	none
211	4.37	0	0.00	0.2685	0.16	0.16	4.37	none
212	4.37	0.05	0.09	0.2142	0.13	0.04	4.37	none
213	4.37	0	0.00	0.2402	0.14	0.14	4.37	none
214	4.37	0	0.00	0.2339	0.14	0.14	4.37	none
215	4.37	0.22	0.22	0.2673	0.16	-0.06	4.31	none
216	4.31	0	0.00	0.2409	0.14	0.14	4.37	none
217	4.37	0	0.00	0.2539	0.15	0.15	4.37	none
218	4.37	0	0.00	0.2374	0.14	0.14	4.37	none
219	4.37	0	0.00	0.2524	0.15	0.15	4.37	none
220	4.37	0	0.00	0.2492	0.15	0.15	4.37	none
221	4.37	0	0.00	0.2610	0.16	0.16	4.37	none
222	4.37	0	0.00	0.2631	0.15	0.15	4.37	none
223	4.37	0	0.00	0.2354	0.14	0.14	4.37	none
224	4.37	0	0.00	0.2417	0.15	0.15	4.37	none
225	4.37	0	0.00	0.2461	0.15	0.15	4.37	none
226	4.37	0	0.00	0.2620	0.15	0.15	4.37	none
227	4.37	0	0.00	0.2205	0.13	0.13	4.37	none
228	4.37	0.18	0.18	0.2205	0.13	-0.05	4.32	none
229	4.32	0	0.00	0.2114	0.13	0.13	4.37	none
230	4.37	0	0.00	0.2020	0.12	0.12	4.37	none
231	4.37	0	0.00	0.2106	0.13	0.13	4.37	none
232	4.37	0	0.00	0.2028	0.12	0.12	4.37	none
233	4.37	0	0.00	0.1791	0.11	0.11	4.37	none
234	4.37	0	0.00	0.2067	0.12	0.12	4.37	none
235	4.37	0	0.00	0.2110	0.13	0.13	4.37	none
236	4.37	0	0.00	0.2094	0.13	0.13	4.37	none
237	4.37	0.29	0.29	0.1941	0.12	-0.17	4.19	none
238	4.19	0.01	0.01	0.1445	0.09	0.08	4.27	none
239	4.27	0.08	0.08	0.1815	0.11	0.03	4.30	none
240	4.30	0	0.00	0.1776	0.11	0.11	4.37	none
241	4.37	0	0.00	0.2043	0.12	0.12	4.37	none
242	4.37	0	0.00	0.2094	0.13	0.13	4.37	none
243	4.37	0	0.00	0.1815	0.11	0.11	4.37	none
244	4.37	0	0.00	0.1791	0.11	0.11	4.37	none
245	4.37	0	0.00	0.1559	0.09	0.09	4.37	none
246	4.37	0	0.00	0.1854	0.11	0.11	4.37	none
247	4.37	0	0.00	0.2004	0.12	0.12	4.37	none
248	4.37	0	0.00	0.1961	0.12	0.12	4.37	none
249	4.37	0	0.00	0.2035	0.12	0.12	4.37	none
250	4.37	0	0.00	0.1961	0.12	0.12	4.37	none
251	4.37	0.41	0.41	0.1679	0.06	-0.35	4.02	none
252	4.02	0.33	0.33	0.1185	0.07	-0.26	3.76	none
253	3.76	0.26	0.26	0.1197	0.07	-0.19	3.58	none
254	3.58	1.19	1.19	0.0921	0.06	-1.13	2.44	none
255	2.44	0.18	0.18	0.1035	0.06	-0.12	2.32	none
256	2.32	0	0.00	0.1335	0.08	0.08	2.40	none
257	2.40	0.02	0.02	0.1398	0.08	0.06	2.47	none
258	2.47	0	0.00	0.1394	0.08	0.08	2.55	none
259	2.55	0	0.00	0.1555	0.09	0.09	2.64	none
260	2.64	0	0.00	0.1657	0.10	0.10	2.74	none
261	2.74	0	0.00	0.1547	0.09	0.09	2.84	none
262	2.84	0	0.00	0.1642	0.10	0.10	2.93	none
263	2.93	0	0.00	0.1654	0.10	0.10	3.03	none
264	3.03	0	0.00	0.1701	0.10	0.10	3.14	none
265	3.14	0	0.00	0.1390	0.08	0.08	3.22	none
266	3.22	0	0.00	0.1319	0.08	0.08	3.30	none
267	3.30	0	0.00	0.1235	0.07	0.07	3.37	none
268	3.37	0	0.00	0.1465	0.09	0.09	3.46	none
269	3.46	0	0.00	0.1480	0.09	0.09	3.55	none
270	3.55	0	0.00	0.1311	0.08	0.08	3.63	none
271	3.63	0	0.00	0.1433	0.09	0.09	3.71	none
272	3.71	0	0.00	0.1524	0.09	0.09	3.81	none
273	3.81	0	0.00	0.1535	0.09	0.09	3.90	none
274	3.90	0	0.00	0.1496	0.09	0.09	3.99	none
275	3.99	0	0.00	0.1518	0.10	0.10	4.08	none
276	4.08	0	0.00	0.1564	0.10	0.10	4.18	none
277	4.18	0	0.00	0.1421	0.09	0.09	4.27	none
278	4.27	0	0.00	0.1437	0.09	0.09	4.35	none
279	4.35	0	0.00	0.1472	0.09	0.09	4.37	none
280	4.37	0	0.00	0.1319	0.08	0.08	4.37	none
281	4.37	0	0.00	0.1382	0.08	0.08	4.37	none
282	4.37	0	0.00	0.1461	0.09	0.09	4.37	none
283	4.37	0	0.00	0.1515	0.09	0.09	4.37	none
284	4.37	0	0.00	0.1382	0.08	0.08	4.37	none
285	4.37	0	0.00	0.1291	0.08	0.08	4.37	none
286	4.37	0	0.00	0.1280	0.08	0.08	4.37	none
287	4.37	0.23	0.23	0.0701	0.04	-0.19	4.18	none
288	4.18	0.08	0.08	0.0972	0.06	-0.02	4.16	none

289	4.16	0.33	0.33	0.0917	0.06	-0.27	3.88	none
290	3.88	0.03	0.03	0.0480	0.03	0.00	3.88	none
291	3.88	0	0.00	0.0579	0.03	0.03	3.92	none
292	3.92	0	0.00	0.0626	0.04	0.04	3.95	none
293	3.95	0	0.00	0.0728	0.04	0.04	4.00	none
294	4.00	0	0.00	0.0776	0.05	0.05	4.04	none
295	4.04	0	0.00	0.0823	0.05	0.05	4.09	none
296	4.09	0	0.00	0.0835	0.05	0.05	4.14	none
297	4.14	0	0.00	0.0819	0.05	0.05	4.19	none
298	4.19	0	0.00	0.0594	0.04	0.04	4.23	none
299	4.23	0	0.00	0.0661	0.04	0.04	4.27	none
300	4.27	0	0.00	0.0673	0.04	0.04	4.31	none
301	4.31	0.12	0.12	0.0406	0.02	-0.10	4.21	none
302	4.21	0	0.00	0.0524	0.03	0.03	4.24	none
303	4.24	0	0.00	0.0563	0.03	0.03	4.28	none
304	4.28	0	0.00	0.0630	0.04	0.04	4.32	none
305	4.32	0	0.00	0.0697	0.04	0.04	4.36	none
306	4.36	0	0.00	0.0685	0.04	0.04	4.37	none
307	4.37	0	0.00	0.0713	0.04	0.04	4.37	none
308	4.37	0	0.00	0.0736	0.04	0.04	4.37	none
309	4.37	0	0.00	0.0710	0.04	0.04	4.37	none
310	4.37	0	0.00	0.0858	0.05	0.05	4.37	none
311	4.37	0	0.00	0.0803	0.05	0.05	4.37	none
312	4.37	0	0.00	0.0799	0.05	0.05	4.37	none
313	4.37	0	0.00	0.0815	0.05	0.05	4.37	none
314	4.37	0	0.00	0.0791	0.05	0.05	4.37	none
315	4.37	0	0.00	0.0720	0.04	0.04	4.37	none
316	4.37	0	0.00	0.0713	0.04	0.04	4.37	none
317	4.37	0	0.00	0.0551	0.03	0.03	4.37	none
318	4.37	0.06	0.06	0.0551	0.03	-0.03	4.34	none
319	4.34	0	0.00	0.0425	0.03	0.03	4.37	none
320	4.37	0	0.00	0.0350	0.02	0.02	4.37	none
321	4.37	0	0.00	0.0350	0.02	0.02	4.37	none
322	4.37	0	0.00	0.0311	0.02	0.02	4.37	none
323	4.37	0	0.00	0.0370	0.02	0.02	4.37	none
324	4.37	0	0.00	0.0406	0.02	0.02	4.37	none
325	4.37	0	0.00	0.0433	0.03	0.03	4.37	none
326	4.37	0	0.00	0.0484	0.03	0.03	4.37	none
327	4.37	0	0.00	0.0413	0.02	0.02	4.37	none
328	4.37	0	0.00	0.0421	0.03	0.03	4.37	none
329	4.37	0.24	0.24	0.0370	0.02	-0.22	4.15	none
330	4.15	0	0.00	0.0378	0.02	0.02	4.17	none
331	4.17	0	0.00	0.0303	0.02	0.02	4.19	none
332	4.19	0	0.00	0.0374	0.02	0.02	4.21	none
333	4.21	0	0.00	0.0358	0.02	0.02	4.24	none
334	4.24	0	0.00	0.0394	0.02	0.02	4.26	none
335	4.26	0	0.00	0.0272	0.02	0.02	4.27	none
336	4.27	0	0.00	0.0386	0.02	0.02	4.30	none
337	4.30	0	0.00	0.0413	0.02	0.02	4.32	none
338	4.32	0	0.00	0.0382	0.02	0.02	4.35	none
339	4.35	0	0.00	0.0425	0.03	0.03	4.37	none
340	4.37	0.02	0.02	0.0370	0.02	0.00	4.37	none
341	4.37	0	0.00	0.0445	0.03	0.03	4.37	none
342	4.37	0	0.00	0.0354	0.02	0.02	4.37	none
343	4.37	0	0.00	0.0307	0.02	0.02	4.37	none
344	4.37	0	0.00	0.0296	0.02	0.02	4.37	none
345	4.37	0	0.00	0.0315	0.02	0.02	4.37	none
346	4.37	0	0.00	0.0327	0.02	0.02	4.37	none
347	4.37	0	0.00	0.0374	0.02	0.02	4.37	none
348	4.37	0	0.00	0.0409	0.02	0.02	4.37	none
349	4.37	0	0.00	0.0457	0.03	0.03	4.37	none
350	4.37	0	0.00	0.0386	0.02	0.02	4.37	none
351	4.37	0	0.00	0.0524	0.03	0.03	4.37	none
352	4.37	0	0.00	0.0496	0.03	0.03	4.37	none
353	4.37	0	0.00	0.0445	0.03	0.03	4.37	none
354	4.37	0	0.00	0.0406	0.02	0.02	4.37	none
355	4.37	0	0.00	0.0445	0.03	0.03	4.37	none
356	4.37	0	0.00	0.0406	0.02	0.02	4.37	none
357	4.37	0	0.00	0.0402	0.02	0.02	4.37	none
358	4.37	0	0.00	0.0402	0.02	0.02	4.37	none
359	4.37	0	0.00	0.0433	0.03	0.03	4.37	none
360	4.37	0	0.00	0.0358	0.02	0.02	4.37	none
361	4.37	0	0.00	0.0433	0.03	0.03	4.37	none
362	4.37	0	0.00	0.0488	0.03	0.03	4.37	none
363	4.37	0	0.00	0.0425	0.03	0.03	4.37	none
364	4.37	0	0.00	0.0508	0.03	0.03	4.37	none
365	4.37	0	0.00	0.0452	0.03	0.03	4.37	none
366	4.37	0	0.00	0.0453	0.03	0.03	4.37	none
1	4.37	0	0.00	0.0130	0.01	0.01	4.37	none
2	4.37	0	0.00	0.0165	0.01	0.01	4.37	none
3	4.37	0	0.00	0.0173	0.01	0.01	4.37	none
4	4.37	0	0.00	0.0102	0.01	0.01	4.37	none
5	4.37	0	0.00	0.0102	0.01	0.01	4.37	none
6	4.37	0	0.00	0.0106	0.01	0.01	4.37	none
7	4.37	0	0.00	0.0248	0.01	0.01	4.37	none
8	4.37	0	0.00	0.0319	0.02	0.02	4.37	none
9	4.37	0	0.00	0.0406	0.02	0.02	4.37	none
10	4.37	0.27	0.27	0.0331	0.02	-0.25	4.12	none
11	4.12	0.06	0.06	0.0343	0.02	-0.04	4.08	none
12	4.08	0.18	0.18	0.0130	0.01	-0.17	3.91	none
13	3.91	0.13	0.13	0.0153	0.01	-0.12	3.79	none
14	3.79	0.02	0.02	0.0244	0.01	-0.01	3.78	none
15	3.78	0	0.00	0.0370	0.02	0.02	3.80	none
16	3.80	0	0.00	0.0340	0.02	0.02	3.83	none
17	3.83	0	0.00	0.0197	0.01	0.01	3.84	none
18	3.84	0.69	0.69	0.0232	0.01	-0.68	3.16	none
19	3.16	0.39	0.39	0.0327	0.02	-0.37	2.79	none
20	2.79	0	0.00	0.0307	0.02	0.02	2.81	none
21	2.81	0	0.00	0.0323	0.02	0.02	2.83	none
22	2.83	0	0.00	0.0339	0.02	0.02	2.85	none
23	2.85	0	0.00	0.0303	0.02	0.02	2.87	none
24	2.87	0	0.00	0.0287	0.02	0.02	2.89	none

25	2.89	0	0.00	0.0358	0.02	0.02	2.91	none
26	2.91	0	0.00	0.0402	0.02	0.02	2.93	none
27	2.93	0	0.00	0.0409	0.02	0.02	2.96	none
28	2.96	0	0.00	0.0406	0.02	0.02	2.98	none
29	2.98	0.51	0.51	0.0256	0.02	-0.49	2.49	none
30	2.49	0.19	0.19	0.0425	0.03	-0.16	2.32	none
31	2.32	0	0.00	0.0291	0.02	0.02	2.34	none
32	2.34	0	0.00	0.0343	0.02	0.02	2.36	none
33	2.36	0	0.00	0.0358	0.02	0.02	2.38	none
34	2.38	0	0.00	0.0378	0.02	0.02	2.40	none
35	2.40	0	0.00	0.0382	0.02	0.02	2.43	none
36	2.43	0	0.00	0.0496	0.03	0.03	2.46	none
37	2.46	0	0.00	0.0406	0.02	0.02	2.48	none
38	2.48	0	0.00	0.0421	0.03	0.03	2.51	none
39	2.51	0	0.00	0.0327	0.02	0.02	2.53	none
40	2.53	0	0.00	0.0335	0.02	0.02	2.55	none
41	2.55	0	0.00	0.0339	0.02	0.02	2.57	none
42	2.57	0	0.00	0.0315	0.02	0.02	2.59	none
43	2.59	0	0.00	0.0386	0.02	0.02	2.61	none
44	2.61	0	0.00	0.0390	0.02	0.02	2.63	none
45	2.63	0.08	0.08	0.0441	0.03	-0.05	2.58	none
46	2.58	0.36	0.36	0.0272	0.02	-0.34	2.23	none
47	2.23	0.02	0.02	0.0449	0.03	0.01	2.24	none
48	2.24	0.14	0.14	0.0539	0.03	-0.11	2.13	none
49	2.13	0.1	0.10	0.0429	0.03	-0.07	2.06	none
50	2.06	0.43	0.43	0.0697	0.04	-0.39	1.67	none
51	1.67	0.36	0.36	0.0386	0.02	-0.34	1.33	none
52	1.33	0.05	0.05	0.0543	0.03	-0.02	1.32	none
53	1.32	0.24	0.24	0.0280	0.02	-0.22	1.09	none
54	1.09	0.02	0.02	0.0510	0.04	0.02	1.11	none
55	1.11	0	0.00	0.0516	0.03	0.03	1.14	none
56	1.14	0	0.00	0.0539	0.03	0.03	1.17	none
57	1.17	0	0.00	0.0587	0.04	0.04	1.21	none
58	1.21	0	0.00	0.0701	0.04	0.04	1.25	none
59	1.25	0	0.00	0.0752	0.05	0.05	1.30	none
60	1.30	0	0.00	0.0732	0.04	0.04	1.34	none
61	1.34	0	0.00	0.0654	0.04	0.04	1.38	none
62	1.38	0	0.00	0.0685	0.04	0.04	1.42	none
63	1.42	0	0.00	0.0681	0.04	0.04	1.46	none
64	1.46	0	0.00	0.0697	0.04	0.04	1.50	none
65	1.50	0	0.00	0.0713	0.04	0.04	1.55	none
66	1.55	0.02	0.02	0.0646	0.04	0.02	1.57	none
67	1.57	0.93	0.93	0.0520	0.03	-0.90	0.67	none
68	0.67	0	0.00	0.0821	0.06	0.06	0.72	none
69	0.72	0	0.00	0.0569	0.04	0.04	0.76	none
70	0.76	0	0.00	0.0634	0.04	0.04	0.80	none
71	0.80	0.08	0.08	0.0728	0.04	-0.04	0.76	none
72	0.76	0	0.00	0.0689	0.04	0.04	0.80	none
73	0.80	0	0.00	0.0512	0.03	0.03	0.84	none
74	0.84	0	0.00	0.0799	0.05	0.05	0.88	none
75	0.88	0	0.00	0.0929	0.06	0.06	0.94	none
76	0.94	0	0.00	0.1020	0.06	0.06	1.00	none
77	1.00	0	0.00	0.0457	0.03	0.03	1.03	none
78	1.03	0	0.00	0.0657	0.04	0.04	1.07	none
79	1.07	0	0.00	0.0903	0.05	0.05	1.12	none
80	1.12	0	0.00	0.0894	0.05	0.05	1.17	none
81	1.17	0	0.00	0.0972	0.06	0.06	1.23	none
82	1.23	0	0.00	0.0882	0.05	0.05	1.28	none
83	1.28	0.15	0.15	0.0783	0.03	-0.12	1.17	none
84	1.17	0	0.00	0.0846	0.05	0.05	1.22	none
85	1.22	0.02	0.02	0.0732	0.04	0.02	1.24	none
86	1.24	0	0.00	0.0657	0.04	0.04	1.28	none
87	1.28	0	0.00	0.0717	0.04	0.04	1.32	none
88	1.32	0	0.00	0.0780	0.05	0.05	1.37	none
89	1.37	0	0.00	0.0772	0.05	0.05	1.42	none
90	1.42	0	0.00	0.0874	0.05	0.05	1.47	none
91	1.47	0	0.00	0.0654	0.04	0.04	1.51	none
92	1.51	0.03	0.03	0.0492	0.03	0.00	1.51	none
93	1.51	0	0.00	0.0736	0.04	0.04	1.55	none
94	1.55	0	0.00	0.0783	0.05	0.05	1.60	none
95	1.60	0	0.00	0.0839	0.05	0.05	1.65	none
96	1.65	0	0.00	0.1138	0.07	0.07	1.72	none
97	1.72	0	0.00	0.1287	0.08	0.08	1.79	none
98	1.79	0	0.00	0.1161	0.07	0.07	1.86	none
99	1.86	0	0.00	0.0732	0.04	0.04	1.91	none
100	1.91	0	0.00	0.1079	0.06	0.06	1.97	none
101	1.97	0	0.00	0.1413	0.08	0.08	2.06	none
102	2.06	0	0.00	0.1122	0.07	0.07	2.12	none
103	2.12	0	0.00	0.0909	0.05	0.05	2.18	none
104	2.18	0	0.00	0.1006	0.06	0.06	2.24	none
105	2.24	0	0.00	0.1236	0.07	0.07	2.31	none
106	2.31	0	0.00	0.1651	0.10	0.10	2.41	none
107	2.41	0	0.00	0.1504	0.09	0.09	2.50	none
108	2.50	0	0.00	0.1539	0.09	0.09	2.60	none
109	2.60	0	0.00	0.1697	0.10	0.10	2.70	none
110	2.70	0	0.00	0.1325	0.12	0.12	2.81	none
111	2.81	0	0.00	0.2051	0.12	0.12	2.94	none
112	2.94	0	0.00	0.2057	0.12	0.12	3.06	none
113	3.06	0	0.00	0.1657	0.10	0.10	3.16	none
114	3.16	0.08	0.08	0.1410	0.10	0.02	3.18	none
115	3.18	0.22	0.22	0.1110	0.07	-0.15	3.02	none
116	3.02	0	0.00	0.1516	0.09	0.09	3.11	none
117	3.11	0	0.00	0.1504	0.09	0.09	3.20	none
118	3.20	0	0.00	0.1650	0.10	0.10	3.30	none
119	3.30	0	0.00	0.1768	0.11	0.11	3.41	none
120	3.41	0	0.00	0.1577	0.10	0.10	3.51	none
121	3.51	0.24	0.24	0.1475	0.09	-0.15	3.36	none
122	3.36	0	0.00	0.1409	0.08	0.08	3.44	none
123	3.44	0.27	0.27	0.1102	0.07	-0.20	3.24	none
124	3.24	0	0.00	0.1571	0.09	0.09	3.33	none
125	3.33	0	0.00	0.1780	0.11	0.11	3.44	none
126	3.44	0	0.00	0.1831	0.11	0.11	3.55	none

127	3.55	0.31	0.31	0.1760	0.11	-0.20	3.35	none
128	3.35	0.19	0.19	0.1390	0.08	-0.11	3.24	none
129	3.24	0.09	0.08	0.1551	0.09	0.01	3.25	none
130	3.25	0.01	0.01	0.1559	0.09	0.08	3.34	none
131	3.34	0	0.00	0.1311	0.08	0.08	3.41	none
132	3.41	0	0.00	0.1555	0.09	0.09	3.51	none
133	3.51	0.06	0.06	0.0976	0.06	0.00	3.51	none
134	3.51	0	0.00	0.1303	0.08	0.08	3.58	none
135	3.58	0	0.10	0.1453	0.09	-0.01	3.57	none
136	3.57	0.4	0.40	0.1343	0.08	-0.32	3.25	none
137	3.25	0.01	0.01	0.1582	0.08	0.07	3.32	none
138	3.32	0.02	0.02	0.1720	0.10	0.08	3.41	none
139	3.41	0	0.00	0.1335	0.08	0.08	3.49	none
140	3.49	0	0.00	0.1338	0.10	0.10	3.59	none
141	3.59	0	0.00	0.1953	0.12	0.12	3.70	none
142	3.70	0	0.00	0.2114	0.13	0.13	3.83	none
143	3.83	0	0.00	0.2236	0.13	0.13	3.96	none
144	3.96	0.21	0.21	0.2303	0.14	-0.07	3.89	none
145	3.89	0	0.00	0.1720	0.10	0.10	4.00	none
146	4.00	0	0.00	0.1256	0.08	0.08	4.07	none
147	4.07	0	0.00	0.1193	0.07	0.07	4.14	none
148	4.14	0	0.00	0.1713	0.10	0.10	4.25	none
149	4.25	0	0.00	0.1866	0.11	0.11	4.36	none
150	4.36	0	0.00	0.1841	0.12	0.12	4.37	none
151	4.37	0	0.00	0.1885	0.11	0.11	4.37	none
152	4.37	0	0.00	0.1980	0.12	0.12	4.37	none
153	4.37	0	0.00	0.1795	0.11	0.11	4.37	none
154	4.37	0	0.00	0.1858	0.11	0.11	4.37	none
155	4.37	0	0.00	0.2055	0.12	0.12	4.37	none
156	4.37	0	0.00	0.2146	0.13	0.13	4.37	none
157	4.37	0	0.00	0.2260	0.14	0.14	4.37	none
158	4.37	0	0.00	0.2250	0.14	0.14	4.37	none
159	4.37	0	0.00	0.2138	0.13	0.13	4.37	none
160	4.37	0	0.00	0.2193	0.13	0.13	4.37	none
161	4.37	0	0.00	0.2433	0.15	0.15	4.37	none
162	4.37	0	0.00	0.2508	0.15	0.15	4.37	none
163	4.37	0	0.00	0.2522	0.16	0.16	4.37	none
164	4.37	0	0.00	0.2740	0.16	0.16	4.37	none
165	4.37	0	0.00	0.2488	0.15	0.15	4.37	none
166	4.37	0	0.00	0.2543	0.15	0.15	4.37	none
167	4.37	0	0.00	0.2186	0.13	0.13	4.37	none
168	4.37	0	0.00	0.2193	0.13	0.13	4.37	none
169	4.37	0	0.00	0.2461	0.15	0.15	4.37	none
170	4.37	0	0.00	0.2528	0.15	0.15	4.37	none
171	4.37	0	0.00	0.2534	0.16	0.16	4.37	none
172	4.37	0	0.00	0.2358	0.14	0.14	4.37	none
173	4.37	0	0.00	0.2736	0.16	0.16	4.37	none
174	4.37	0	0.00	0.2535	0.15	0.15	4.37	none
175	4.37	0	0.00	0.2732	0.16	0.16	4.37	none
176	4.37	0	0.00	0.2626	0.16	0.16	4.37	none
177	4.37	0	0.00	0.2553	0.16	0.16	4.37	none
178	4.37	0	0.00	0.2799	0.17	0.17	4.37	none
179	4.37	0	0.00	0.2970	0.17	0.17	4.37	none
180	4.37	0	0.00	0.2508	0.15	0.15	4.37	none
181	4.37	0	0.00	0.2768	0.17	0.17	4.37	none
182	4.37	0.02	0.02	0.2577	0.16	0.14	4.37	none
183	4.37	0.08	0.08	0.2534	0.16	0.08	4.37	none
184	4.37	0.08	0.08	0.2567	0.13	0.05	4.37	none
185	4.37	0	0.00	0.2173	0.13	0.13	4.37	none
186	4.37	0	0.00	0.2499	0.14	0.14	4.37	none
187	4.37	0	0.00	0.2542	0.16	0.16	4.37	none
188	4.37	0	0.00	0.2803	0.17	0.17	4.37	none
189	4.37	0	0.00	0.2530	0.16	0.16	4.37	none
190	4.37	0.02	0.02	0.2533	0.12	0.10	4.37	none
191	4.37	0.19	0.19	0.2168	0.14	-0.05	4.31	none
192	4.31	0	0.00	0.2461	0.15	0.15	4.37	none
193	4.37	0.01	0.01	0.2374	0.14	0.13	4.37	none
194	4.37	0	0.00	0.2646	0.16	0.16	4.37	none
195	4.37	0	0.00	0.2496	0.15	0.15	4.37	none
196	4.37	0.05	0.05	0.2469	0.15	0.10	4.37	none
197	4.37	0	0.00	0.2453	0.15	0.15	4.37	none
198	4.37	0	0.00	0.2634	0.16	0.16	4.37	none
199	4.37	0	0.00	0.2539	0.15	0.15	4.37	none
200	4.37	0	0.00	0.2776	0.17	0.17	4.37	none
201	4.37	0	0.00	0.2421	0.18	0.18	4.37	none
202	4.37	0	0.00	0.2587	0.16	0.16	4.37	none
203	4.37	0	0.00	0.2554	0.16	0.16	4.37	none
204	4.37	0	0.00	0.2575	0.15	0.15	4.37	none
205	4.37	0	0.00	0.2591	0.16	0.16	4.37	none
206	4.37	0.03	0.03	0.2461	0.15	0.12	4.37	none
207	4.37	0	0.00	0.2756	0.17	0.17	4.37	none
208	4.37	0	0.00	0.2591	0.16	0.16	4.37	none
209	4.37	0	0.00	0.2569	0.16	0.16	4.37	none
210	4.37	0	0.00	0.2642	0.16	0.16	4.37	none
211	4.37	0	0.00	0.2685	0.16	0.16	4.37	none
212	4.37	0.09	0.09	0.2142	0.13	0.04	4.37	none
213	4.37	0	0.00	0.2-02	0.14	0.14	4.37	none
214	4.37	0	0.00	0.2339	0.14	0.14	4.37	none
215	4.37	0.22	0.22	0.2573	0.16	-0.06	4.31	none
216	4.31	0	0.00	0.2496	0.14	0.14	4.37	none
217	4.37	0	0.00	0.2533	0.15	0.15	4.37	none
218	4.37	0	0.00	0.2374	0.14	0.14	4.37	none
219	4.37	0	0.00	0.2624	0.15	0.15	4.37	none
220	4.37	0	0.00	0.2492	0.15	0.15	4.37	none
221	4.37	0	0.00	0.2610	0.16	0.16	4.37	none
222	4.37	0	0.00	0.2531	0.15	0.15	4.37	none
223	4.37	0	0.00	0.2354	0.14	0.14	4.37	none
224	4.37	0	0.00	0.2417	0.15	0.15	4.37	none
225	4.37	0	0.00	0.2461	0.15	0.15	4.37	none
226	4.37	0	0.00	0.2520	0.15	0.15	4.37	none
227	4.37	0	0.00	0.2205	0.13	0.13	4.37	none
228	4.37	0.19	0.18	0.2265	0.13	-0.05	4.32	none

229	4.32	0	0.00	0.2114	0.13	0.13	4.37	none
230	4.37	0	0.00	0.2020	0.12	0.12	4.37	none
231	4.37	0	0.00	0.2106	0.13	0.13	4.37	none
232	4.37	0	0.00	0.2028	0.12	0.12	4.37	none
233	4.37	0	0.00	0.1791	0.11	0.11	4.37	none
234	4.37	0	0.00	0.2067	0.12	0.12	4.37	none
235	4.37	0	0.00	0.2110	0.13	0.13	4.37	none
236	4.37	0	0.00	0.2094	0.13	0.13	4.37	none
237	4.37	0.29	0.29	0.1941	0.12	-0.17	4.19	none
238	4.19	0.01	0.01	0.1445	0.09	0.08	4.27	none
239	4.27	0.02	0.08	0.1615	0.11	0.03	4.30	none
240	4.30	0	0.00	0.1776	0.11	0.11	4.37	none
241	4.37	0	0.00	0.2043	0.12	0.12	4.37	none
242	4.37	0	0.00	0.2094	0.13	0.13	4.37	none
243	4.37	0	0.00	0.1815	0.11	0.11	4.37	none
244	4.37	0	0.00	0.1791	0.11	0.11	4.37	none
245	4.37	0	0.00	0.1559	0.09	0.09	4.37	none
246	4.37	0	0.00	0.1554	0.11	0.11	4.37	none
247	4.37	0	0.00	0.2054	0.12	0.12	4.37	none
248	4.37	0	0.00	0.1961	0.12	0.12	4.37	none
249	4.37	0	0.00	0.2035	0.12	0.12	4.37	none
250	4.37	0	0.00	0.1961	0.12	0.12	4.37	none
251	4.37	0.41	0.41	0.1079	0.06	-0.35	4.02	none
252	4.02	0.33	0.33	0.1185	0.07	-0.26	3.76	none
253	3.76	0.25	0.25	0.1197	0.07	-0.19	3.58	none
254	3.58	1.19	1.19	0.0521	0.06	-1.13	2.44	none
255	2.44	0.18	0.18	0.1035	0.06	-0.12	2.32	none
256	2.32	0	0.00	0.1035	0.08	0.08	2.40	none
257	2.40	0.02	0.02	0.1098	0.08	0.06	2.47	none
258	2.47	0	0.00	0.1094	0.08	0.08	2.55	none
259	2.55	0	0.00	0.1555	0.09	0.09	2.64	none
260	2.64	0	0.00	0.1657	0.10	0.10	2.74	none
261	2.74	0	0.00	0.1547	0.09	0.09	2.84	none
262	2.84	0	0.00	0.1642	0.10	0.10	2.93	none
263	2.93	0	0.00	0.1654	0.10	0.10	3.03	none
264	3.03	0	0.00	0.1701	0.10	0.10	3.14	none
265	3.14	0	0.00	0.1590	0.08	0.08	3.22	none
266	3.22	0	0.00	0.1519	0.08	0.08	3.30	none
267	3.30	0	0.00	0.1530	0.07	0.07	3.37	none
268	3.37	0	0.00	0.1455	0.09	0.09	3.46	none
269	3.46	0	0.00	0.1480	0.09	0.09	3.55	none
270	3.55	0	0.00	0.1311	0.08	0.08	3.63	none
271	3.63	0	0.00	0.1433	0.09	0.09	3.71	none
272	3.71	0	0.00	0.1524	0.09	0.09	3.81	none
273	3.81	0	0.00	0.1535	0.09	0.09	3.90	none
274	3.90	0	0.00	0.1496	0.09	0.09	3.99	none
275	3.99	0	0.00	0.1618	0.10	0.10	4.08	none
276	4.08	0	0.00	0.1591	0.10	0.10	4.18	none
277	4.18	0	0.00	0.1421	0.09	0.09	4.27	none
278	4.27	0	0.00	0.1437	0.09	0.09	4.35	none
279	4.35	0	0.00	0.1472	0.09	0.09	4.37	none
280	4.37	0	0.00	0.1519	0.08	0.08	4.37	none
281	4.37	0	0.00	0.1382	0.08	0.08	4.37	none
282	4.37	0	0.00	0.1461	0.09	0.09	4.37	none
283	4.37	0	0.00	0.1515	0.09	0.09	4.37	none
284	4.37	0	0.00	0.1362	0.08	0.08	4.37	none
285	4.37	0	0.00	0.1291	0.08	0.08	4.37	none
286	4.37	0	0.00	0.1290	0.08	0.08	4.37	none
287	4.37	0.23	0.23	0.1701	0.04	-0.19	4.18	none
288	4.18	0.08	0.08	0.0972	0.06	-0.02	4.16	none
289	4.16	0.33	0.33	0.0917	0.06	-0.27	3.88	none
290	3.88	0.03	0.03	0.0490	0.03	0.00	3.88	none
291	3.88	0	0.00	0.0579	0.03	0.03	3.92	none
292	3.92	0	0.00	0.0626	0.04	0.04	3.95	none
293	3.95	0	0.00	0.0728	0.04	0.04	4.00	none
294	4.00	0	0.00	0.0776	0.05	0.05	4.04	none
295	4.04	0	0.00	0.0823	0.05	0.05	4.09	none
296	4.09	0	0.00	0.0835	0.05	0.05	4.14	none
297	4.14	0	0.00	0.0819	0.05	0.05	4.19	none
298	4.19	0	0.00	0.0564	0.04	0.04	4.23	none
299	4.23	0	0.00	0.0661	0.04	0.04	4.27	none
300	4.27	0	0.00	0.0773	0.04	0.04	4.31	none
301	4.31	0.12	0.12	0.0405	0.02	-0.10	4.21	none
302	4.21	0	0.00	0.0524	0.03	0.03	4.24	none
303	4.24	0	0.00	0.0563	0.03	0.03	4.28	none
304	4.28	0	0.00	0.0630	0.04	0.04	4.32	none
305	4.32	0	0.00	0.0697	0.04	0.04	4.36	none
306	4.36	0	0.00	0.0685	0.04	0.04	4.37	none
307	4.37	0	0.00	0.0713	0.04	0.04	4.37	none
308	4.37	0	0.00	0.0736	0.04	0.04	4.37	none
309	4.37	0	0.00	0.0710	0.04	0.04	4.37	none
310	4.37	0	0.00	0.0558	0.05	0.05	4.37	none
311	4.37	0	0.00	0.0603	0.05	0.05	4.37	none
312	4.37	0	0.00	0.0799	0.05	0.05	4.37	none
313	4.37	0	0.00	0.0815	0.05	0.05	4.37	none
314	4.37	0	0.00	0.0791	0.05	0.05	4.37	none
315	4.37	0	0.00	0.0720	0.04	0.04	4.37	none
316	4.37	0	0.00	0.0713	0.04	0.04	4.37	none
317	4.37	0	0.00	0.0551	0.03	0.03	4.37	none
318	4.37	0.06	0.06	0.0551	0.03	-0.03	4.34	none
319	4.34	0	0.00	0.0425	0.03	0.03	4.37	none
320	4.37	0	0.00	0.0350	0.02	0.02	4.37	none
321	4.37	0	0.00	0.0250	0.02	0.02	4.37	none
322	4.37	0	0.00	0.0311	0.02	0.02	4.37	none
323	4.37	0	0.00	0.0370	0.02	0.02	4.37	none
324	4.37	0	0.00	0.0406	0.02	0.02	4.37	none
325	4.37	0	0.00	0.0433	0.03	0.03	4.37	none
326	4.37	0	0.00	0.0464	0.03	0.03	4.37	none
327	4.37	0	0.00	0.0413	0.02	0.02	4.37	none
328	4.37	0	0.00	0.0421	0.03	0.03	4.37	none
329	4.37	0.24	0.24	0.0370	0.02	-0.22	4.15	none
330	4.15	0	0.00	0.0378	0.02	0.02	4.17	none

331	4.17	0	0.00	0.0303	0.02	0.02	4.19	none
332	4.19	0	0.00	0.0374	0.02	0.02	4.21	none
333	4.21	0	0.00	0.0358	0.02	0.02	4.24	none
334	4.24	0	0.00	0.0394	0.02	0.02	4.26	none
335	4.26	0	0.00	0.0372	0.02	0.02	4.27	none
336	4.27	0	0.00	0.0386	0.02	0.02	4.30	none
337	4.30	0	0.00	0.0413	0.02	0.02	4.32	none
338	4.32	0	0.00	0.0382	0.02	0.02	4.35	none
339	4.35	0	0.00	0.0425	0.03	0.03	4.37	none
340	4.37	0.02	0.02	0.0370	0.02	0.00	4.37	none
341	4.37	0	0.00	0.0445	0.03	0.03	4.37	none
342	4.37	0	0.00	0.0354	0.02	0.02	4.37	none
343	4.37	0	0.00	0.0307	0.02	0.02	4.37	none
344	4.37	0	0.00	0.0295	0.02	0.02	4.37	none
345	4.37	0	0.00	0.0315	0.02	0.02	4.37	none
346	4.37	0	0.00	0.0227	0.02	0.02	4.37	none
347	4.37	0	0.00	0.0374	0.02	0.02	4.37	none
348	4.37	0	0.00	0.0409	0.02	0.02	4.37	none
349	4.37	0	0.00	0.0457	0.03	0.03	4.37	none
350	4.37	0	0.00	0.0366	0.02	0.02	4.37	none
351	4.37	0	0.00	0.0324	0.03	0.03	4.37	none
352	4.37	0	0.00	0.0496	0.03	0.03	4.37	none
353	4.37	0	0.00	0.0445	0.03	0.03	4.37	none
354	4.37	0	0.00	0.0406	0.02	0.02	4.37	none
355	4.37	0	0.00	0.0445	0.03	0.03	4.37	none
356	4.37	0	0.00	0.0406	0.02	0.02	4.37	none
357	4.37	0	0.00	0.0402	0.02	0.02	4.37	none
358	4.37	0	0.00	0.0402	0.02	0.02	4.37	none
359	4.37	0	0.00	0.0433	0.03	0.03	4.37	none
360	4.37	0	0.00	0.0358	0.02	0.02	4.37	none
361	4.37	0	0.00	0.0433	0.03	0.03	4.37	none
362	4.37	0	0.00	0.0498	0.03	0.03	4.37	none
363	4.37	0	0.00	0.0425	0.03	0.03	4.37	none
364	4.37	0	0.00	0.0398	0.03	0.03	4.37	none
365	4.37	0	0.00	0.0492	0.03	0.03	4.37	none
366	4.37	0	0.00	0.0453	0.03	0.03	4.37	none
1	4.37	0	0.00	0.0130	0.01	0.01	4.37	none
2	4.37	0	0.00	0.0165	0.01	0.01	4.37	none
3	4.37	0	0.00	0.0173	0.01	0.01	4.37	none
4	4.37	0	0.00	0.0102	0.01	0.01	4.37	none
5	4.37	0	0.00	0.0102	0.01	0.01	4.37	none
6	4.37	0	0.00	0.0106	0.01	0.01	4.37	none
7	4.37	0	0.00	0.0248	0.01	0.01	4.37	none
8	4.37	0	0.00	0.0319	0.02	0.02	4.37	none
9	4.37	0	0.00	0.0406	0.02	0.02	4.37	none
10	4.37	0.27	0.27	0.0331	0.02	-0.25	4.12	none
11	4.12	0.06	0.06	0.0343	0.02	-0.04	4.08	none
12	4.08	0.18	0.18	0.0130	0.01	-0.17	3.91	none
13	3.91	0.13	0.13	0.0193	0.01	-0.12	3.79	none
14	3.79	0.02	0.02	0.0144	0.01	-0.01	3.78	none
15	3.78	0	0.00	0.0170	0.02	0.02	3.80	none
16	3.80	0	0.00	0.0360	0.02	0.02	3.83	none
17	3.83	0	0.00	0.0197	0.01	0.01	3.84	none
18	3.84	0.69	0.69	0.0232	0.01	-0.68	3.16	none
19	3.16	0.39	0.39	0.0227	0.02	-0.37	2.79	none
20	2.79	0	0.00	0.0307	0.02	0.02	2.81	none
21	2.81	0	0.00	0.0323	0.02	0.02	2.83	none
22	2.83	0	0.00	0.0339	0.02	0.02	2.85	none
23	2.85	0	0.00	0.0303	0.02	0.02	2.87	none
24	2.87	0	0.00	0.0287	0.02	0.02	2.89	none
25	2.89	0	0.00	0.0358	0.02	0.02	2.91	none
26	2.91	0	0.00	0.0402	0.02	0.02	2.93	none
27	2.93	0	0.00	0.0409	0.02	0.02	2.96	none
28	2.96	0	0.00	0.0406	0.02	0.02	2.98	none
29	2.98	0.51	0.51	0.0356	0.02	-0.49	2.49	none
30	2.49	0.19	0.19	0.0425	0.03	-0.16	2.32	none
31	2.32	0	0.00	0.0391	0.02	0.02	2.34	none
32	2.34	0	0.00	0.0343	0.02	0.02	2.36	none
33	2.36	0	0.00	0.0358	0.02	0.02	2.38	none
34	2.38	0	0.00	0.0378	0.02	0.02	2.40	none
35	2.40	0	0.00	0.0382	0.02	0.02	2.43	none
36	2.43	0	0.00	0.0496	0.03	0.03	2.46	none
37	2.46	0	0.00	0.0406	0.02	0.02	2.48	none
38	2.48	0	0.00	0.0421	0.03	0.03	2.51	none
39	2.51	0	0.00	0.0327	0.02	0.02	2.53	none
40	2.53	0	0.00	0.0335	0.02	0.02	2.55	none
41	2.55	0	0.00	0.0339	0.02	0.02	2.57	none
42	2.57	0	0.00	0.0315	0.02	0.02	2.59	none
43	2.59	0	0.00	0.0386	0.02	0.02	2.61	none
44	2.61	0	0.00	0.0390	0.02	0.02	2.63	none
45	2.63	0.08	0.08	0.0441	0.03	-0.05	2.58	none
46	2.58	0.36	0.36	0.0272	0.02	-0.34	2.23	none
47	2.23	0.02	0.02	0.0449	0.03	0.01	2.24	none
48	2.24	0.14	0.14	0.0359	0.03	-0.11	2.13	none
49	2.13	0.10	0.10	0.0429	0.03	-0.07	2.06	none
50	2.06	0.43	0.43	0.0367	0.04	-0.39	1.67	none
51	1.67	0.36	0.36	0.0386	0.02	-0.34	1.33	none
52	1.33	0.05	0.05	0.0543	0.03	-0.02	1.32	none
53	1.32	0.24	0.24	0.0280	0.02	-0.22	1.09	none
54	1.09	0.02	0.02	0.0310	0.04	0.02	1.11	none
55	1.11	0	0.00	0.0316	0.03	0.03	1.14	none
56	1.14	0	0.00	0.0339	0.03	0.03	1.17	none
57	1.17	0	0.00	0.0387	0.04	0.04	1.21	none
58	1.21	0	0.00	0.0301	0.04	0.04	1.25	none
59	1.25	0	0.00	0.0352	0.05	0.05	1.30	none
60	1.30	0	0.00	0.0332	0.04	0.04	1.34	none
61	1.34	0	0.00	0.0364	0.04	0.04	1.38	none
62	1.38	0	0.00	0.0365	0.04	0.04	1.42	none
63	1.42	0	0.00	0.0381	0.04	0.04	1.46	none
64	1.46	0	0.00	0.0397	0.04	0.04	1.50	none
65	1.50	0	0.00	0.0313	0.04	0.04	1.55	none
66	1.55	0.02	0.02	0.0346	0.04	0.02	1.57	none

67	1.57	0.93	0.93	0.6520	0.03	-0.90	0.67	none
68	0.67	0	0.00	0.0921	0.06	0.06	0.72	none
69	0.72	0	0.00	0.0669	0.04	0.04	0.76	none
70	0.76	0	0.00	0.0634	0.04	0.04	0.80	none
71	0.80	0.08	0.08	0.0728	0.04	-0.04	0.76	none
72	0.76	0	0.00	0.0689	0.04	0.04	0.80	none
73	0.80	0	0.00	0.0512	0.03	0.03	0.84	none
74	0.84	0	0.00	0.0799	0.05	0.05	0.88	none
75	0.88	0	0.00	0.0929	0.06	0.06	0.94	none
76	0.94	0	0.00	0.1020	0.06	0.06	1.00	none
77	1.00	0	0.00	0.0457	0.03	0.03	1.03	none
78	1.03	0	0.00	0.0557	0.04	0.04	1.07	none
79	1.07	0	0.00	0.0903	0.05	0.05	1.12	none
80	1.12	0	0.00	0.0994	0.05	0.05	1.17	none
81	1.17	0	0.00	0.0972	0.06	0.06	1.23	none
82	1.23	0	0.00	0.0882	0.05	0.05	1.28	none
83	1.28	0.15	0.15	0.0583	0.03	-0.12	1.17	none
84	1.17	0	0.00	0.0846	0.05	0.05	1.22	none
85	1.22	0.02	0.02	0.0732	0.04	0.02	1.24	none
86	1.24	0	0.00	0.0657	0.04	0.04	1.28	none
87	1.28	0	0.00	0.0717	0.04	0.04	1.32	none
88	1.32	0	0.00	0.0780	0.05	0.05	1.37	none
89	1.37	0	0.00	0.0772	0.05	0.05	1.42	none
90	1.42	0	0.00	0.0874	0.05	0.05	1.47	none
91	1.47	0	0.00	0.0654	0.04	0.04	1.51	none
92	1.51	0.03	0.03	0.0492	0.03	0.00	1.51	none
93	1.51	0	0.00	0.0735	0.04	0.04	1.55	none
94	1.55	0	0.00	0.0783	0.05	0.05	1.60	none
95	1.60	0	0.00	0.0639	0.05	0.05	1.65	none
96	1.65	0	0.00	0.1138	0.07	0.07	1.72	none
97	1.72	0	0.00	0.1287	0.08	0.08	1.79	none
98	1.79	0	0.00	0.1161	0.07	0.07	1.86	none
99	1.86	0	0.00	0.0732	0.04	0.04	1.91	none
100	1.91	0	0.00	0.1079	0.06	0.06	1.97	none
101	1.97	0	0.00	0.1413	0.08	0.08	2.06	none
102	2.06	0	0.00	0.1122	0.07	0.07	2.12	none
103	2.12	0	0.00	0.0909	0.05	0.05	2.18	none
104	2.18	0	0.00	0.0908	0.06	0.06	2.24	none
105	2.24	0	0.00	0.1235	0.07	0.07	2.31	none
106	2.31	0	0.00	0.1261	0.10	0.10	2.41	none
107	2.41	0	0.00	0.1504	0.09	0.09	2.50	none
108	2.50	0	0.00	0.1539	0.09	0.09	2.60	none
109	2.60	0	0.00	0.1597	0.10	0.10	2.70	none
110	2.70	0	0.00	0.1925	0.12	0.12	2.81	none
111	2.81	0	0.00	0.2051	0.12	0.12	2.94	none
112	2.94	0	0.00	0.2067	0.12	0.12	3.06	none
113	3.06	0	0.00	0.1657	0.10	0.10	3.16	none
114	3.16	0.08	0.08	0.1610	0.10	0.02	3.18	none
115	3.18	0.22	0.22	0.1110	0.07	-0.15	3.02	none
116	3.02	0	0.00	0.1516	0.09	0.09	3.11	none
117	3.11	0	0.00	0.1504	0.09	0.09	3.20	none
118	3.20	0	0.00	0.1650	0.10	0.10	3.30	none
119	3.30	0	0.00	0.1768	0.11	0.11	3.41	none
120	3.41	0	0.00	0.1677	0.10	0.10	3.51	none
121	3.51	0.24	0.24	0.1476	0.09	-0.15	3.36	none
122	3.36	0	0.00	0.1409	0.08	0.08	3.44	none
123	3.44	0.27	0.27	0.1402	0.07	-0.20	3.24	none
124	3.24	0	0.00	0.1571	0.09	0.09	3.33	none
125	3.33	0	0.00	0.1780	0.11	0.11	3.44	none
126	3.44	0	0.00	0.1831	0.11	0.11	3.55	none
127	3.55	0.31	0.31	0.1760	0.11	-0.20	3.35	none
128	3.35	0.19	0.19	0.1390	0.08	-0.11	3.24	none
129	3.24	0.08	0.08	0.1551	0.09	0.01	3.25	none
130	3.25	0.01	0.01	0.1559	0.09	0.08	3.34	none
131	3.34	0	0.00	0.1311	0.08	0.08	3.41	none
132	3.41	0	0.00	0.1555	0.09	0.09	3.51	none
133	3.51	0.06	0.06	0.0976	0.06	0.00	3.51	none
134	3.51	0	0.00	0.1303	0.08	0.08	3.58	none
135	3.58	0.1	0.10	0.1463	0.09	-0.01	3.57	none
136	3.57	0.4	0.40	0.1343	0.08	-0.32	3.25	none
137	3.25	0.01	0.01	0.1382	0.08	0.07	3.32	none
138	3.32	0.02	0.02	0.1720	0.10	0.08	3.41	none
139	3.41	0	0.00	0.1535	0.08	0.08	3.49	none
140	3.49	0	0.00	0.1638	0.10	0.10	3.59	none
141	3.59	0	0.00	0.1353	0.12	0.12	3.70	none
142	3.70	0	0.00	0.1114	0.13	0.13	3.83	none
143	3.83	0	0.00	0.1236	0.13	0.13	3.96	none
144	3.96	0.21	0.21	0.2303	0.14	-0.07	3.89	none
145	3.89	0	0.00	0.1720	0.10	0.10	4.00	none
146	4.00	0	0.00	0.1256	0.08	0.08	4.07	none
147	4.07	0	0.00	0.1193	0.07	0.07	4.14	none
148	4.14	0	0.00	0.1713	0.10	0.10	4.25	none
149	4.25	0	0.00	0.1966	0.11	0.11	4.36	none
150	4.36	0	0.00	0.1941	0.12	0.12	4.37	none
151	4.37	0	0.00	0.1986	0.11	0.11	4.37	none
152	4.37	0	0.00	0.1980	0.12	0.12	4.37	none
153	4.37	0	0.00	0.1755	0.11	0.11	4.37	none
154	4.37	0	0.00	0.1358	0.11	0.11	4.37	none
155	4.37	0	0.00	0.2055	0.12	-0.12	4.37	none
156	4.37	0	0.00	0.2146	0.13	0.13	4.37	none
157	4.37	0	0.00	0.2260	0.14	0.14	4.37	none
158	4.37	0	0.00	0.2260	0.14	0.14	4.37	none
159	4.37	0	0.00	0.2138	0.13	0.13	4.37	none
160	4.37	0	0.00	0.2193	0.13	0.13	4.37	none
161	4.37	0	0.00	0.2433	0.15	0.15	4.37	none
162	4.37	0	0.00	0.2508	0.15	0.15	4.37	none
163	4.37	0	0.00	0.2522	0.16	0.16	4.37	none
164	4.37	0	0.00	0.2740	0.16	0.16	4.37	none
165	4.37	0	0.00	0.2488	0.15	0.15	4.37	none
166	4.37	0	0.00	0.2543	0.15	0.15	4.37	none
167	4.37	0	0.00	0.2189	0.13	0.13	4.37	none
168	4.37	0	0.00	0.2193	0.13	0.13	4.37	none

169	4.37	0	0.00	0.2461	0.15	0.15	4.37	none
170	4.37	0	0.00	0.2528	0.15	0.15	4.37	none
171	4.37	0	0.00	0.2534	0.16	0.16	4.37	none
172	4.37	0	0.00	0.2558	0.14	0.14	4.37	none
173	4.37	0	0.00	0.2736	0.16	0.16	4.37	none
174	4.37	0	0.00	0.2535	0.15	0.15	4.37	none
175	4.37	0	0.00	0.2732	0.16	0.16	4.37	none
176	4.37	0	0.00	0.2826	0.16	0.16	4.37	none
177	4.37	0	0.00	0.2693	0.16	0.16	4.37	none
178	4.37	0	0.00	0.2799	0.17	0.17	4.37	none
179	4.37	0	0.00	0.2870	0.17	0.17	4.37	none
180	4.37	0	0.00	0.2508	0.15	0.15	4.37	none
181	4.37	0	0.00	0.2768	0.17	0.17	4.37	none
182	4.37	0.02	0.02	0.2477	0.16	0.14	4.37	none
183	4.37	0.08	0.08	0.2934	0.16	0.08	4.37	none
184	4.37	0.08	0.08	0.2087	0.13	0.05	4.37	none
185	4.37	0	0.00	0.2173	0.13	0.13	4.37	none
186	4.37	0	0.00	0.2409	0.14	0.14	4.37	none
187	4.37	0	0.00	0.2642	0.16	0.16	4.37	none
188	4.37	0	0.00	0.2803	0.17	0.17	4.37	none
189	4.37	0	0.00	0.2630	0.16	0.16	4.37	none
190	4.37	0.02	0.02	0.2053	0.12	0.10	4.37	none
191	4.37	0.19	0.19	0.2268	0.14	-0.05	4.31	none
192	4.31	0	0.00	0.2461	0.15	0.15	4.37	none
193	4.37	0.01	0.01	0.2274	0.14	0.13	4.37	none
194	4.37	0	0.00	0.2646	0.16	0.16	4.37	none
195	4.37	0	0.00	0.2496	0.15	0.15	4.37	none
196	4.37	0.05	0.05	0.2469	0.15	0.10	4.37	none
197	4.37	0	0.00	0.2453	0.15	0.15	4.37	none
198	4.37	0	0.00	0.2634	0.16	0.16	4.37	none
199	4.37	0	0.00	0.2539	0.15	0.15	4.37	none
200	4.37	0	0.00	0.2776	0.17	0.17	4.37	none
201	4.37	0	0.00	0.2721	0.18	0.18	4.37	none
202	4.37	0	0.00	0.2587	0.16	0.16	4.37	none
203	4.37	0	0.00	0.2664	0.16	0.16	4.37	none
204	4.37	0	0.00	0.2775	0.15	0.15	4.37	none
205	4.37	0	0.00	0.2581	0.16	0.16	4.37	none
206	4.37	0.03	0.03	0.2451	0.15	0.12	4.37	none
207	4.37	0	0.00	0.2756	0.17	0.17	4.37	none
208	4.37	0	0.00	0.2591	0.16	0.16	4.37	none
209	4.37	0	0.00	0.2569	0.16	0.16	4.37	none
210	4.37	0	0.00	0.2642	0.16	0.16	4.37	none
211	4.37	0	0.00	0.2685	0.16	0.16	4.37	none
212	4.37	0.09	0.09	0.2742	0.13	0.04	4.37	none
213	4.37	0	0.00	0.2402	0.14	0.14	4.37	none
214	4.37	0	0.00	0.2339	0.14	0.14	4.37	none
215	4.37	0.22	0.22	0.2673	0.16	-0.06	4.31	none
216	4.31	0	0.00	0.2409	0.14	0.14	4.37	none
217	4.37	0	0.00	0.2539	0.15	0.15	4.37	none
218	4.37	0	0.00	0.2374	0.14	0.14	4.37	none
219	4.37	0	0.00	0.2524	0.15	0.15	4.37	none
220	4.37	0	0.00	0.2482	0.15	0.15	4.37	none
221	4.37	0	0.00	0.2610	0.16	0.16	4.37	none
222	4.37	0	0.00	0.2531	0.15	0.15	4.37	none
223	4.37	0	0.00	0.2754	0.14	0.14	4.37	none
224	4.37	0	0.00	0.2417	0.15	0.15	4.37	none
225	4.37	0	0.00	0.2461	0.15	0.15	4.37	none
226	4.37	0	0.00	0.2520	0.15	0.15	4.37	none
227	4.37	0	0.00	0.2205	0.13	0.13	4.37	none
228	4.37	0.18	0.18	0.2205	0.13	-0.05	4.32	none
229	4.32	0	0.00	0.2114	0.13	0.13	4.37	none
230	4.37	0	0.00	0.2020	0.12	0.12	4.37	none
231	4.37	0	0.00	0.2106	0.13	0.13	4.37	none
232	4.37	0	0.00	0.2028	0.12	0.12	4.37	none
233	4.37	0	0.00	0.1791	0.11	0.11	4.37	none
234	4.37	0	0.00	0.2067	0.12	0.12	4.37	none
235	4.37	0	0.00	0.2110	0.13	0.13	4.37	none
236	4.37	0	0.00	0.2094	0.13	0.13	4.37	none
237	4.37	0.29	0.29	0.1941	0.12	-0.17	4.19	none
238	4.19	0.01	0.01	0.1445	0.09	0.08	4.27	none
239	4.27	0.08	0.08	0.1915	0.11	0.03	4.30	none
240	4.30	0	0.00	0.1776	0.11	0.11	4.37	none
241	4.37	0	0.00	0.2043	0.12	0.12	4.37	none
242	4.37	0	0.00	0.2094	0.13	0.13	4.37	none
243	4.37	0	0.00	0.1815	0.11	0.11	4.37	none
244	4.37	0	0.00	0.1791	0.11	0.11	4.37	none
245	4.37	0	0.00	0.1559	0.09	0.09	4.37	none
246	4.37	0	0.00	0.1854	0.11	0.11	4.37	none
247	4.37	0	0.00	0.1904	0.12	0.12	4.37	none
248	4.37	0	0.00	0.1951	0.12	0.12	4.37	none
249	4.37	0	0.00	0.1935	0.12	0.12	4.37	none
250	4.37	0	0.00	0.1961	0.12	0.12	4.37	none
251	4.37	0.41	0.41	0.1979	0.06	-0.35	4.02	none
252	4.02	0.33	0.33	0.1185	0.07	-0.26	3.76	none
253	3.76	0.26	0.26	0.197	0.07	-0.19	3.58	none
254	3.58	1.19	1.19	0.0921	0.06	-1.13	2.44	none
255	2.44	0.18	0.18	0.1035	0.06	-0.12	2.32	none
256	2.32	0	0.00	0.1335	0.08	0.08	2.40	none
257	2.40	0.02	0.02	0.1398	0.08	0.06	2.47	none
258	2.47	0	0.00	0.1394	0.08	0.08	2.55	none
259	2.55	0	0.00	0.1355	0.09	0.09	2.64	none
260	2.64	0	0.00	0.1657	0.10	0.10	2.74	none
261	2.74	0	0.00	0.1447	0.09	0.09	2.84	none
262	2.84	0	0.00	0.1442	0.10	0.10	2.93	none
263	2.93	0	0.00	0.1654	0.10	0.10	3.03	none
264	3.03	0	0.00	0.1701	0.10	0.10	3.14	none
265	3.14	0	0.00	0.1390	0.08	0.08	3.22	none
266	3.22	0	0.00	0.1319	0.08	0.08	3.30	none
267	3.30	0	0.00	0.1236	0.07	0.07	3.37	none
268	3.37	0	0.00	0.1455	0.09	0.09	3.46	none
269	3.46	0	0.00	0.1480	0.09	0.09	3.55	none
270	3.55	0	0.00	0.1311	0.08	0.08	3.63	none

271	3.63	0	0.00	0.1433	0.09	0.09	3.71	none
272	3.71	0	0.00	0.1524	0.09	0.09	3.81	none
273	3.81	0	0.00	0.1535	0.09	0.09	3.90	none
274	3.90	0	0.00	0.1496	0.09	0.09	3.99	none
275	3.99	0	0.00	0.1618	0.10	0.10	4.08	none
276	4.08	0	0.00	0.1591	0.10	0.10	4.18	none
277	4.18	0	0.00	0.1421	0.09	0.09	4.27	none
278	4.27	0	0.00	0.1437	0.09	0.09	4.35	none
279	4.35	0	0.00	0.1472	0.09	0.09	4.37	none
280	4.37	0	0.00	0.1719	0.08	0.08	4.37	none
281	4.37	0	0.00	0.1592	0.08	0.08	4.37	none
282	4.37	0	0.00	0.1451	0.09	0.09	4.37	none
283	4.37	0	0.00	0.1516	0.09	0.09	4.37	none
284	4.37	0	0.00	0.1382	0.08	0.08	4.37	none
285	4.37	0	0.00	0.1291	0.08	0.08	4.37	none
286	4.37	0	0.00	0.1260	0.08	0.08	4.37	none
287	4.37	0.23	0.23	0.1701	0.04	-0.19	4.18	none
288	4.18	0.08	0.08	0.0972	0.06	-0.02	4.16	none
289	4.16	0.33	0.33	0.0617	0.06	-0.27	3.88	none
290	3.88	0.03	0.03	0.1480	0.03	0.00	3.88	none
291	3.88	0	0.00	0.1579	0.03	0.03	3.92	none
292	3.92	0	0.00	0.1626	0.04	0.04	3.95	none
293	3.95	0	0.00	0.1726	0.04	0.04	4.00	none
294	4.00	0	0.00	0.1776	0.05	0.05	4.04	none
295	4.04	0	0.00	0.1823	0.05	0.05	4.09	none
296	4.09	0	0.00	0.1835	0.05	0.05	4.14	none
297	4.14	0	0.00	0.1818	0.05	0.05	4.19	none
298	4.19	0	0.00	0.1594	0.04	0.04	4.23	none
299	4.23	0	0.00	0.1661	0.04	0.04	4.27	none
300	4.27	0	0.00	0.1673	0.04	0.04	4.31	none
301	4.31	0.12	0.12	0.1406	0.02	-0.10	4.21	none
302	4.21	0	0.00	0.1524	0.03	0.03	4.24	none
303	4.24	0	0.00	0.1563	0.03	0.03	4.28	none
304	4.28	0	0.00	0.1630	0.04	0.04	4.32	none
305	4.32	0	0.00	0.1697	0.04	0.04	4.36	none
306	4.36	0	0.00	0.1685	0.04	0.04	4.37	none
307	4.37	0	0.00	0.1713	0.04	0.04	4.37	none
308	4.37	0	0.00	0.1736	0.04	0.04	4.37	none
309	4.37	0	0.00	0.1710	0.04	0.04	4.37	none
310	4.37	0	0.00	0.1858	0.05	0.05	4.37	none
311	4.37	0	0.00	0.1903	0.05	0.05	4.37	none
312	4.37	0	0.00	0.1799	0.05	0.05	4.37	none
313	4.37	0	0.00	0.1615	0.05	0.05	4.37	none
314	4.37	0	0.00	0.1791	0.05	0.05	4.37	none
315	4.37	0	0.00	0.1720	0.04	0.04	4.37	none
316	4.37	0	0.00	0.1713	0.04	0.04	4.37	none
317	4.37	0	0.00	0.1651	0.03	0.03	4.37	none
318	4.37	0.06	0.06	0.1551	0.03	-0.03	4.34	none
319	4.34	0	0.00	0.1425	0.03	0.03	4.37	none
320	4.37	0	0.00	0.1350	0.02	0.02	4.37	none
321	4.37	0	0.00	0.1350	0.02	0.02	4.37	none
322	4.37	0	0.00	0.1311	0.02	0.02	4.37	none
323	4.37	0	0.00	0.1370	0.02	0.02	4.37	none
324	4.37	0	0.00	0.1406	0.02	0.02	4.37	none
325	4.37	0	0.00	0.1433	0.03	0.03	4.37	none
326	4.37	0	0.00	0.1464	0.03	0.03	4.37	none
327	4.37	0	0.00	0.1413	0.02	0.02	4.37	none
328	4.37	0	0.00	0.1421	0.03	0.03	4.37	none
329	4.37	0.24	0.24	0.1370	0.02	-0.22	4.15	none
330	4.15	0	0.00	0.1378	0.02	0.02	4.17	none
331	4.17	0	0.00	0.1303	0.02	0.02	4.19	none
332	4.19	0	0.00	0.1374	0.02	0.02	4.21	none
333	4.21	0	0.00	0.1358	0.02	0.02	4.24	none
334	4.24	0	0.00	0.1394	0.02	0.02	4.26	none
335	4.26	0	0.00	0.1372	0.02	0.02	4.27	none
336	4.27	0	0.00	0.1386	0.02	0.02	4.30	none
337	4.30	0	0.00	0.1413	0.02	0.02	4.32	none
338	4.32	0	0.00	0.1382	0.02	0.02	4.35	none
339	4.35	0	0.00	0.1425	0.03	0.03	4.37	none
340	4.37	0.02	0.02	0.1370	0.02	0.00	4.37	none
341	4.37	0	0.00	0.1445	0.03	0.03	4.37	none
342	4.37	0	0.00	0.1354	0.02	0.02	4.37	none
343	4.37	0	0.00	0.1307	0.02	0.02	4.37	none
344	4.37	0	0.00	0.1295	0.02	0.02	4.37	none
345	4.37	0	0.00	0.1315	0.02	0.02	4.37	none
346	4.37	0	0.00	0.1327	0.02	0.02	4.37	none
347	4.37	0	0.00	0.1374	0.02	0.02	4.37	none
348	4.37	0	0.00	0.1409	0.02	0.02	4.37	none
349	4.37	0	0.00	0.1457	0.03	0.03	4.37	none
350	4.37	0	0.00	0.1386	0.02	0.02	4.37	none
351	4.37	0	0.00	0.1424	0.03	0.03	4.37	none
352	4.37	0	0.00	0.1496	0.03	0.03	4.37	none
353	4.37	0	0.00	0.1445	0.03	0.03	4.37	none
354	4.37	0	0.00	0.1406	0.02	0.02	4.37	none
355	4.37	0	0.00	0.1445	0.03	0.03	4.37	none
356	4.37	0	0.00	0.1406	0.02	0.02	4.37	none
357	4.37	0	0.00	0.1402	0.02	0.02	4.37	none
358	4.37	0	0.00	0.1402	0.02	0.02	4.37	none
359	4.37	0	0.00	0.1433	0.03	0.03	4.37	none
360	4.37	0	0.00	0.1458	0.02	0.02	4.37	none
361	4.37	0	0.00	0.1433	0.03	0.03	4.37	none
362	4.37	0	0.00	0.1488	0.03	0.03	4.37	none
363	4.37	0	0.00	0.1425	0.03	0.03	4.37	none
364	4.37	0	0.00	0.1508	0.03	0.03	4.37	none
365	4.37	0	0.00	0.1492	0.03	0.03	4.37	none
366	4.37	0	0.00	0.1453	0.03	0.03	4.37	none

APPENDIX J

EMERY COUNTY RESOLUTION NO. 10-5-94C

A RESOLUTION TO ESTABLISH A
FINANCIAL ASSURANCE TRUST FUND FOR CLOSURE OF
EMERY COUNTY LANDFILL

WHEREAS, the Emery County Landfill is required by its licensing body to establish a Financial Assurance Fund in the event of closure of the landfill; and,

WHEREAS, the Board of Commissioners has determined that it is appropriate to establish an expendable Trust Fund in the amount of \$133,000.00; and,

WHEREAS, a \$133,000.00 expendable Trust Fund is sufficient to fulfill the required financial assurance;

NOW, THEREFORE, the Board of County Commissioners of the County of Emery hereby resolves:

To establish a Financial Assurance Trust Fund in Emery County in accordance with Section 17-36-6(1)(m), Utah Code Annotated (1953), as amended. Said Fund shall be established in the amount of \$133,000.00, unless the Landfill's licensing agency determines on an annual basis that a greater amount is necessary, at which time the Fund may be increased by resolution. Interest earned on said funds shall be payable to the Emery County General Fund.

ADOPTED by the Board of County Commissioners of Emery County, State of Utah, this 5th day of October, 1994.

STATEMENT OF ACCOUNT
PTIF
 UTAH PUBLIC TREASURERS' INVESTMENT FUND

Richard K. Ellis, Utah State Treasurer, Fund Manager
 PO Box 142315
 350 N State Street, Suite 180
 Salt Lake City, Utah 84114-2315
 Local Call (801) 538-1042 Toll Free (800) 395-7665
www.treasurer.utah.gov

ESC-EMERY COUNTY LANDFILL
 EMERY COUNTY TREASURER
 PO BOX 595
 CASTLE DALE UT 84513

Account 2576 **Account Period** December 01, 2010 through December 31, 2010

Summary

Beginning Balance	\$ 304,472.01	Average Daily Balance	\$ 304,472.01
Deposits	\$ 126.20	Interest Earned	\$ 126.20
Withdrawals	\$ 0.00	360 Day Rate	0.4813
Ending Balance	\$ 304,598.21	365 Day Rate	0.4880

Date	Activity	Deposits	Withdrawals	Balance
12/01/2010	FORWARD BALANCE	\$ 0.00	\$ 0.00	\$ 304,472.01
12/31/2010	REINVESTMENT	\$ 126.20	\$ 0.00	\$ 304,598.21
12/31/2010	ENDING BALANCE	\$ 0.00	\$ 0.00	\$ 304,598.21

Emery County Landfill Operational Life (2% annual growth)

ACTIVE PHASE	YEAR	ESTIMATED DAILY MSW WASTE (Tons)	DAYS OF OPERATION	ESTIMATED YEARLY MSW WASTE (Tons)	ESTIMATED YEARLY MSW WASTE (Cu. Yds.)	CUMULATIVE MSW WASTE (Cu.Yards)	REMAINING WASTE CAPACITY (Cu. Yds.)	REMAINING LANDFILL CAPACITY (Percent)
							2,787,200	100.0%
I	2011	51.80	256	13,261	22,101	22,101	2,765,099	99.2%
I	2012	52.84	256	13,526	22,543	44,645	2,742,555	98.4%
I	2013	53.89	256	13,797	22,994	67,639	2,719,561	97.6%
I	2014	54.97	256	14,072	23,454	91,093	2,696,107	96.7%
II	2015	56.07	256	14,354	23,923	115,016	2,672,184	95.9%
II	2016	57.19	256	14,641	24,402	139,418	2,647,782	95.0%
II	2017	58.34	256	14,934	24,890	164,308	2,622,892	94.1%
II	2018	59.50	256	15,232	25,387	189,695	2,597,505	93.2%
II	2019	60.69	256	15,537	25,895	215,590	2,571,610	92.3%
II	2020	61.91	256	15,848	26,413	242,003	2,545,197	91.3%
II	2021	63.14	256	16,165	26,941	268,945	2,518,255	90.4%
II	2022	64.41	256	16,488	27,480	296,425	2,490,775	89.4%
II	2023	65.69	256	16,818	28,030	324,455	2,462,745	88.4%
III	2024	67.01	256	17,154	28,590	353,045	2,434,155	87.3%
III	2025	68.35	256	17,497	29,162	382,208	2,404,992	86.3%
III	2026	69.72	256	17,847	29,745	411,953	2,375,247	85.2%
III	2027	71.11	256	18,204	30,340	442,293	2,344,907	84.1%
III	2028	72.53	256	18,568	30,947	473,241	2,313,959	83.0%
III	2029	73.98	256	18,940	31,566	504,807	2,282,393	81.9%
III	2030	75.46	256	19,318	32,197	537,004	2,250,196	80.7%
III	2031	76.97	256	19,705	32,841	569,846	2,217,354	79.6%
III	2032	78.51	256	20,099	33,498	603,344	2,183,856	78.4%
III	2033	80.08	256	20,501	34,168	637,512	2,149,688	77.1%
III	2034	81.68	256	20,911	34,852	672,364	2,114,836	75.9%
III	2035	83.32	256	21,329	35,549	707,912	2,079,288	74.6%
III	2036	84.98	256	21,756	36,260	744,172	2,043,028	73.3%
III	2037	86.68	256	22,191	36,985	781,157	2,006,043	72.0%
III	2038	88.42	256	22,635	37,724	818,881	1,968,319	70.6%
III	2039	90.19	256	23,087	38,479	857,360	1,929,840	69.2%
III	2040	91.99	256	23,549	39,249	896,609	1,890,591	67.8%
III	2041	93.83	256	24,020	40,034	936,642	1,850,558	66.4%
III	2042	95.71	256	24,501	40,834	977,476	1,809,724	64.9%
III	2043	97.62	256	24,991	41,651	1,019,127	1,768,073	63.4%
IV	2044	99.57	256	25,490	42,484	1,061,611	1,725,589	61.9%
IV	2045	101.56	256	26,000	43,334	1,104,945	1,682,255	60.4%
IV	2046	103.59	256	26,520	44,200	1,149,145	1,638,055	58.8%
IV	2047	105.67	256	27,051	45,084	1,194,229	1,592,971	57.2%
IV	2048	107.78	256	27,592	45,986	1,240,215	1,546,985	55.5%
IV	2049	109.94	256	28,143	46,906	1,287,121	1,500,079	53.8%
IV	2050	112.13	256	28,706	47,844	1,334,964	1,452,236	52.1%
IV	2051	114.38	256	29,280	48,801	1,383,765	1,403,435	50.4%
IV	2052	116.66	256	29,866	49,777	1,433,542	1,353,658	48.6%
IV	2053	119.00	256	30,463	50,772	1,484,314	1,302,886	46.7%
IV	2054	121.38	256	31,073	51,788	1,536,101	1,251,099	44.9%
IV	2055	123.80	256	31,694	52,823	1,588,925	1,198,275	43.0%
IV	2056	126.28	256	32,328	53,880	1,642,805	1,144,395	41.1%
IV	2057	128.81	256	32,974	54,957	1,697,762	1,089,438	39.1%
IV	2058	131.38	256	33,634	56,057	1,753,819	1,033,381	37.1%
IV	2059	134.01	256	34,307	57,178	1,810,996	976,204	35.0%
IV	2060	136.69	256	34,993	58,321	1,869,318	917,882	32.9%
IV	2061	139.42	256	35,693	59,488	1,928,805	858,395	30.8%
V	2062	142.21	256	36,406	60,677	1,989,483	797,717	28.6%
V	2063	145.06	256	37,135	61,891	2,051,374	735,826	26.4%
V	2064	147.96	256	37,877	63,129	2,114,502	672,698	24.1%
V	2065	150.92	256	38,635	64,391	2,178,894	608,306	21.8%
V	2066	153.94	256	39,408	65,679	2,244,573	542,627	19.5%
V	2067	157.01	256	40,196	66,993	2,311,566	475,634	17.1%
V	2068	160.15	256	41,000	68,333	2,379,898	407,302	14.6%
V	2069	163.36	256	41,820	69,699	2,449,598	337,602	12.1%
V	2070	166.62	256	42,656	71,093	2,520,691	266,509	9.6%
V	2071	169.96	256	43,509	72,515	2,593,206	193,994	7.0%
V	2072	173.36	256	44,379	73,965	2,667,172	120,028	4.3%
V	2073	176.82	256	45,267	75,445	2,742,616	44,584	1.6%
V	2074	180.36	148	26,750	44,584	2,787,200	0	0.0%

Approximate Gross Air Space (Cubic Yards) = 3,484,000
 Net Air Space based upon a 20% reduction to allow for cover soils
 Approximate Net Air Space (Cubic Yards) = 2,787,200
 Conversion of tons of waste to Cubic Yards of waste is based upon an estimated conversion rate of 1200 pounds per one Cubic Yard of MSW waste.

LANDFILL CLOSURE COSTS

Section 1.0 - Engineering

Phase I

DATE TO BE CLOSED = **June 2015**
 AREA TO BE CLOSED = **159,000** SQ FT

Item #	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
1.1	Topographic Survey	LS	\$85	16	\$1,360
1.2	Boundary Survey for Closure	NA	\$85	8	\$680
1.3	Site Evaluation	NA	\$85	8	\$680
1.4	Development of Plans (Cover)	LS	\$75	80	\$6,000
1.5	Contract Administration - (Bidding and Award)	LA	\$85	32	\$2,720
1.6	Administrative Costs - (Certification of Final Cover and Closure Notice)	LS	\$85	8	\$680
1.7	Project Management - (Construction Observation and Testlog)	LS	\$45	80	\$3,600
1.8	Monitor Well Consultant Cost	NA			\$0
1.9	Other Environmental Permit Costs	NA			\$0
Engineering Subtotal					\$15,720

Section 2.0 - Construction

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
2.1	Final Cover System				
2.1.1	Site Preparation/ Site Regrading	ACRE	\$1,000	3.7	\$3,650
2.1.2	Gas Collection Layer/Pipes	Included below			\$0
2.1.3	Low permeability Layer (Included in Erosion Protection Layer)				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	NA			\$0
c	Soil Transportation	NA			\$0
d	Soil Placement	NA			\$0
e	Soil Amendment (compact)	NA			\$0
2.1.4	Low permeability Layer (Synthetic - If Applicable)				
a	Geotextile	NA			\$0
b	GCL	NA			\$0
c	Geomembrane (HDPE,PVC,LLDPE,etc...)	NA			\$0
2.1.5	Drainage Layer (Soil - If Applicable)				
a	Geotextile	NA			\$0
b	Sand/Gravel	NA			\$0
2.1.6	Drainage Layer (Synthetic - If Applicable)				
a	Geotextile	NA			\$0
b	Geonet/Geocomposite	NA			\$0
2.1.7	Erosion Protection Soil Layer				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	CY	\$0.50	11,778	\$5,889
c	Soil Transportation	CY	\$1.00	11,778	\$11,778
d	Soil Placement	CY	\$0.75	11,778	\$8,833
e	Soil Amendment (compact)	CY	\$0.50	11,778	\$5,889
2.1.8	Topsoil Layer				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	CY	\$0.50	2,944	\$1,472
c	Soil Transportation	CY	\$1.00	2,944	\$2,944
d	Soil Placement	CY	\$0.75	2,944	\$2,208
e	Soil Amendment	NA			\$0
2.1.9	Revegetation				
a	Seeding	ACRE	\$800	3.7	\$2,920
b	Fertilizing	ACRE	\$800	3.7	\$2,920
c	Mulch	ACRE	\$200	3.7	\$730
d	Tacifier	ACRE	\$200	3.7	\$730
2.2	Stormwater Protection Structures				
a	Culverts	NA			\$0
b	Pipes	NA			\$0
c	Ditches/Berms	NA			\$0
d	Detention Basins	NA			\$0
2.3	Gas Collection System				
a	Design	NA			\$0
b	Additional Gas Collection Wells and Connection	NA			\$0
c	THOX Unit - (Optional)	NA			\$0
2.4	Leachate Collection System				
a	Design	NA			\$0
b	Additional Equipment / Installation	NA			\$0
2.5	Groundwater Monitoring System				
a	Monitor Well Installation	NA			\$0
b	Monitor Well Abandonment	NA			\$0
2.6	Site Security				
a	Lighting, signs, etc...	NA			\$0
b	Fencing and Gates	NA			\$0
2.7	Miscellaneous				
a	Performance Bonds	LS	\$3,000	1	\$3,000
b	Contract/Legal fees	LS	\$3,000	1	\$3,000
Construction Subtotal					\$55,964

LS - LUMP SUM
 NA - NOT APPLICABLE
 EA - EACH
 CY - CUBIC YARD
 FT - FEET

Total \$71,684
 10% Contingency \$7,168
Subtotal Closure Cost \$78,853

LANDFILL CLOSURE COSTS

Section 1.0 - Engineering

Phase II

DATE TO BE CLOSED = August 2024
 AREA TO BE CLOSED = 285,000 SQ FT

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
1.1	Topographic Survey	LS	\$85	16	\$1,360
1.2	Boundary Survey for Closure	NA	\$85	8	\$680
1.3	Site Evaluation	NA	\$85	8	\$680
1.4	Development of Plans (Cover)	LS	\$75	80	\$6,000
1.5	Contract Administration - (Bidding and Award)	LA	\$85	32	\$2,720
1.6	Administrative Costs - (Certification of Final Cover and Closure Notice)	LS	\$85	8	\$680
1.7	Project Management - (Construction Observation and Testing)	LS	\$45	80	\$3,600
1.8	Monitor Well Consultant Cost	NA			\$0
1.9	Other Environmental Permit Costs	NA			\$0
Engineering Subtotal					\$15,720

Section 2.0 - Construction

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
2.1	Final Cover System				
2.1.1	Site Preparation/Site Regrading	ACRE	\$1,000	6.5	\$6,543
2.1.2	Gas Collection Layer/Pipes	Included below			\$0
2.1.3	Low permeability Layer (Included in Erosion Protection Layer)				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	NA			\$0
c	Soil Transportation	NA			\$0
d	Soil Placement	NA			\$0
e	Soil Amendment (compact)	NA			\$0
2.1.4	Low permeability Layer (Synthetic - If Applicable)				
a	Geotextile	NA			\$0
b	GCL	NA			\$0
c	Geomembrane (HDPE,PVC,LLDPE,etc...)	NA			\$0
2.1.5	Drainage Layer (Soil - If Applicable)				
a	Geotextile	NA			\$0
b	Sand/Gravel	NA			\$0
2.1.6	Drainage Layer (Synthetic - If Applicable)				
a	Geotextile	NA			\$0
b	Geonet/Geocomposite	NA			\$0
2.1.7	Erosion Protection Soil Layer				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	CY	\$0.50	21,111	\$10,556
c	Soil Transportation	CY	\$1.00	21,111	\$21,111
d	Soil Placement	CY	\$0.75	21,111	\$15,833
e	Soil Amendment (compact)	CY	\$0.50	21,111	\$10,556
2.1.8	Topsoil Layer				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	CY	\$0.50	5,278	\$2,639
c	Soil Transportation	CY	\$1.00	5,278	\$5,278
d	Soil Placement	CY	\$0.75	5,278	\$3,958
e	Soil Amendment	NA			\$0
2.1.9	Revegetation				
a	Seeding	ACRE	\$800	6.5	\$5,234
b	Fertilizing	ACRE	\$800	6.5	\$5,234
c	Mulch	ACRE	\$200	6.5	\$1,309
d	Tacifier	ACRE	\$200	6.5	\$1,309
2.2	Stormwater Protection Structures				
a	Culverts	NA			\$0
b	Pipes	NA			\$0
c	Ditches/Berns	NA			\$0
d	Detention Basins	NA			\$0
2.3	Gas Collection System				
a	Design	NA			\$0
b	Additional Gas Collection Wells and Connection	NA			\$0
c	THOX Unit - (Optional)	NA			\$0
2.4	Leachate Collection System				
a	Design	NA			\$0
b	Additional Equipment / Installation	NA			\$0
2.5	Groundwater Monitoring System				
a	Monitor Well Installation	NA			\$0
b	Monitor Well Abandonment	NA			\$0
2.6	Site Security				
a	Lighting, signs, etc...	NA			\$0
b	Fencing and Gates	NA			\$0
2.7	Miscellaneous				
a	Performance Bonds	LS	\$3,000	1	\$3,000
b	Contract/Legal fees	LS	\$3,000	1	\$3,000
Construction Subtotal					\$95,559

LS - LUMP SUM
 NA - NOT APPLICABLE
 EA - EACH
 CY - CUBIC YARD
 FT - FEET

Total \$111,279
 10% Contingency \$11,128
Subtotal Closure Cost \$122,407

LANDFILL CLOSURE COSTS

Section 1.0 - Engineering

Phase III

DATE TO BE CLOSED = February 2044
 AREA TO BE CLOSED = 490,000 SQ FT

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
1.1	Topographic Survey	LS	\$85	16	\$1,360
1.2	Boundary Survey for Closure	NA	\$85	8	\$680
1.3	Site Evaluation	NA	\$85	8	\$680
1.4	Development of Plans (Cover)	LS	\$75	80	\$6,000
1.5	Contract Administration - (Bidding and Award)	LA	\$85	32	\$2,720
1.6	Administrative Costs - (Certification of Final Cover and Closure Notice)	LS	\$85	8	\$680
1.7	Project Management - (Construction Observation and Testing)	LS	\$45	80	\$3,600
1.8	Monitor Well Consultant Cost	NA			\$0
1.9	Other Environmental Permit Costs	NA			\$0
Engineering Subtotal					\$15,720

Section 2.0 - Construction

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
2.1	Final Cover System				
2.1.1	Site Preparation/ Site Grading	ACRE	\$1,000	11.2	\$11,249
2.1.2	Gas Collection Layer/Pipes	Included below			\$0
2.1.3	Low permeability Layer (Included in Erosion Protection Layer)				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	NA			\$0
c	Soil Transportation	NA			\$0
d	Soil Placement	NA			\$0
e	Soil Amendment (compact)	NA			\$0
2.1.4	Low permeability Layer (Synthetic - If Applicable)				
a	Geotextile	NA			\$0
b	GCL	NA			\$0
c	Geomembrane (HDPE,PVC,LLDPE,etc...)	NA			\$0
2.1.5	Drainage Layer (Soil - If Applicable)				
a	Geotextile	NA			\$0
b	Sand/Gravel	NA			\$0
2.1.6	Drainage Layer (Synthetic - If Applicable)				
a	Geotextile	NA			\$0
b	Geonet/Geocomposite	NA			\$0
2.1.7	Erosion Protection Soil Layer				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	CY	\$0.50	36,296	\$18,148
c	Soil Transportation	CY	\$1.00	36,296	\$36,296
d	Soil Placement	CY	\$0.75	36,296	\$27,222
e	Soil Amendment (compact)	CY	\$0.50	36,296	\$18,148
2.1.8	Topsoil Layer				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	CY	\$0.50	9,074	\$4,537
c	Soil Transportation	CY	\$1.00	9,074	\$9,074
d	Soil Placement	CY	\$0.75	9,074	\$6,806
e	Soil Amendment	NA			\$0
2.1.9	Vegetation				
a	Seeding	ACRE	\$800	11.2	\$8,999
b	Fertilizing	ACRE	\$800	11.2	\$8,999
c	Mulch	ACRE	\$200	11.2	\$2,250
d	Tacifier	ACRE	\$200	11.2	\$2,250
2.2	Stormwater Protection Structures				
a	Culverts	NA			\$0
b	Pipes	NA			\$0
c	Ditches/Berms	NA			\$0
d	Detention Basins	NA			\$0
2.3	Gas Collection System				
a	Design	NA			\$0
b	Additional Gas Collection Wells and Connection	NA			\$0
c	THOX Unit - (Optional)	NA			\$0
2.4	Leachate Collection System				
a	Design	NA			\$0
b	Additional Equipment / Installation	NA			\$0
2.5	Groundwater Monitoring System				
a	Monitor Well Installation	NA			\$0
b	Monitor Well Abandonment	NA			\$0
2.6	Site Security				
a	Lighting, signs, etc...	NA			\$0
b	Fencing and Gates	NA			\$0
2.7	Miscellaneous				
a	Performance Bonds	LS	\$3,000	1	\$3,000
b	Contract/Legal fees	LS	\$3,000	1	\$3,000
Construction Subtotal					\$159,978

LS - LUMP SUM
 NA - NOT APPLICABLE
 EA - EACH
 CY - CUBIC YARD
 FT - FEET

Total \$175,698
 10% Contingency \$17,570
Subtotal Closure Cost \$193,268

LANDFILL CLOSURE COSTS

Section 1.0 - Engineering

Phase IV

DATE TO BE CLOSED = July 2062

AREA TO BE CLOSED = 494,000 SQ FT

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
1.1	Topographic Survey	LS	\$85	16	\$1,360
1.2	Boundary Survey for Closure	NA	\$85	8	\$680
1.3	Site Evaluation	NA	\$85	8	\$680
1.4	Development of Plans (Cover)	LS	\$75	80	\$6,000
1.5	Contract Administration - (Bidding and Award)	LA	\$85	32	\$2,720
1.6	Administrative Costs - (Certification of Final Cover and Closure Notice)	LS	\$85	8	\$680
1.7	Project Management - (Construction Observation and Testing)	LS	\$45	80	\$3,600
1.8	Monitor Well Consultant Cost	NA			\$0
1.9	Other Environmental Permit Costs	NA			\$0
Engineering Subtotal					\$15,720

Section 2.0 - Construction

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
2.1	Final Cover System				
2.1.1	Site Preparation/ Site Regrading	ACRE	\$1,000	11.3	\$11,341
2.1.2	Gas Collection Layer/Pipes	Included below			\$0
2.1.3	<i>Low permeability Layer (Included in Erosion Protection Layer)</i>				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	NA			\$0
c	Soil Transportation	NA			\$0
d	Soil Placement	NA			\$0
e	Soil Amendment (compact)	NA			\$0
2.1.4	<i>Low permeability Layer (Synthetic - If Applicable)</i>				
a	Geotextile	NA			\$0
b	GCL	NA			\$0
c	Geomembrane (HDPE, PVC, LLDPE, etc...)	NA			\$0
2.1.5	<i>Drainage Layer (Soil - If Applicable)</i>				
a	Geotextile	NA			\$0
b	Sand/Gravel	NA			\$0
2.1.6	<i>Drainage Layer (Synthetic - If Applicable)</i>				
a	Geotextile	NA			\$0
b	Geonet/Geocomposite	NA			\$0
2.1.7	<i>Erosion Protection Soil Layer</i>				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	CY	\$0.50	36,593	\$18,296
c	Soil Transportation	CY	\$1.00	36,593	\$36,593
d	Soil Placement	CY	\$0.75	36,593	\$27,444
e	Soil Amendment (compact)	CY	\$0.50	36,593	\$18,296
2.1.8	<i>Topsoil Layer</i>				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	CY	\$0.50	9,148	\$4,574
c	Soil Transportation	CY	\$1.00	9,148	\$9,148
d	Soil Placement	CY	\$0.75	9,148	\$6,861
e	Soil Amendment	NA			\$0
2.1.9	<i>Revegetation</i>				
a	Seeding	ACRE	\$800	11.3	\$9,073
b	Fertilizing	ACRE	\$800	11.3	\$9,073
c	Mulch	ACRE	\$200	11.3	\$2,268
d	Tacifier	ACRE	\$200	11.3	\$2,268
2.2	Stormwater Protection Structures				
a	Culverts	NA			\$0
b	Pipes	NA			\$0
c	Ditches/Berms	NA			\$0
d	Detention Basins	NA			\$0
2.3	Gas Collection System				
a	Design	NA			\$0
b	Additional Gas Collection Wells and Connection	NA			\$0
c	THOX Unit - (Optional)	NA			\$0
2.4	Leachate Collection System				
a	Design	NA			\$0
b	Additional Equipment / Installation	NA			\$0
2.5	Groundwater Monitoring System				
a	Monitor Well Installation	NA			\$0
b	Monitor Well Abandonment	NA			\$0
2.6	Site Security				
a	Lighting, signs, etc...	NA			\$0
b	Fencing and Gates	NA			\$0
2.7	Miscellaneous				
a	Performance Bonds	LS	\$3,000	1	\$3,000
b	Contract/Legal fees	LS	\$3,000	1	\$3,000
Construction Subtotal					\$161,235

LS - LUMP SUM
 NA - NOT APPLICABLE
 EA - EACH
 CY - CUBIC YARD
 FT - FEET

Total \$176,955
10% Contingency \$17,696
Subtotal Closure Cost \$194,651

LANDFILL CLOSURE COSTS

Section 1.0 - Engineering

Phase V

DATE TO BE CLOSED = May 2074
 AREA TO BE CLOSED = 677,000 SQ FT

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
1.1	Topographic Survey	LS	\$85	16	\$1,360
1.2	Boundary Survey for Closure	NA	\$85	8	\$680
1.3	Site Evaluation	NA	\$85	8	\$680
1.4	Development of Plans (Cover)	LS	\$75	80	\$6,000
1.5	Contract Administration - (Bidding and Award)	LA	\$85	32	\$2,720
1.6	Administrative Costs - (Certification of Final Cover and Closure Notice)	LS	\$85	8	\$680
1.7	Project Management - (Construction Observation and Testing)	LS	\$45	80	\$3,600
1.8	Monitor Well Consultant Cost	NA			\$0
1.9	Other Environmental Permit Costs	NA			\$0
Engineering Subtotal					\$15,720

Section 2.0 - Construction

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
2.1	Final Cover System				
2.1.1	Site Preparation/ Site Regrading	ACRE	\$1,000	15.5	\$15,542
2.1.2	Gas Collection Layer/Pipes	Included below			\$0
2.1.3	Low permeability Layer (Included in Erosion Protection Layer)				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	NA			\$0
c	Soil Transportation	NA			\$0
d	Soil Placement	NA			\$0
e	Soil Amendment (compact)	NA			\$0
2.1.4	Low permeability Layer (Synthetic - If Applicable)				
a	Geotextile	NA			\$0
b	GCL	NA			\$0
c	Geomembrane (HDPE,PVC,LLDPE,etc.)	NA			\$0
2.1.5	Drainage Layer (Soil - If Applicable)				
a	Geotextile	NA			\$0
b	Sand/Gravel	NA			\$0
2.1.6	Drainage Layer (Synthetic - If Applicable)				
a	Geotextile	NA			\$0
b	Geonet/Geocomposite	NA			\$0
2.1.7	Erosion Protection Soil Layer				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	CY	\$0.50	50,148	\$25,074
c	Soil Transportation	CY	\$1.00	50,148	\$50,148
d	Soil Placement	CY	\$0.75	50,148	\$37,611
e	Soil Amendment (compact)	CY	\$0.50	50,148	\$25,074
2.1.8	Topsoil Layer				
a	Soil Purchase	NA			\$0
b	Soil Processing (load)	CY	\$0.50	12,537	\$6,269
c	Soil Transportation	CY	\$1.00	12,537	\$12,537
d	Soil Placement	CY	\$0.75	12,537	\$9,403
e	Soil Amendment	NA			\$0
2.1.9	Revegetation				
a	Seeding	ACRE	\$800	15.5	\$12,433
b	Fertilizing	ACRE	\$800	15.5	\$12,433
c	Mulch	ACRE	\$200	15.5	\$3,108
d	Tacifier	ACRE	\$200	15.5	\$3,108
2.2	Stormwater Protection Structures				
a	Culverts	NA			\$0
b	Pipes	NA			\$0
c	Ditches/Berms	NA			\$0
d	Detention Basins	NA			\$0
2.3	Gas Collection System				
a	Design	NA			\$0
b	Additional Gas Collection Wells and Connection	NA			\$0
c	THOX Unit - (Optional)	NA			\$0
2.4	Leachate Collection System				
a	Design	NA			\$0
b	Additional Equipment / Installation	NA			\$0
2.5	Groundwater Monitoring System				
a	Monitor Well Installation	NA			\$0
b	Monitor Well Abandonment	NA			\$0
2.6	Site Security				
a	Lighting, signs, etc...	NA			\$0
b	Fencing and Gates	NA			\$0
2.7	Miscellaneous				
a	Performance Bonds	LS	\$3,000	1	\$3,000
b	Contract/Legal fees	LS	\$3,000	1	\$3,000
Construction Subtotal					\$218,741

LS - LUMP SUM
 NA - NOT APPLICABLE
 EA - EACH
 CY - CUBIC YARD
 FT - FEET

Total \$234,461
 10% Contingency \$23,446
Subtotal Closure Cost \$257,907

LANDFILL POST-CLOSURE COSTS (30 YEARS)

Section 1.0 - Engineering

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
1.1	Post-Closure Plan	NA			\$0
1.2	Annual Report (including results from gas, leachate, and ground water sampling - details of maintenance performed)	EA	\$500	30	\$15,000
a	Semiannual Site Inspections	EA	\$80	60	\$4,800
b	Plan Update	EA	\$100	30	\$3,000
Engineering Subtotal					\$22,800

Section 2.0 - Gas Collection System - Sampling

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
2.1	Sample Collection	NA			\$0
2.2	Sample Analysis	NA			\$0
2.3	Report (Part of Annual Report)	NA			\$0
Gas Collection System - Sampling Subtotal					\$0

Section 3.0 - Leachate Collection System - Sampling

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
2.1	Sample Collection	NA			\$0
2.2	Sample Analysis	NA			\$0
2.3	Report (Part of Annual Report)	NA			\$0
Leachate Collection System - Sampling Subtotal					\$0

Section 4.0 - Ground Water Monitoring System - Sampling

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
3.1	Sample Collection	NA			\$0
3.2	Sample Analysis	NA			\$0
3.3	Report (Part of Annual Report)	NA			\$0
Ground Water Collection System - Sampling Subtotal					\$0

Section 5.0 - Facility Operations and Maintenance

Item	Description	Unit Measure	Cost/Unit	No. Units	Total Cost
4.1	Cover				
a	Soil Replacement	LS	\$500	30	\$15,000
b	Vegetation/Reseeding	LS	\$300	30	\$9,000
4.2	Storm Water Protection Structures				
a	Ditch and Culvert Maintenance	LS	\$200	30	\$6,000
b	Berm and Basin Maintenance	LS	\$200	30	\$6,000
4.3	Gas Collection System				
a	System Operation	NA			\$0
b	System Repair	NA			\$0
4.4	Leachate Collection System				
a	System Operation	NA			\$0
b	System Repair	NA			\$0
4.5	Ground Water Monitoring System				
a	System Operation	NA			\$0
b	System Repair	NA			\$0
4.6	Site Security				
a	Lighting, signs, etc.	LS	\$250	30	\$7,500
b	Fencing and Gates	LS	\$250	30	\$7,500
4.7	Miscellaneous				
a	Building Demolition	SF	\$0.60	5900	\$3,540
b					
Facility Operations and Maintenance Subtotal					\$54,540

Total	\$77,340
10% Contingency	\$7,734
Total Post-Closure Cost	\$85,074